

ASBESTOS BULK SAMPLING LOG

NAF MIDWAY

THE SZARAS COMPANIES

PAGE 1 of 1 DATE SAMPLES COLLECTED: November 23, 1993

SAMPLE ID NO	SAMPLE LOCATION / DESCRIPTION	ANALYTICAL RESULTS	FRIABLE	CONDITION	AMOUNT										
<table border="1" style="width: 100%; border-collapse: collapse;"> <tr> <td style="width: 30%;">BUILDING NUMBER 619</td> <td style="width: 35%;">BUILDING NAME Pacific Cable House</td> <td colspan="3">BUILDING DESCRIPTION 1 Story</td> </tr> <tr> <td>TSC PROJECT NUMBER 865</td> <td>TSC INSPECTOR J. Kain and B. Kain</td> <td colspan="3">TSC LABORATORY ID No. 120293C</td> </tr> </table>						BUILDING NUMBER 619	BUILDING NAME Pacific Cable House	BUILDING DESCRIPTION 1 Story			TSC PROJECT NUMBER 865	TSC INSPECTOR J. Kain and B. Kain	TSC LABORATORY ID No. 120293C		
BUILDING NUMBER 619	BUILDING NAME Pacific Cable House	BUILDING DESCRIPTION 1 Story													
TSC PROJECT NUMBER 865	TSC INSPECTOR J. Kain and B. Kain	TSC LABORATORY ID No. 120293C													
INTERIOR:															
A1123-26	Basement north end Brown sheet vinyl	Tile - None detected Mastic - 10% Chrysotile	Yes	Fair	110 sq. ft.										
A1123-27	Kitchen south end Red stamped pattern 12" x 12" floor tile	Tile - 2% Chrysotile Mastic - 1-2% Chrysotile	No	Fair	300 sq. ft.										
No sample collected	Shower Transite panel Same as sample A1123-10, building 623	25% Chrysotile	No	Good	500 sq. ft.										
No sample collected	Green with white streaks 9" x 9" floor tile Same as sample A1123-7, building 623	15% Chrysotile	No	Fair	7,000 sq. ft. mixed with next item										
No sample collected	Black with white streaks 9" x 9" floor tile Same as sample A1123-18, building 643	10% Chrysotile	No	Fair	Mixed with above item										
No sample collected	Green with white streaks 9" x 9" floor tile Same as sample A1123-7, building 623	15% Chrysotile	No	Fair	Mixed with 7,000 sq. ft.										
EXTERIOR:															
A1123-30	West side Pipe elbow	25% Chrysotile	Yes	Poor	100 lin. ft.										
A1123-29	Southwest side wall White stucco	None detected	No	Fair	5,000 sq. ft.										
A1123-28	Southeast side White & black shingles & roof core	None detected	No	Poor	3,400 sq. ft.										

It is assumed that anywhere the above identified asbestos containing building materials are found in the building, that those materials also contain asbestos and should be treated as such.

LEAD BASED PAINT SAMPLING LOG

NAF MIDWAY

THE SZARAS COMPANIES

PAGE 1 of 1 DATE SAMPLES COLLECTED: November 23, 1993


SAMPLE ID NO	SAMPLE LOCATION / DESCRIPTION	ANALYTICAL RESULTS (PPM)	CONDITION	AMOUNT								
<table border="1" style="width: 100%; border-collapse: collapse;"> <tr> <td style="width: 30%;">BUILDING NUMBER 619</td> <td style="width: 35%;">BUILDING NAME Pacific Cable House</td> <td colspan="2">BUILDING DESCRIPTION 2 Story</td> </tr> <tr> <td>TSC PROJECT NUMBER 865</td> <td>TSC INSPECTOR J. Kain and B. Kain</td> <td colspan="2">TSC LABORATORY ID No. 120293A</td> </tr> </table>					BUILDING NUMBER 619	BUILDING NAME Pacific Cable House	BUILDING DESCRIPTION 2 Story		TSC PROJECT NUMBER 865	TSC INSPECTOR J. Kain and B. Kain	TSC LABORATORY ID No. 120293A	
BUILDING NUMBER 619	BUILDING NAME Pacific Cable House	BUILDING DESCRIPTION 2 Story										
TSC PROJECT NUMBER 865	TSC INSPECTOR J. Kain and B. Kain	TSC LABORATORY ID No. 120293A										
BASEMENT EXTERIOR NORTH END:												
L1123-33	White paint on wall	12,656.2	Poor	5,000 sq. ft.								
L1123-34	Blue paint on trim on window	149,382.0	Poor	1,500 sq. ft.								
EXTERIOR:												
L1123-40	Southeast side Green paint on door	13,879.3	Poor	1,500 sq. ft.								
L1123-41	Veranda east side Red deck paint	4,971.9	Poor	1,500 sq. ft.								
INTERIOR:												
L1123-35	Northwest wall north end White paint	3,152.1	Poor	8,200 sq. ft.								
L1123-36	Northwest side north end White paint on ceiling	2,784.6	Poor	3,100 sq. ft.								
L1123-37	Shower wall 1st floor Green paint	176.7	Poor	175 sq. ft.								
L1123-38	Hallway wall south end White paint	130,000.0	Poor	8,200 sq. ft.								
L1123-39	Kitchen south end White paint on ceiling	30,521.9	Poor	3,100 sq. ft.								

It is assumed that anywhere the above identified lead based paint materials are found in the building, that those materials also contain lead and should be treated as such.

55


A1123-29

A1123-30

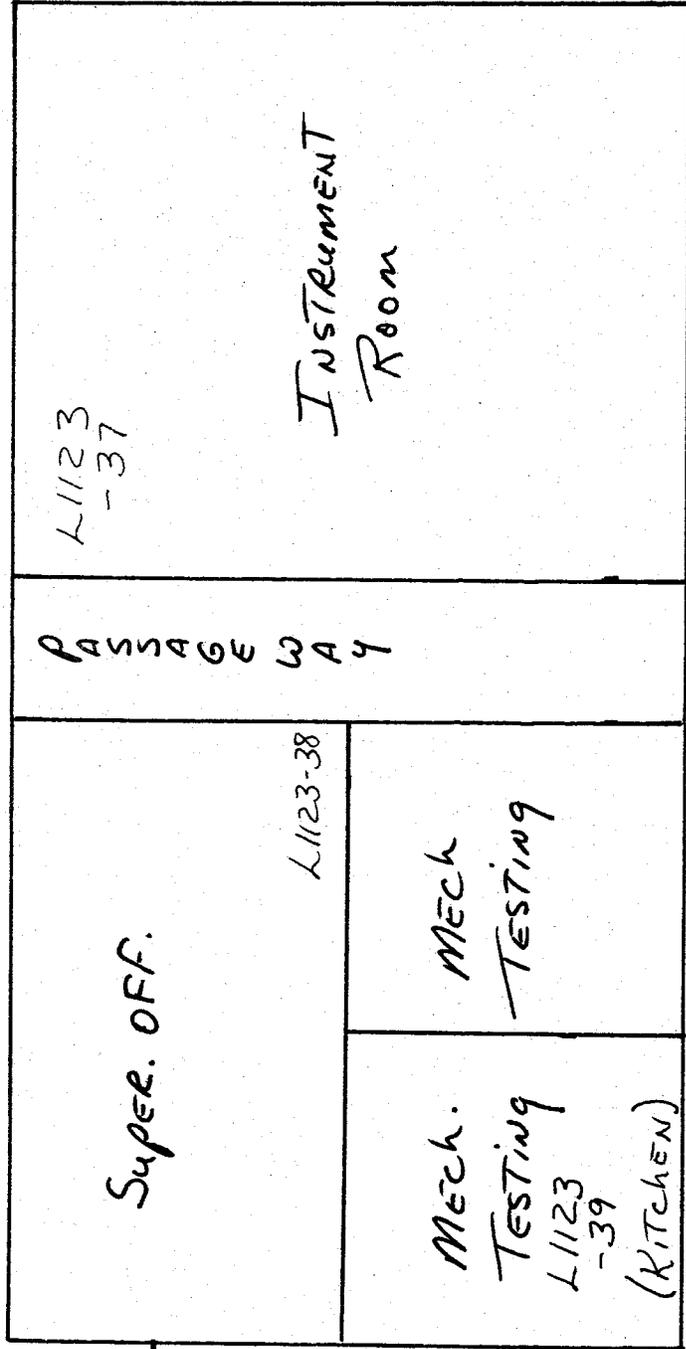

L1123-40


L1123-41



PG. 1 OF 2
 BID # 619
 CABLE HOUSE

(FIRST FLOOR)
 (FROM BLUEPRINT)


28

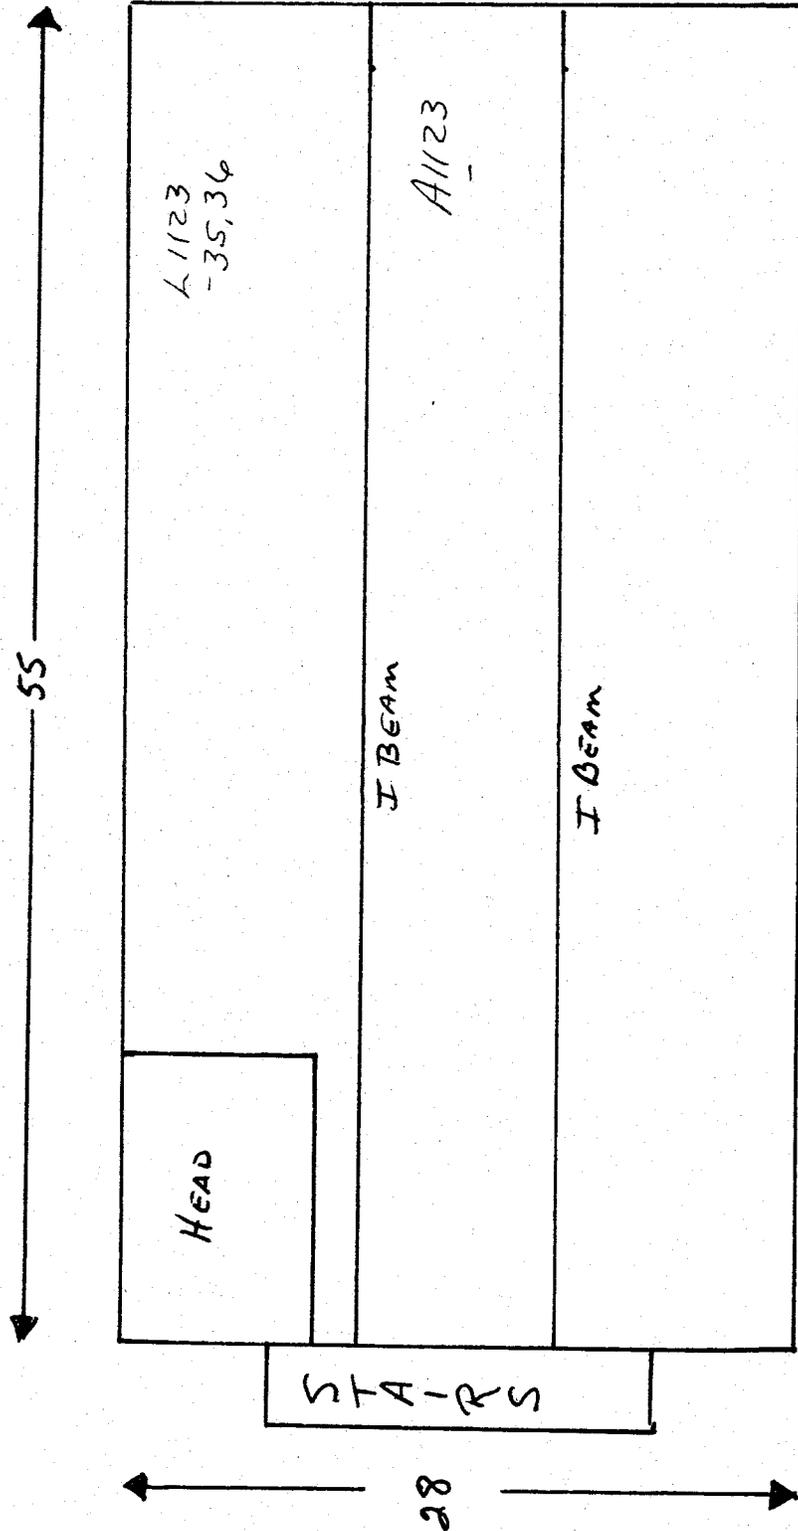

Roof
A1123-28

(BASEMENT)
(FROM BLUE PRINT)

PG. 2 OF 2
BID # 619
CABLE HOUSE

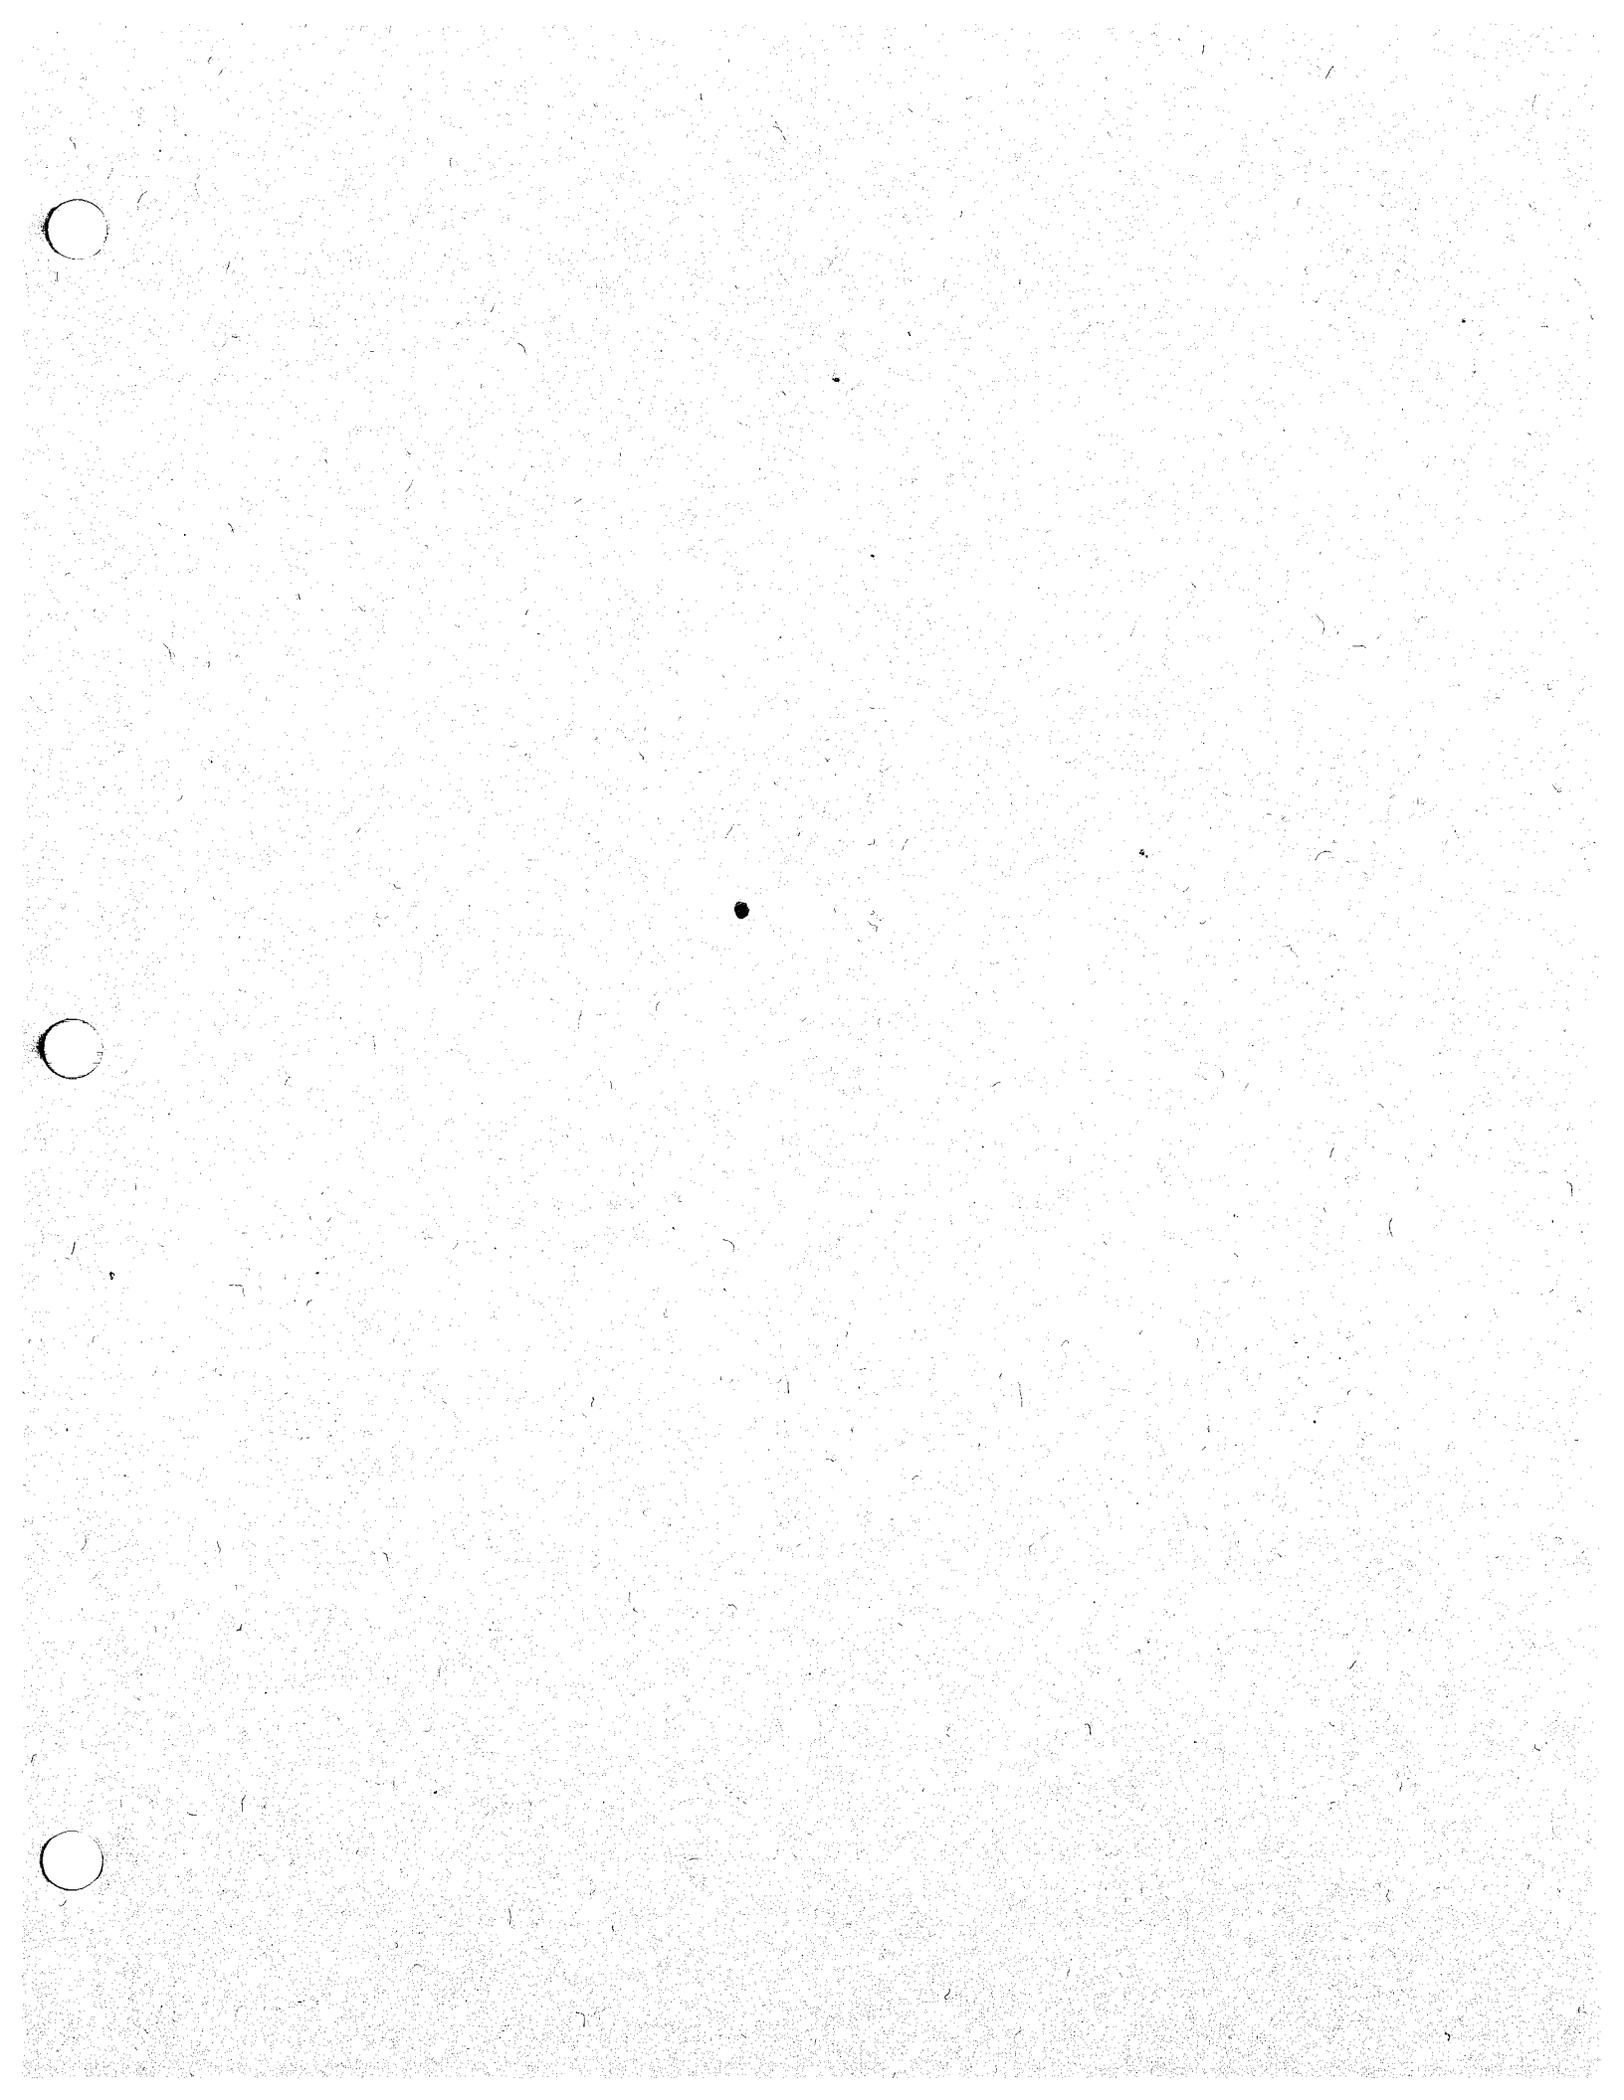

ASBESTOS BULK SAMPLING LOG

NAF MIDWAY

THE SZARAS COMPANIES

PAGE 1 of 1 DATE SAMPLES COLLECTED: November 23, 1993

SAMPLE ID NO	SAMPLE LOCATION / DESCRIPTION	ANALYTICAL RESULTS	FRIABLE	CONDITION	AMOUNT										
<table border="1" style="width: 100%; border-collapse: collapse;"> <tr> <td style="width: 30%;">BUILDING NUMBER 623</td> <td style="width: 35%;">BUILDING NAME Cable House</td> <td colspan="3">BUILDING DESCRIPTION 2 Story</td> </tr> <tr> <td>TSC PROJECT NUMBER 865</td> <td>TSC INSPECTOR J. Kain and B. Kain</td> <td colspan="3">TSC LABORATORY ID No. 120293C</td> </tr> </table>						BUILDING NUMBER 623	BUILDING NAME Cable House	BUILDING DESCRIPTION 2 Story			TSC PROJECT NUMBER 865	TSC INSPECTOR J. Kain and B. Kain	TSC LABORATORY ID No. 120293C		
BUILDING NUMBER 623	BUILDING NAME Cable House	BUILDING DESCRIPTION 2 Story													
TSC PROJECT NUMBER 865	TSC INSPECTOR J. Kain and B. Kain	TSC LABORATORY ID No. 120293C													
INTERIOR 1ST FLOOR:															
A1123-7	Kitchen south side Green with white streaks 9" x 9" floor tile	Tile - 15% Chrysotile Mastic - 8% Chrysotile	No	Fair	7,800 sq. ft. mixed with A1123-8 & 9										
A1123-8	Restroom Black with white streaks 9" x 9" floor tile	Tile - 10% Chrysotile Mastic - 10% Chrysotile	No	Fair	Mixed with A1123-7										
No sample collected	Shower and bath Transite panels Same as sample A1123-10, building 623	25% Chrysotile	No	Good	300 sq. ft.										
A1123-9	Kitchen Beige with brown streaks 12" x 12" floor tile	1% Chrysotile	No	Poor	Mixed with A1123-7										
A1123-10	Shower - Transite panels	25% Chrysotile	No	Fair	300 sq. ft.										
A1123-11	Far northwest corner Green with white streaks 9" x 9" floor tile	Tile - 12% Chrysotile	No	Fair	175 sq. ft.										
BASEMENT INTERIOR:															
A1123-12	Restroom, center apartment Tar paper on shower walls	None detected	No	Poor	100 sq. ft.										
A1123-13	Southeast side Blue with beige streaks 9" x 9" floor tile	Tile - 8% Chrysotile	No	Good	100 sq. ft.										
A1123-14	Southeast side Dark gray with white streaks 9" x 9" floor tile	Tile - 10% Chrysotile	No	Good	100 sq. ft.										
A1123-15	Living room south side Gary with orange and white streaks 9" x 9" floor tile	Tile - None detected Mastic - 20% Chrysotile	No	Good	Mixed with A1123-7										
A1123-16	EXTERIOR ROOF: South side Multi color shingles	None detected	No	Poor	3,400 sq. ft.										

It is assumed that anywhere the above identified asbestos containing building materials are found in the building, that those materials also contain asbestos and should be treated as such.

LEAD BASED PAINT SAMPLING LOG

NAF MIDWAY

THE SZARAS COMPANIES

PAGE 1 of 2 DATE SAMPLES COLLECTED: November 23, 1993

SAMPLE ID NO	SAMPLE LOCATION / DESCRIPTION	ANALYTICAL RESULTS (PPM)	CONDITION	AMOUNT								
<table border="1" style="width: 100%; border-collapse: collapse;"> <tr> <td style="width: 30%;">BUILDING NUMBER 623</td> <td style="width: 35%;">BUILDING NAME Pacific Cable House</td> <td colspan="2" style="width: 35%;">BUILDING DESCRIPTION 2 Story</td> </tr> <tr> <td>TSC PROJECT NUMBER 865</td> <td>TSC INSPECTOR J. Kain and B. Kain</td> <td colspan="2">TSC LABORATORY ID No. 120293A</td> </tr> </table>					BUILDING NUMBER 623	BUILDING NAME Pacific Cable House	BUILDING DESCRIPTION 2 Story		TSC PROJECT NUMBER 865	TSC INSPECTOR J. Kain and B. Kain	TSC LABORATORY ID No. 120293A	
BUILDING NUMBER 623	BUILDING NAME Pacific Cable House	BUILDING DESCRIPTION 2 Story										
TSC PROJECT NUMBER 865	TSC INSPECTOR J. Kain and B. Kain	TSC LABORATORY ID No. 120293A										
INTERIOR 1ST FLOOR:												
L1123-17	Kitchen south wall Off-white paint	29,502.7	Poor	36,000 sq. ft. mixed with L1123-18, 20, 21, 22, 23 & 24								
L1123-18	Kitchen south door Green paint	225,883.8	Poor	Mixed with L1123-17								
L1123-19	Kitchen south side White paint on ceiling	105,443.5	Poor	7,800 sq. ft. mixed with L1123-25 & 28								
INTERIOR:												
L1123-20	Northwest room northwest wall Green paint	35,931.1	Poor	Mixed with L1123-17								
L1123-21	Kitchen west wall White paint	161,155.9	Poor	Mixed with L1123-17								
L1123-22	Northwest wall Yellow paint	9,850.5	Poor	Mixed with L1123-17								
L1123-24	Basement kitchen northeast wall White glossy paint	9,921.9	Poor	Mixed with L1128-17								
L1123-25	Bedroom northwest side White paint on ceiling	2,384.4	Poor	Mixed with L1123-19								
L1123-26	Center apartment bathroom and shower Yellow paint on walls	12,604.2	Poor	600 sq. ft.								

It is assumed that anywhere the above identified lead based paint materials are found in the building, that those materials contain lead and should be treated as such.


North

95

L1123-27
A1123-15

L1123-26
A1123-12

L1123-25

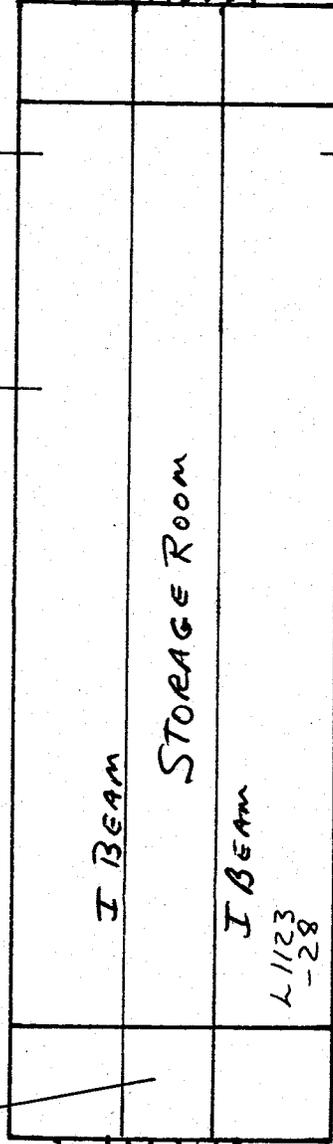

STAIRS

I BEAM

STORAGE ROOM

I BEAM

L1123-28

A1123-13,14

STAIRS

Roof
A1123-16

28

L1123-24

(BASEMENT)
(FROM BLUE PRINT)

Bld # 623

PG. 1 OF 2


Cable House

North

95

TRANSITE

28

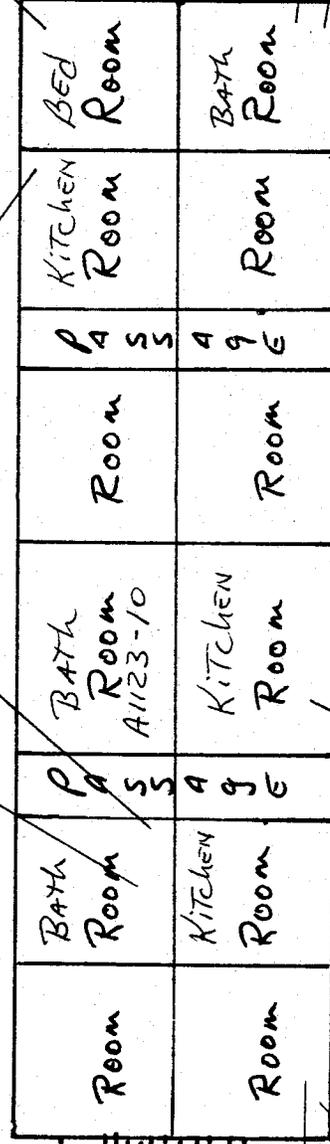

(C)


(B)

(A)

Bld # 623
 PG. 2 OF 2

Cable House

(FIRST FLOOR)
 (FROM BLUE PRINT)

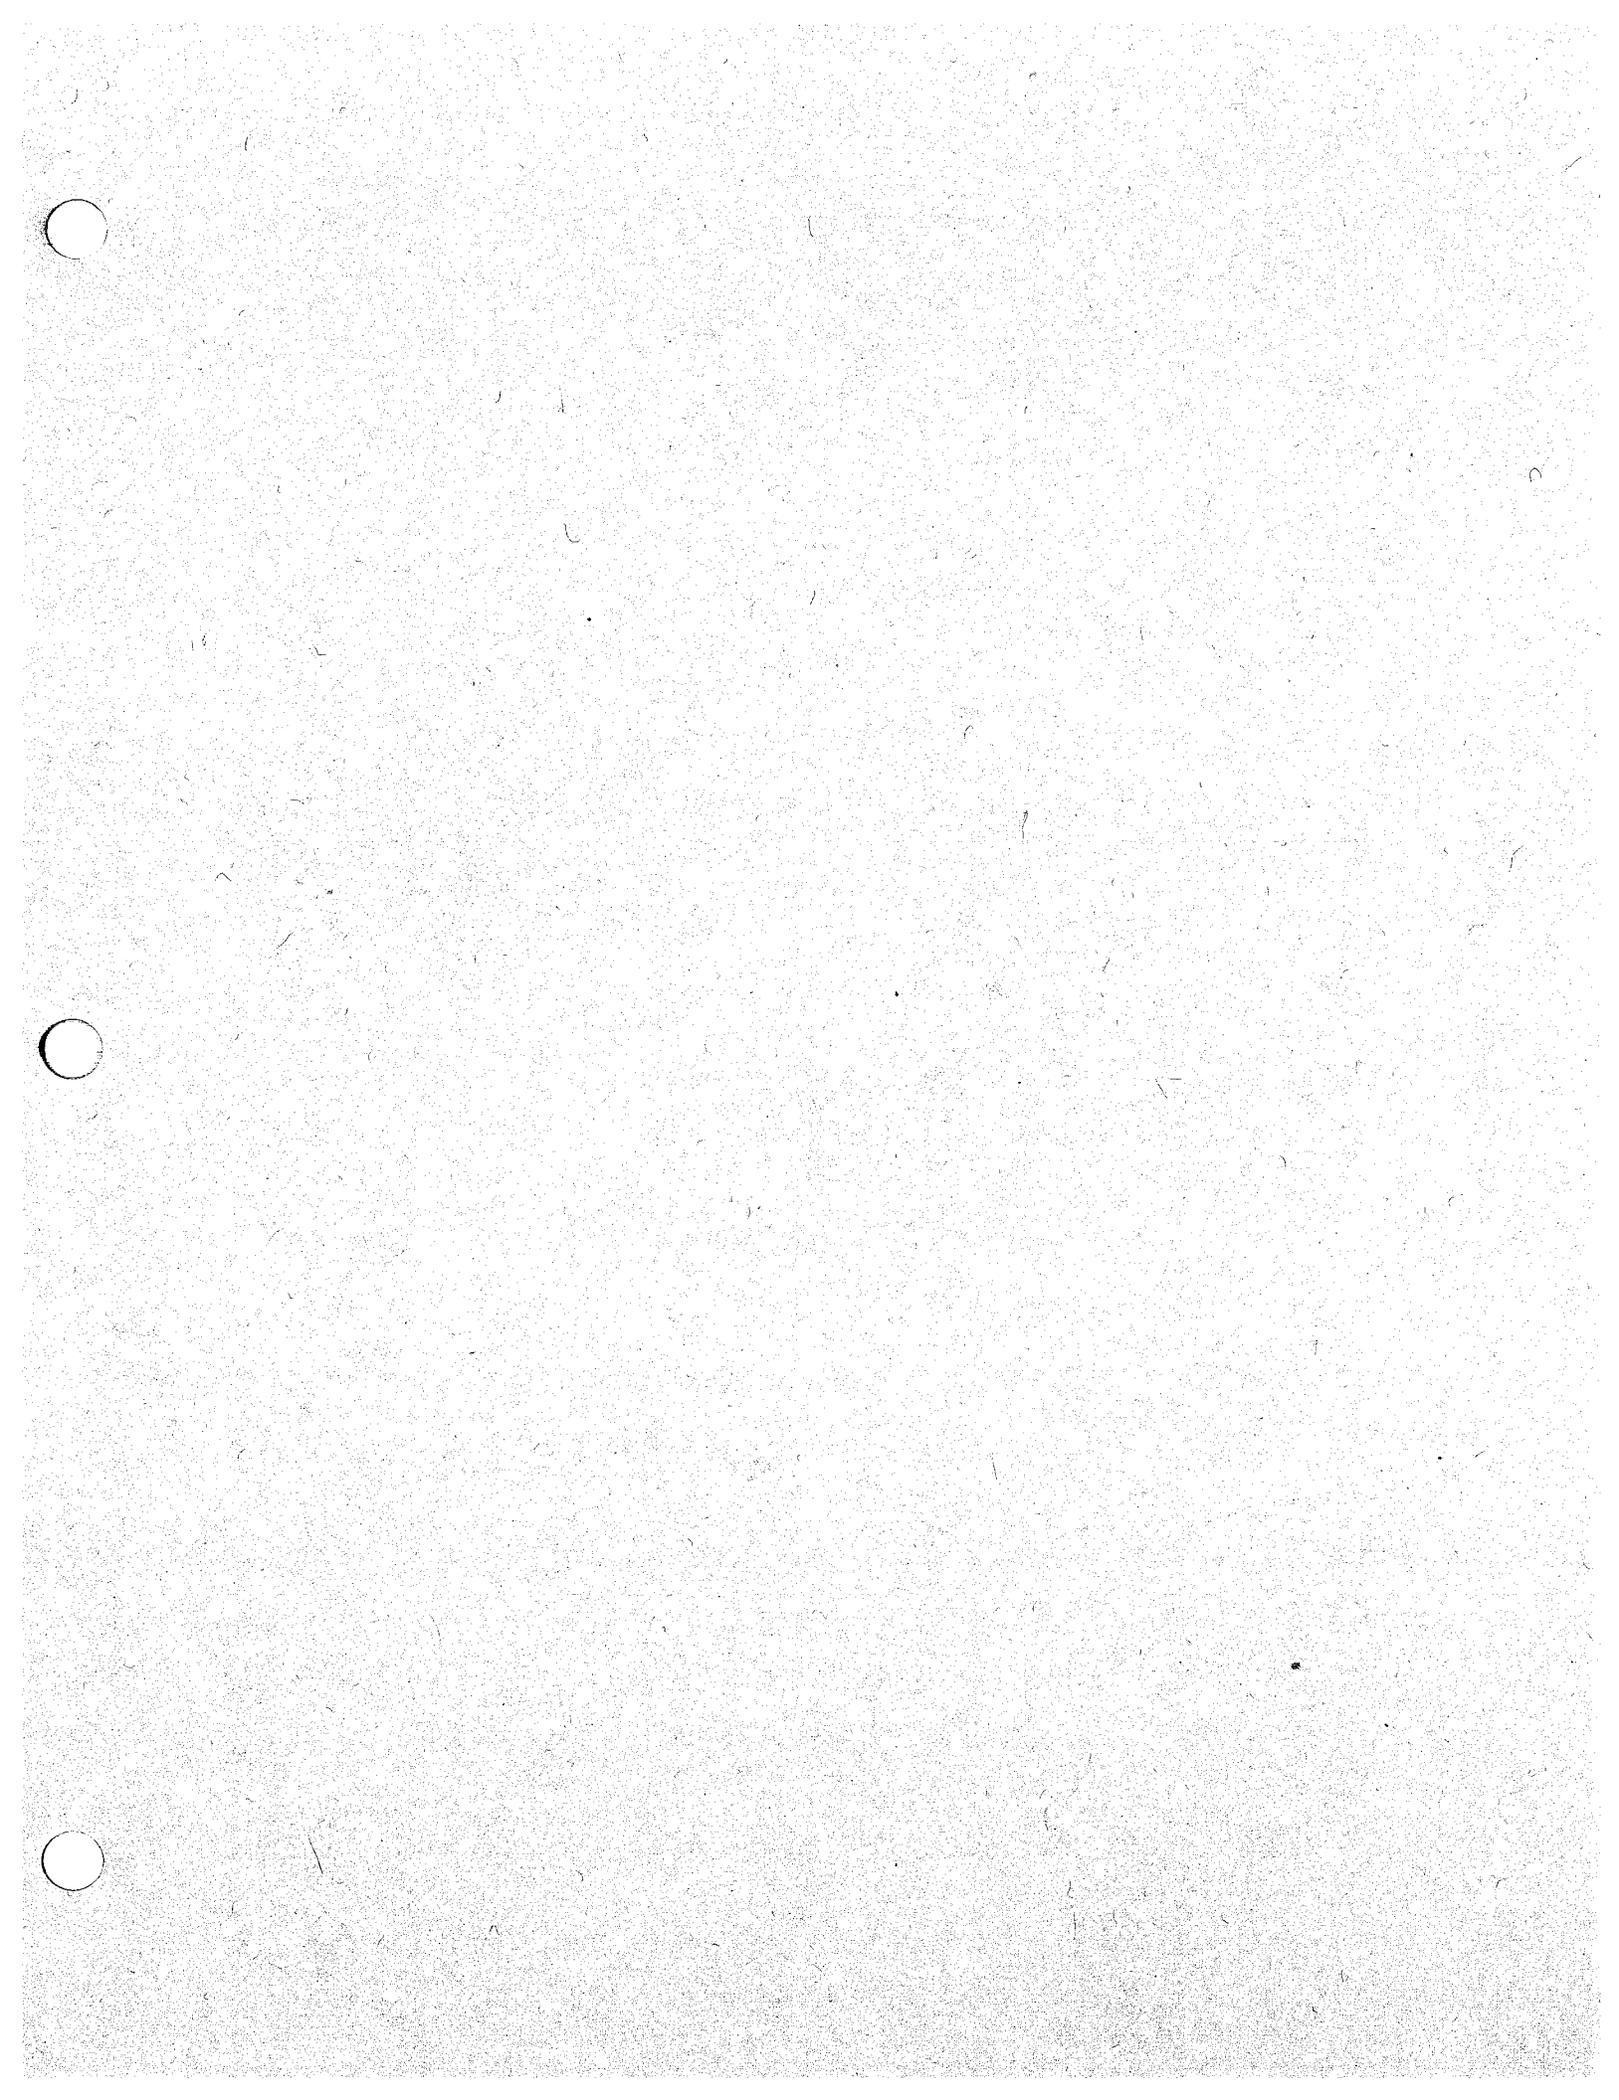

ASBESTOS BULK SAMPLING LOG

NAF MIDWAY

THE SZARAS COMPANIES

PAGE 1 of 1 DATE SAMPLES COLLECTED: November 24, 1993

SAMPLE ID NO	SAMPLE LOCATION / DESCRIPTION	ANALYTICAL RESULTS	FRIABLE	CONDITION	AMOUNT
BUILDING NUMBER 628		BUILDING NAME Pacific Cable House		BUILDING DESCRIPTION 2 Story	
TSC PROJECT NUMBER 865		TSC INSPECTOR J. Kain and B. Kain		TSC LABORATORY ID No. 120293D	
A1123-31	Exterior south side Pink stucco coating	None detected	No	Poor	5,000 sq. ft.
A1123-35	Roof core and multi color shingles	None detected	No	Fair	3,400 sq. ft.
No sample collected	Basement Black with white 9" x 9" floor tile Same as sample A1123-18, building 643	Tile - 10% Chrysotile Mastic - 12% Chrysotile	No	Fair	7,000 sq. ft.
INTERIOR 1ST FLOOR:					
A1123-32	Kitchen Red w/white streaks 9" x 9" floor tile	Tile - 6% Chrysotile Mastic - 6% Chrysotile	No	Fair	7,000 sq. ft. mixed with below
A1123-33	Kitchen Gray w/white streaks 9" x 9" floor tile	Tile - 5% Chrysotile Mastic - 3% Chrysotile	No	Fair	Mixed with A1123-32
A1123-34	Northwest side Concrete	None detected	No	Poor	7,000 sq. ft.
No sample collected	Black w/white 9" x 9" floor tile Same as sample A1123-7, building 642	10% Chrysotile	No	Fair	Mixed with A1123-32
No sample collected	Green w/white 9" x 9" floor tile Same as sample A1123-7, building 623	15% Chrysotile	No	Fair	Mixed with A1123-32

It is assumed that anywhere the above identified asbestos containing building materials are found in the building, that those materials also contain asbestos and should be treated as such.

LEAD BASED PAINT SAMPLING LOG


NAF MIDWAY

THE SZARAS COMPANIES

PAGE 1 of 1 DATE SAMPLES COLLECTED: November 24, 1993


SAMPLE ID NO	SAMPLE LOCATION / DESCRIPTION	ANALYTICAL RESULTS (PPM)	CONDITION	AMOUNT						
<table border="1" style="width: 100%; border-collapse: collapse; margin-bottom: 10px;"> <tr> <td style="width: 30%;">BUILDING NUMBER 628</td> <td style="width: 35%;">BUILDING NAME Pacific Cable House</td> <td style="width: 35%;">BUILDING DESCRIPTION 2 Story</td> </tr> <tr> <td>TSC PROJECT NUMBER 865</td> <td>TSC INSPECTOR J. Kain and B. Kain</td> <td>TSC LABORATORY ID No. 120293B</td> </tr> </table>					BUILDING NUMBER 628	BUILDING NAME Pacific Cable House	BUILDING DESCRIPTION 2 Story	TSC PROJECT NUMBER 865	TSC INSPECTOR J. Kain and B. Kain	TSC LABORATORY ID No. 120293B
BUILDING NUMBER 628	BUILDING NAME Pacific Cable House	BUILDING DESCRIPTION 2 Story								
TSC PROJECT NUMBER 865	TSC INSPECTOR J. Kain and B. Kain	TSC LABORATORY ID No. 120293B								
INTERIOR:										
L1123-42	Basement southwest White paint on wall	17,555.5	Poor	17,000 sq. ft. mixed with L1123-42, 47, 48 & 49						
L1123-43	Basement southwest side White paint on ceiling	3,028.4	Poor	6,200 sq. ft.						
L1123-44	Northeast side Green paint on wall	2,101.3	Poor	Mixed with L1123-42						
L1123-47	Northwest side Green paint on wall	131,781.9	Poor	Mixed with L1123-42						
L1123-48	Sitting room Beige paint on wall	178,324.5	Poor	Mixed with L1123-42						
L1123-49	Northeast side Blue/green paint on wall	12,634.4	Poor	Mixed with L1123-42						
EXTERIOR 1ST FLOOR:										
L1123-45	Southeast side Pink paint on wall	88,239.2	Poor	5,000 sq. ft.						
L1123-46	Southeast side Brown paint on trim	3,567.4	Poor	1,500 sq. ft.						

It is assumed that anywhere the above identified lead based paint materials are found in the building, that those materials also contain lead and should be treated as such.

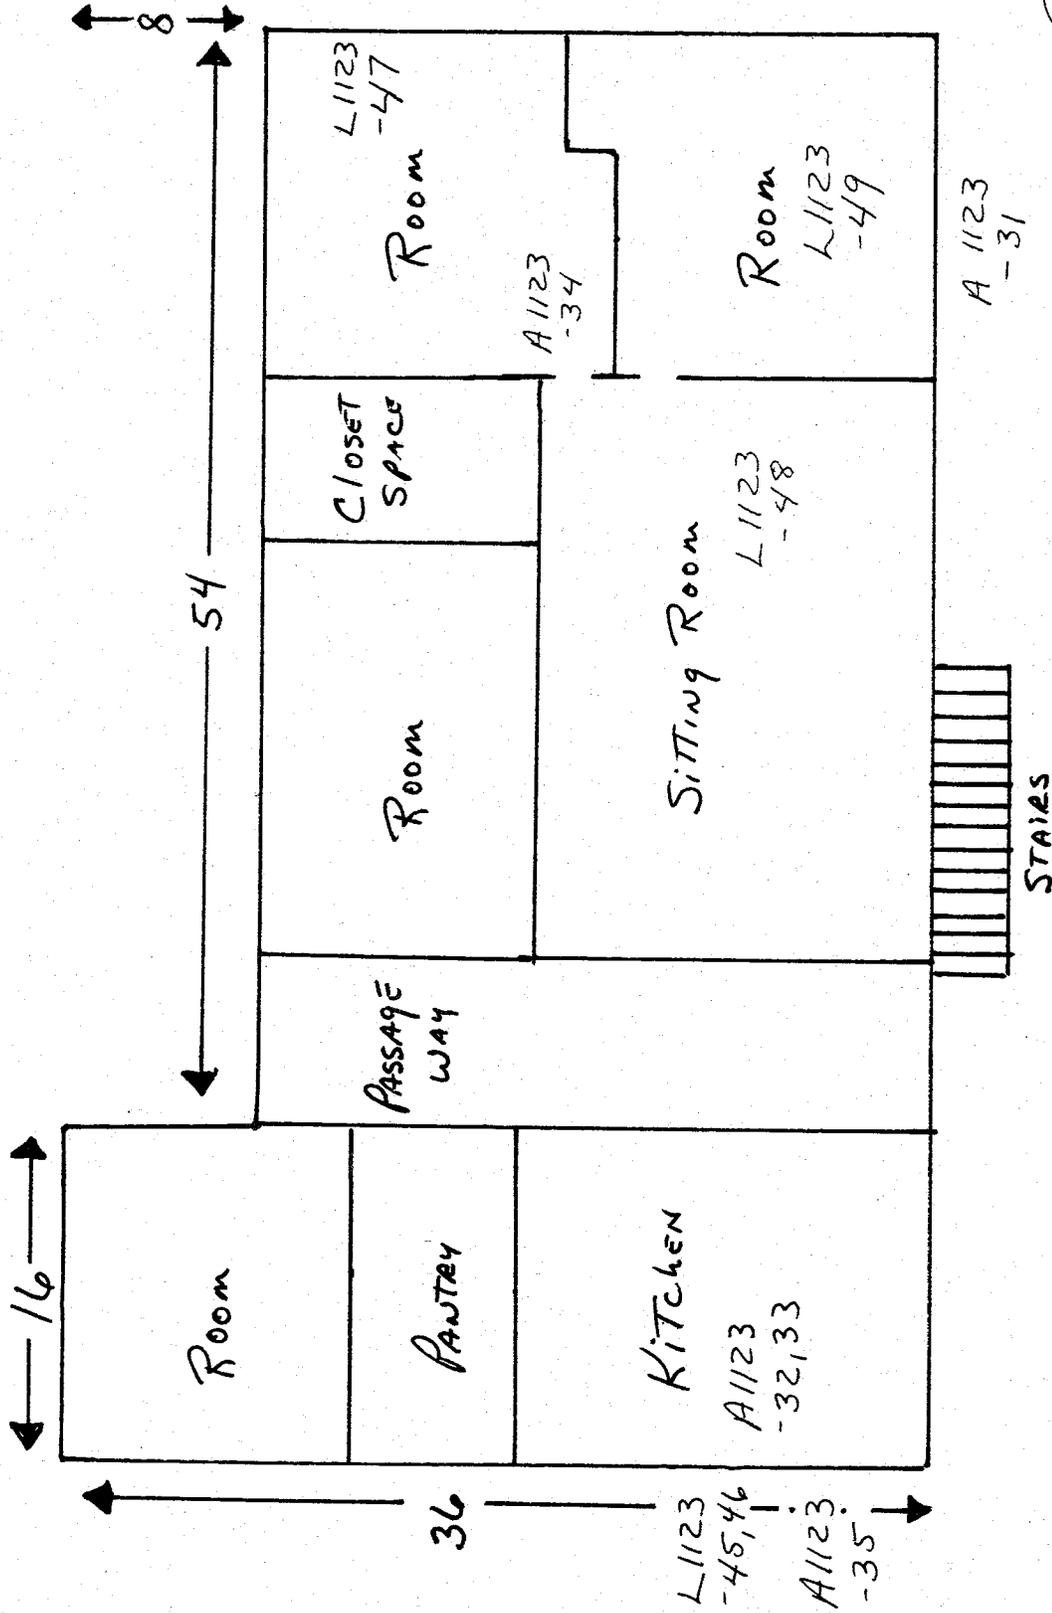

Bld # 628
 Cable House
 PG. 1 OF 2

(First Floor)
 (From Blue Print)

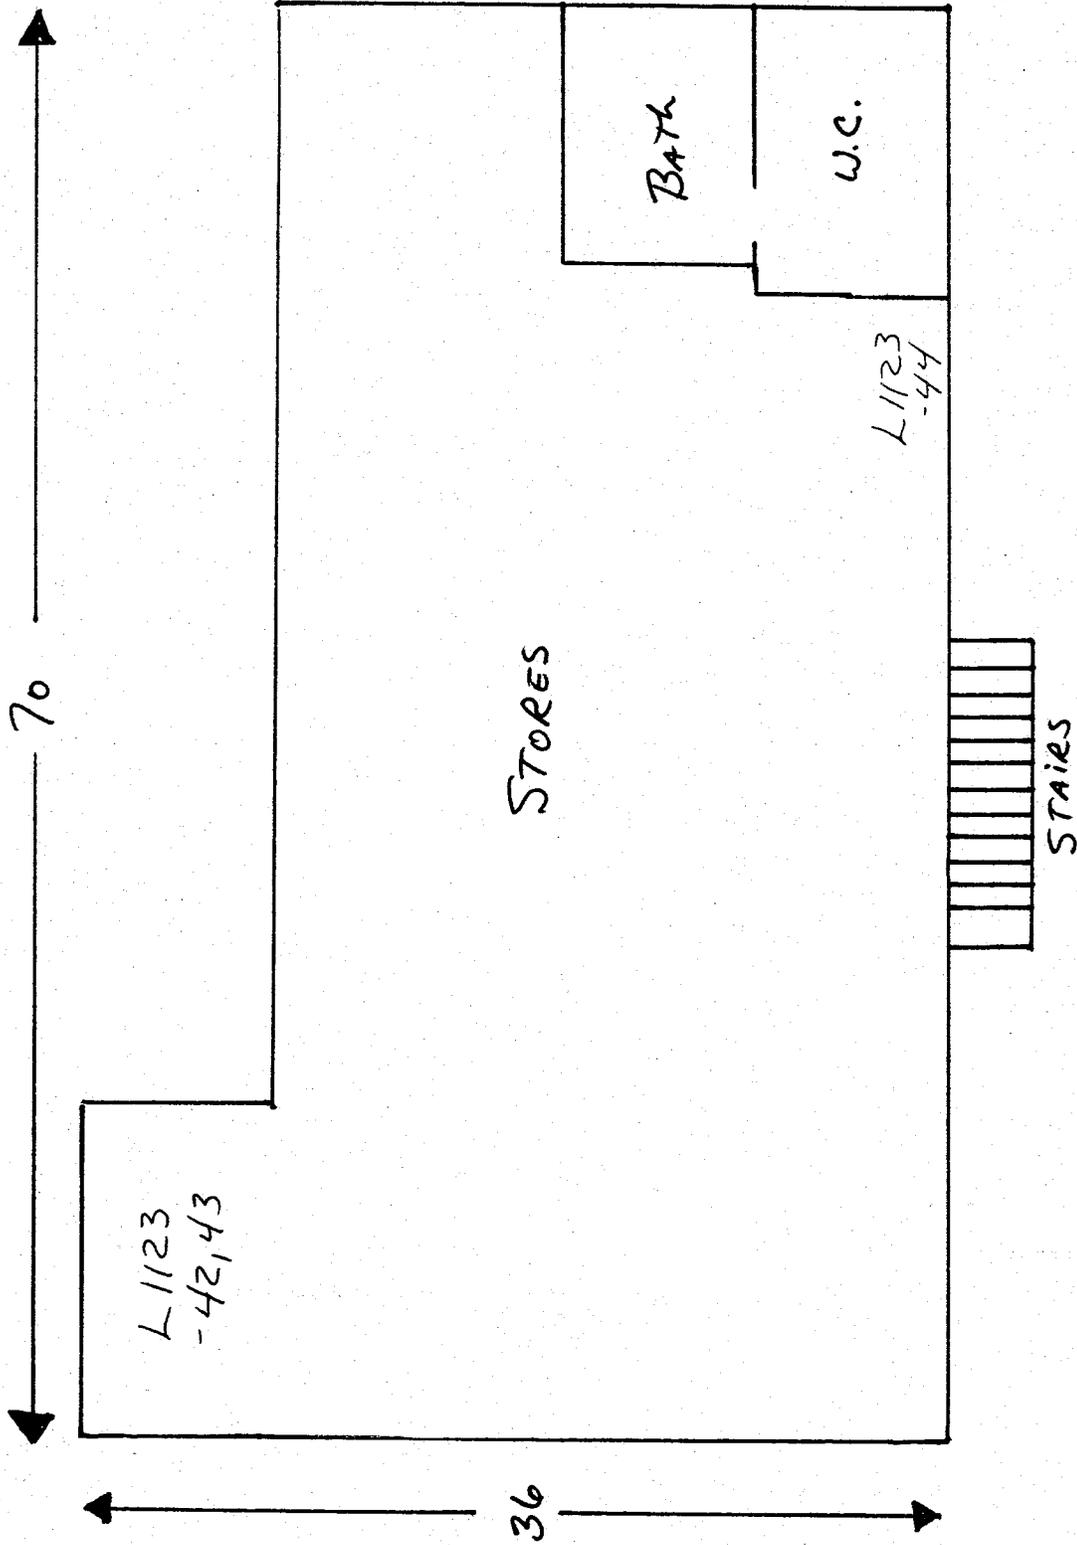

Bld # 628
Cable House
Pg. 2 of 2

(BASEMENT)
(FROM BLUE PRINT)

LEAD BASED PAINT SAMPLING LOG

NAF MIDWAY

THE SZARAS COMPANIES


PAGE 1 of 1 DATE SAMPLES COLLECTED: November 23, 1993

BUILDING NUMBER 631	BUILDING NAME Radar Building	BUILDING DESCRIPTION 1 Story		
TSC PROJECT NUMBER 865	TSC INSPECTOR J. Kain and B. Kain	TSC LABORATORY ID No. 120293A		
SAMPLE ID NO	SAMPLE LOCATION / DESCRIPTION	ANALYTICAL RESULTS (PPM)	CONDITION	AMOUNT
	INTERIOR:			
L1123-10	Stairwell Off-white paint on wall	39,931.3	Poor	1,000 sq. ft.
L1123-11	Office/workshop Green paint on wall	11,114.4	Poor	3,000 sq. ft.
L1123-12	Fallout shelter (add on to building) Beige paint on wall	1,813.8	Poor	350 sq. ft.
L1123-13	Door entrance west side Green paint on door	4,823.7	Poor	150 sq. ft.
	EXTERIOR:			
L1123-14	West side Off-white on wall	80,043.1	Poor	1,400 sq. ft.
	Note: Minimum penetration into building. Ceiling concrete debris on floor.			


It is assumed that anywhere the above identified lead based paint materials are found in the building, that those materials also contain lead and should be treated as such.

BLDG.# 631

Radial Bld

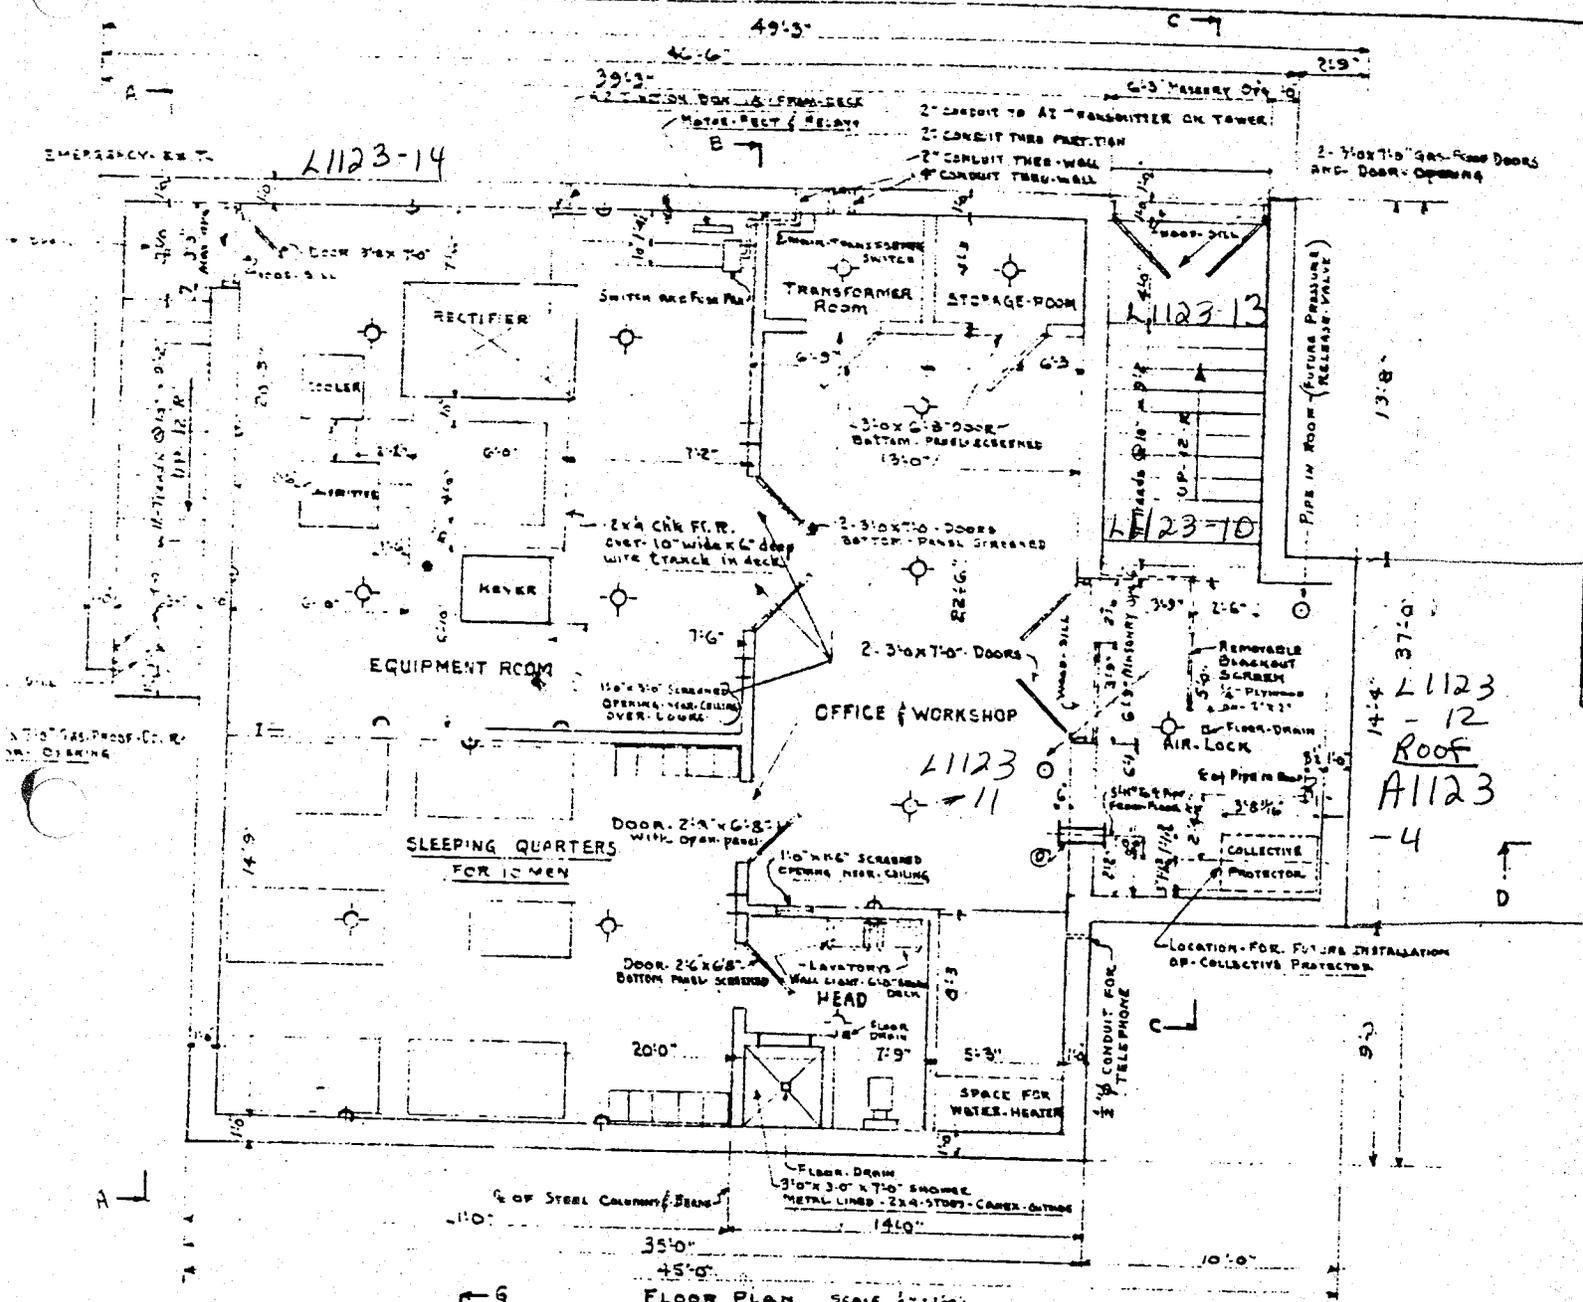


FLOOR PLAN SCALE 1/4" = 1'-0"

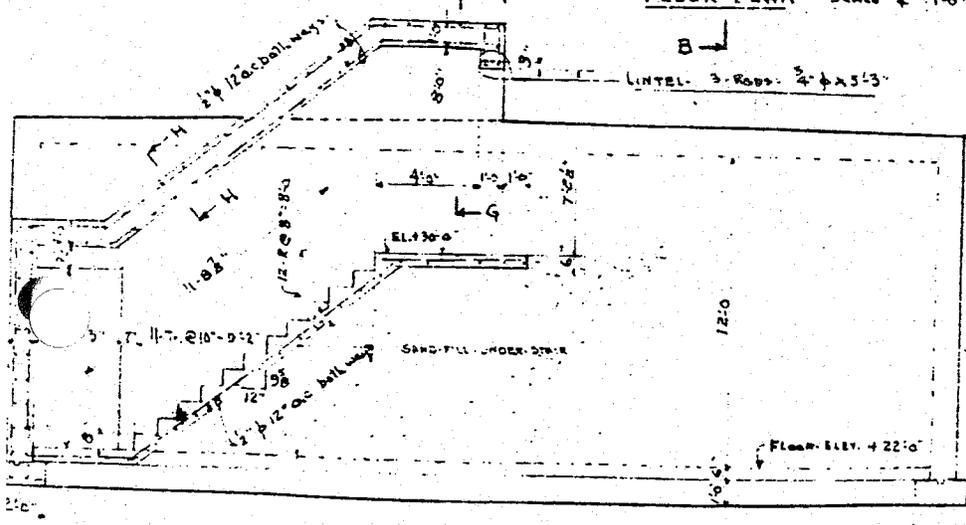

ELECTRICAL NOTES

- PROVIDE FOR FAN AT EXHAUST VENT IN ROOF
- = OVERHEAD-LIGHT
- = CONVENIENCE OUTLET
- = WALL-LIGHT- GO FROM DECK. (IN HEAD. ONLY)

FOR FURTHER DETAILS ON CONSTRUCTION AND LAYOUT OF OPERATING ROOM, REFER TO INSTRUCTION BOOK SCR-271 RADIO SET & DRAWINGS

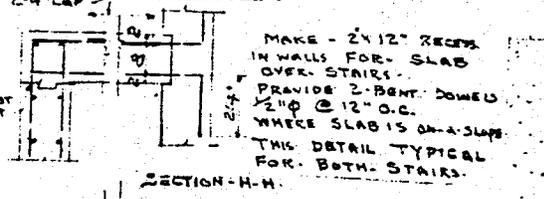

SECTION-H-H

ASBESTOS BULK SAMPLING LOG


NAF MIDWAY

THE SZARAS COMPANIES

PAGE 1 of 1 DATE SAMPLES COLLECTED: November 23, 1993


SAMPLE ID NO	SAMPLE LOCATION / DESCRIPTION	ANALYTICAL RESULTS	FRIABLE	CONDITION	AMOUNT
BUILDING NUMBER 643		BUILDING NAME Cable House		BUILDING DESCRIPTION 2 Story	
TSC PROJECT NUMBER 865		TSC INSPECTOR J. Kain and B. Kain		TSC LABORATORY ID No. 120293C	
INTERIOR:					
A1123-18	Basement, Carpenter Shop Black with white streaks 9" x 9" floor tile	Tile - 10% Chrysotile Mastic - 12% Chrysotile	No	Fair	Tile for samples A1123-18, A1123-19, A1123-20, A1123-22, A1123-24, A1123-23 are mixed. Total 7,800 sq. ft.
A1123-19	Basement, Laundry Red with white streaks 9" x 9" floor tile	Tile - 10% Chrysotile Mastic - 4% Chrysotile	No	Fair	
A1123-20	Kitchen Green with white streaks 12" x 12" floor tile	Tile - 3% Chrysotile Mastic - 8% Chrysotile	No	Fair	
No sample collected	Kitchen, underneath A1123-20 Red with white streaks 9" x 9" floor tile - same as sample A1123-19	Tile - 10% Chrysotile Mastic - 4% Chrysotile	No	Fair	
A1123-22	Southwest end Beige with gray streaks 12" x 12" floor tile	Tile - 10% Chrysotile Mastic - 15% Chrysotile	No	Good	
A1123-21	Southwest end, 1st floor, porch Green with white 9" x 9" floor tile	8% Chrysotile	No	Good	100 sq. ft.
A1123-24	Southeast end Red with white and orange streaks 9" x 9" floor tile	Tile - None detected Mastic - 20% Chrysotile	No	Good	See note above for mixed floor tiles.
A1123-23	North end, kitchen White with gray streaks 9" x 9" floor tile	1% Chrysotile	No	Good	
No sample collected	Green with white streaks 9" x 9" floor tile - same as sample A1123-7, building 623	Tile - 15% Chrysotile Mastic - 8% Chrysotile	No	Good	
EXTERIOR:					
A1123-25	Roof, south side Roof core	None detected	No	Fair	3,400 sq. ft.

It is assumed that anywhere the above identified asbestos containing building materials are found in the building, that those materials also contain asbestos and should be treated as such.

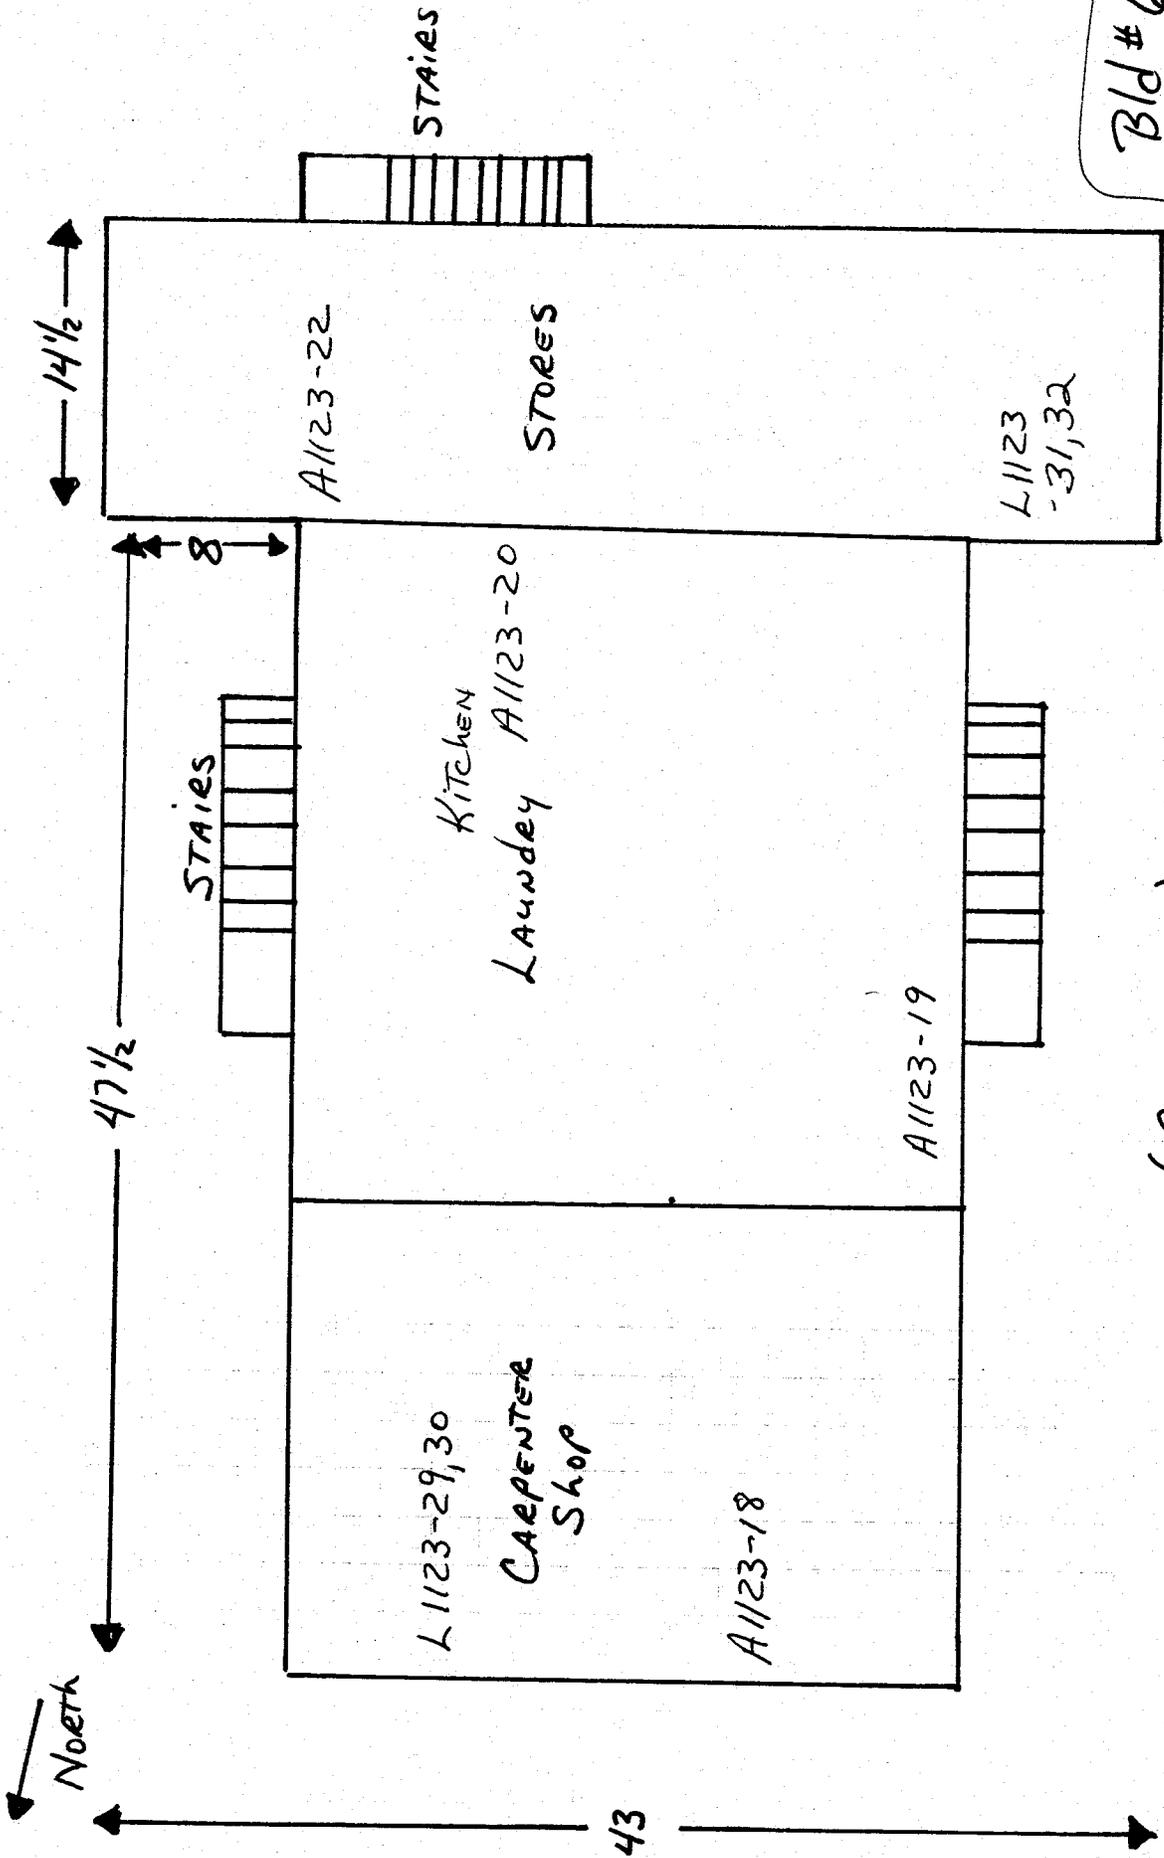

Bld # 643
 Cable House
 Pg. 1 OF 2

(Basement)
 (From Blue Print)

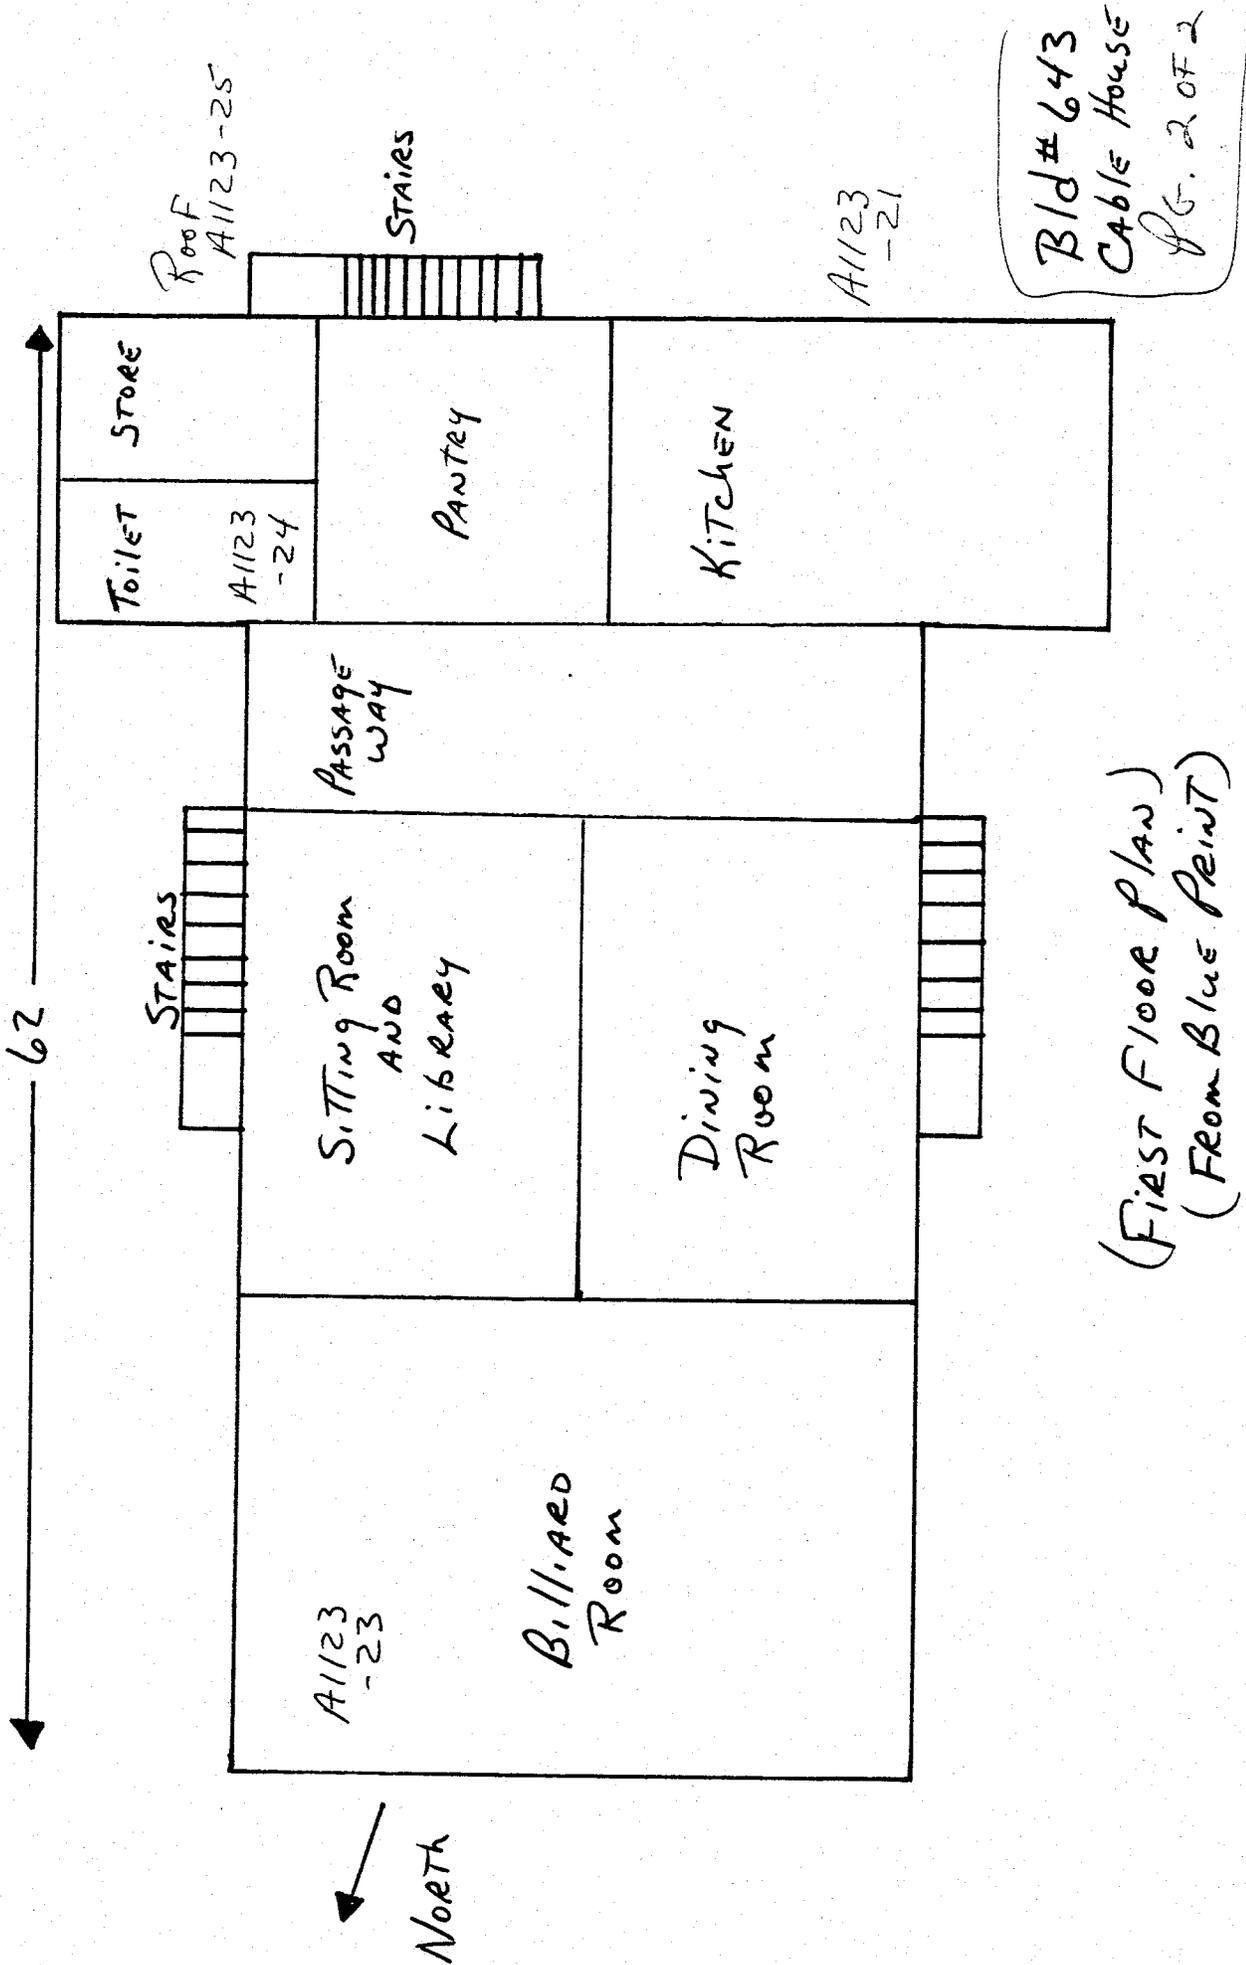


(FIRST FLOOR PLAN)
(FROM BLUE PRINT)



BID # 963

85

North

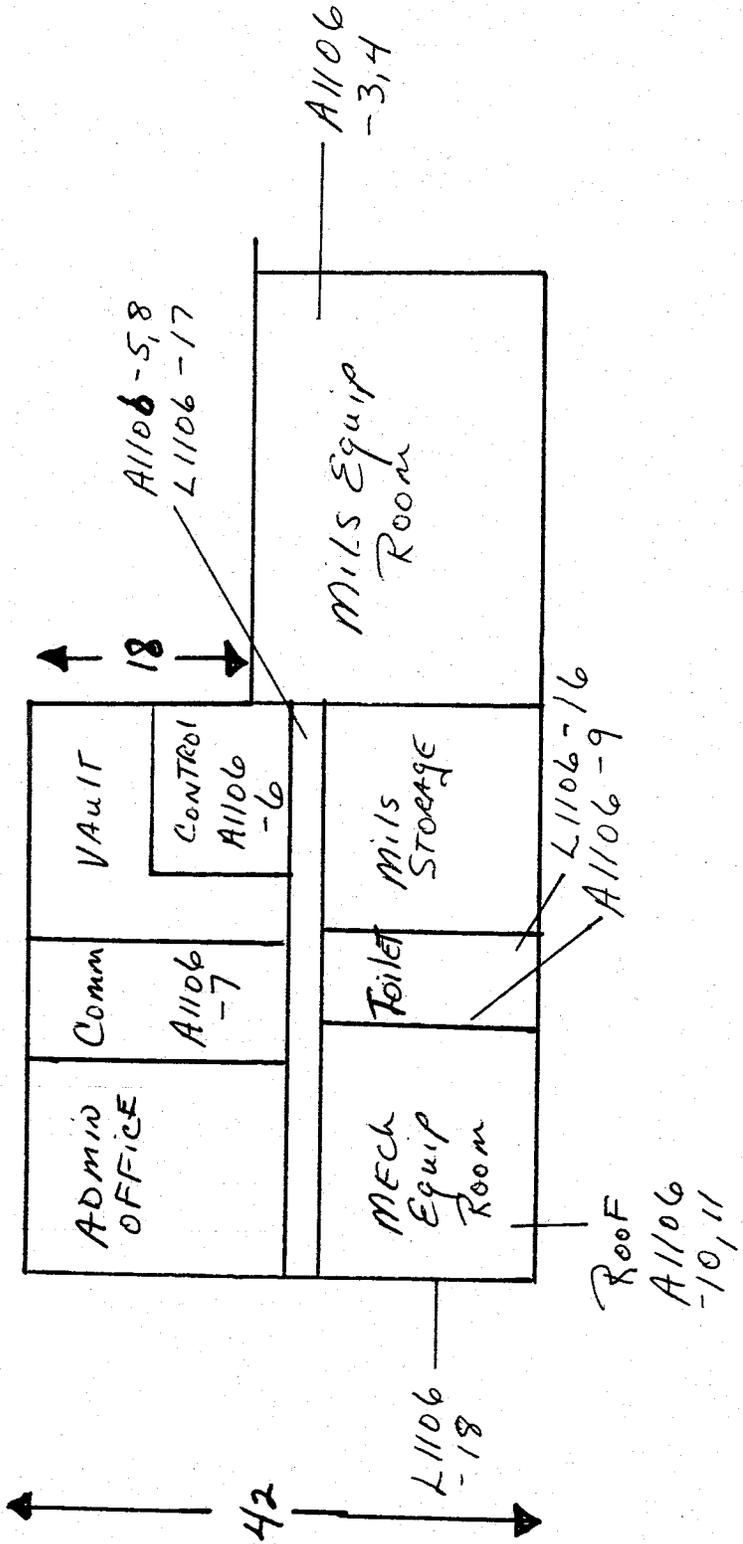

A1106-5,8
L1106-17

A1106-3,4

Mils Equip Room

18

Vault

Control
A1106-6

Comm
A1106-7

Toilet

Mech Equip Room

Mils Storage

L1106-9,16
A1106-9

Roof
A1106-10,11

42

L1106-18

ASBESTOS BULK SAMPLING LOG

NAF MIDWAY

THE SZARAS COMPANIES

PAGE 1 of 1

DATE SAMPLES COLLECTED: November 6, 1993

SAMPLE ID NO	SAMPLE LOCATION / DESCRIPTION	ANALYTICAL RESULTS	FRIABLE	CONDITION	AMOUNT
BUILDING NUMBER 963		BUILDING NAME Communication Research Lab		BUILDING DESCRIPTION 1 Story	
TSC PROJECT NUMBER 865		TSC INSPECTOR J. Kain and B. Kain		TSC LABORATORY ID NO. 111693J	
A1106-3	Interior east end Equipment room Off-white with green 9" x 9" floor tile	Tile - 8% Chrysotile Mastic - 1-2% Chrysotile	No	Good	1,000 sq. ft.
A1106-4	Interior east end, south wall Equipment room 1' x 1' wall tile	None detected	Yes	Fair	6,300 sq. ft.
A1106-5	Interior hallway Green 9" x 9" floor tile	Tile - 18% Chrysotile Mastic - 15% Chrysotile	No	Good	400 sq. ft.
A1106-6	Interior north side Control Room Gray 9" x 9" floor tile	Tile - 8% Chrysotile Mastic - 5% Chrysotile	No	Good	1,500 sq. ft.
A1106-7	Interior north side Communications room - gray with white speckles 9" x 9" floor tile	None detected	No	Good	400 sq. ft.
A1106-8	Interior hallway Transite panelling	59% Chrysotile	No	Good	300 sq. ft.
A1106-9	Interior south side Restroom Drywall	None detected	Yes	Fair	6,300 sq. ft.
A1106-10	Roof Pedestals and penetrations Tar paper and tar	5% Chrysotile	No	Good	200 sq. ft.
A1106-11	Roof south side Rock roof core sample	None detected	No	Fair	2,200 sq. ft.

It is assumed that anywhere the above identified asbestos containing building materials are found in the building, that those materials also contain asbestos and should be treated as such.

LEAD BASED PAINT SAMPLING LOG

NAF MIDWAY


THE SZARAS COMPANIES

PAGE 1 of 1

DATE SAMPLES COLLECTED: November 6, 1993

SAMPLE ID NO	SAMPLE LOCATION / DESCRIPTION	ANALYTICAL RESULTS (PPM)	CONDITION	AMOUNT
BUILDING NUMBER 964		BUILDING NAME Generator/Electrical		BUILDING DESCRIPTION 1 Story
TSC PROJECT NUMBER 865		TSC INSPECTOR J. Kain and B. Kain		TSC LABORATORY ID No. 111693K
L1106-10	Exterior north wall White paint on wall	946.2	Poor	1,300 sq. ft.
L1106-11	Exterior north steps Red deck paint	441.2	Poor	400 sq. ft.
L1106-12	Exterior northeast doors Light gray paint on 4 doors	3,650.0	Poor	300 sq. ft.
L1106-13	Exterior northeast side of concrete diesel platform Black paint on concrete	2,404.2	Poor	250 sq. ft.
Note: Lead wiring throughout underground electrical delivery system				
L1106-14	Interior east side White paint on wall	385.6	Fair	1,500 sq. ft.
L1106-15	Interior east side White/red paint on 4-1/2" pipe	986.7	Poor	10 ft.


It is assumed that anywhere the above identified lead based paint materials are found in the building, that those materials also contain lead and should be treated as such.

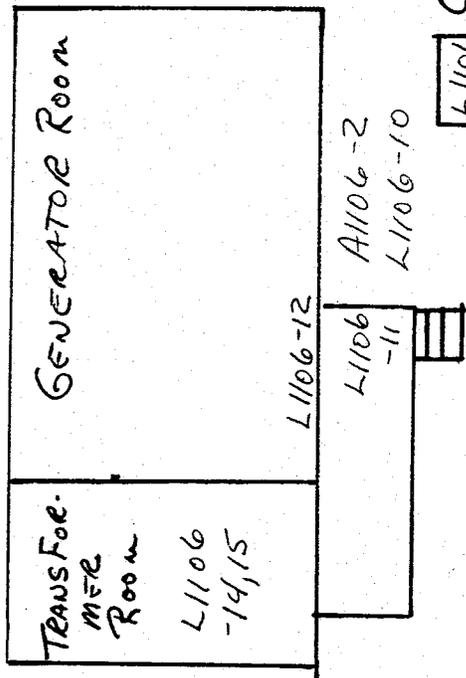

North


Bld 964
GENERATOR Room.



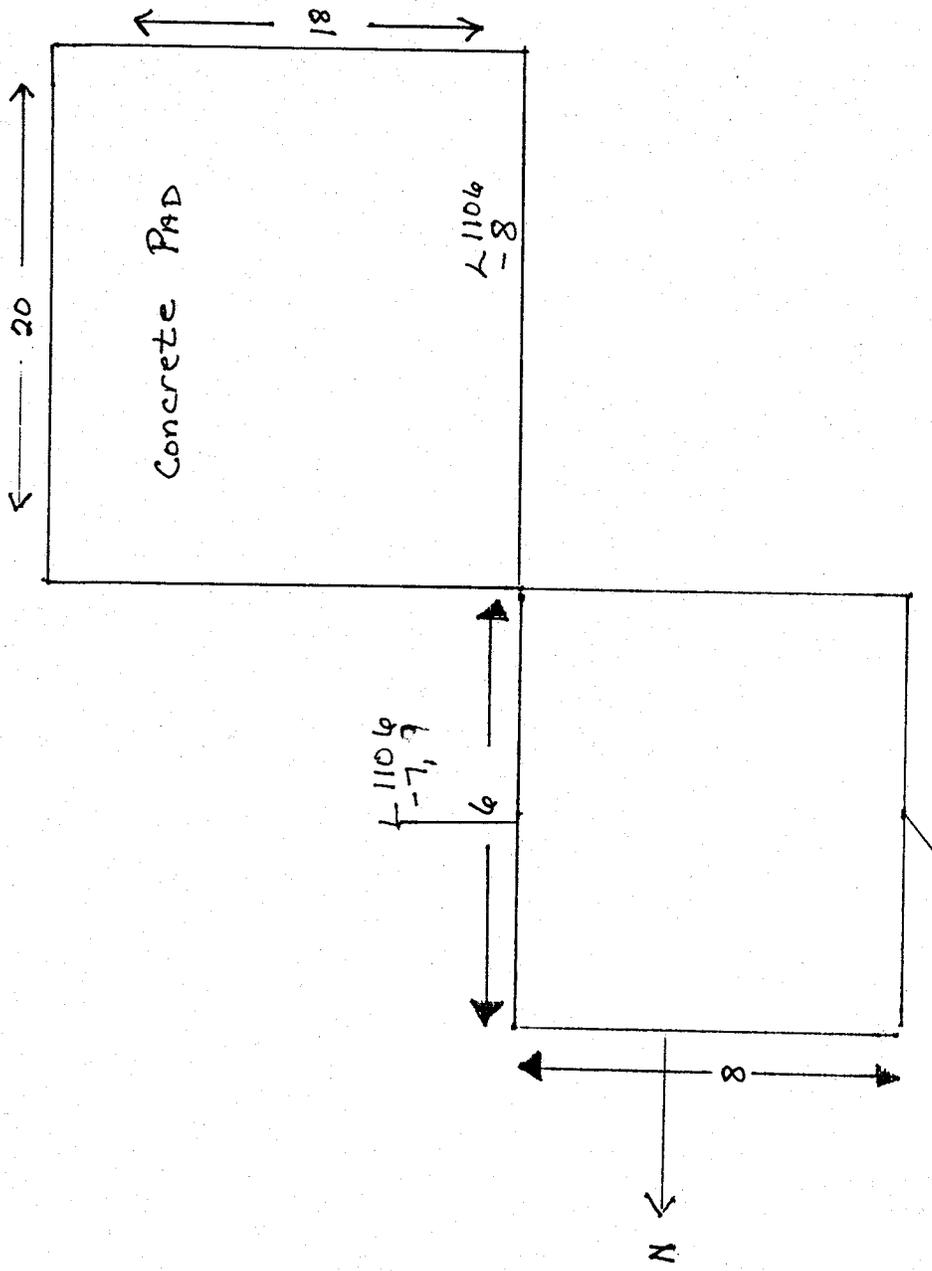

BLDG # 968 Antenna Com. Bldg.



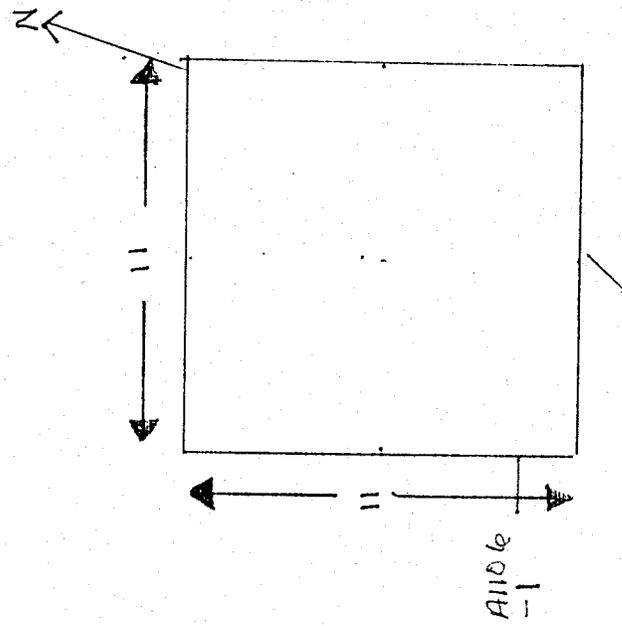

Bldg. #969 Pipe Line Bldg

ASBESTOS BULK SAMPLING LOG

NAF MIDWAY

THE SZARAS COMPANIES

PAGE 1 of 1

DATE SAMPLES COLLECTED: November 5, 1993

SAMPLE ID NO	SAMPLE LOCATION / DESCRIPTION	ANALYTICAL RESULTS	FRIABLE	CONDITION	AMOUNT
BUILDING NUMBER 970		BUILDING NAME NAVOcean ProFac		BUILDING DESCRIPTION 1 Story	
TSC PROJECT NUMBER 865		TSC INSPECTOR J. Kain and B. Kain		TSC LABORATORY ID No. 111693I	
A1105-26	Roof northwest end Multi-layer roof core	1. 50% Chrysotile 2. 2% Chrysotile	No	Good	12,500 sq. ft.
A1105-27	Roof north side Light gray tar on roof vents	30% Chrysotile	No	Good	100 sq. ft.
A1105-28	Interior west end by entrance door Light beige with darker brown 9" x 9" floor tile	Tile - <1% Chrysotile Mastic - 7% Chrysotile	No	Fair	12,000 sq. ft.
A1105-29	Interior Room 5 Soutwest office Drywall	None detected	Yes	Fair	6,000 sq. ft.
A1105-32	Interior kitchen Beige with brown 12" x 12" floor tile	Tile - <1% Chrysotile Mastic - None detected	No	Fair	144 sq. ft.
A1105-30	Interior Room 9 1' x 1' wall tile with holes	None detected	Yes	Fair	Mixed with sample A1105-31
A1105-31	Interior Room 9 Wall tiles with holes and dents	None detected	Yes	Fair	8,000 sq. ft.
A1105-33	Interior Room 17 North wall Baseboard with mastic	None detected	No	Fair	100 sq. ft.
A1105-34	Interior Room 19 Safe insulation in door	None detected	Yes	Fair	100 sq. ft.
A1105-35	Interior Room 9 Wall mastic	None detected	No	Fair	8,000 sq. ft.

It is assumed that anywhere the above identified asbestos containing building materials are found in the building, that those materials also contain asbestos and should be treated as such.

LEAD BASED PAINT SAMPLING LOG

NAF MIDWAY

THE SZARAS COMPANIES

PAGE 1 of 1

DATE SAMPLES COLLECTED: November 5, 1993

SAMPLE ID NO	SAMPLE LOCATION / DESCRIPTION	ANALYTICAL RESULTS (PPM)	CONDITION	AMOUNT
BUILDING NUMBER 970		BUILDING NAME NAVOcean ProFac		BUILDING DESCRIPTION 1 Story
TSC PROJECT NUMBER 865		TSC INSPECTOR J. Kain and B. Kain		TSC LABORATORY ID No. 111693C
L1105-47	Interior southwest office, room 4 Off-white paint on wall	16,875.0	Fair	11,000 sq. ft.
L1105-48	Interior east side, room 16 Green paint on wall	26,026.1	Fair	200 sq. ft.
L1105-49	Exterior north wall Off-white paint on block wall	811.3	Fair	6,000 sq. ft.
L1105-50	Exterior north door, room 23 Blue paint on door	225.8	Fair	400 sq. ft.
L1105-51	Interior north side air conditioning room 21 Red deck paint	3,258.3	Good	350 sq. ft.
L1105-52	Interior north side electrical room 23 Gray deck paint	5,154.3	Poor	300 sq. ft.
L1105-53	Interior north side transformer room 23 Light gray paint on transformer	1,449.5	Good	500 sq. ft.
L1105-54	Interior north side air condition room 21 White paint on tank	5,198.2	Poor	250 sq. ft.
L1105-55	Interior south wall room 17 Beige paint on wall	341.3	Fair	500 sq. ft.
L1105-56	Interior south wall room 17 Yellow paint on wall	23,676.5	Fair	Mixed with sample L1105-55, this building

It is assumed that anywhere the above identified lead based paint materials are found in the building, that those materials also contain lead and should be treated as such.

176

64

68

L1105-50


North

20

INCIN RM EM22

A/C Em RM21 L1105-51,54


SubSTA RM23 L1105-52,53

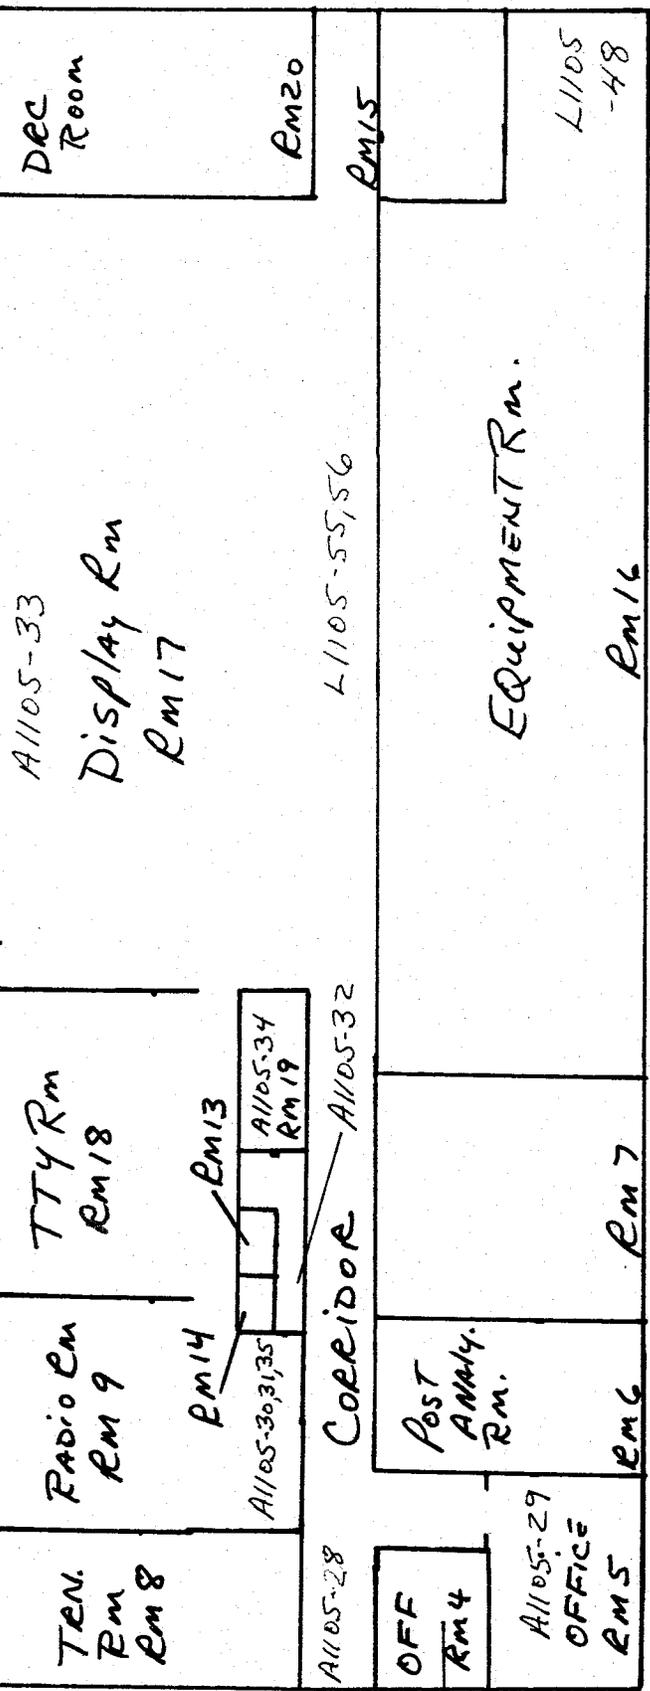

Bld # 970

Roof A1105-26,27

L1105-47

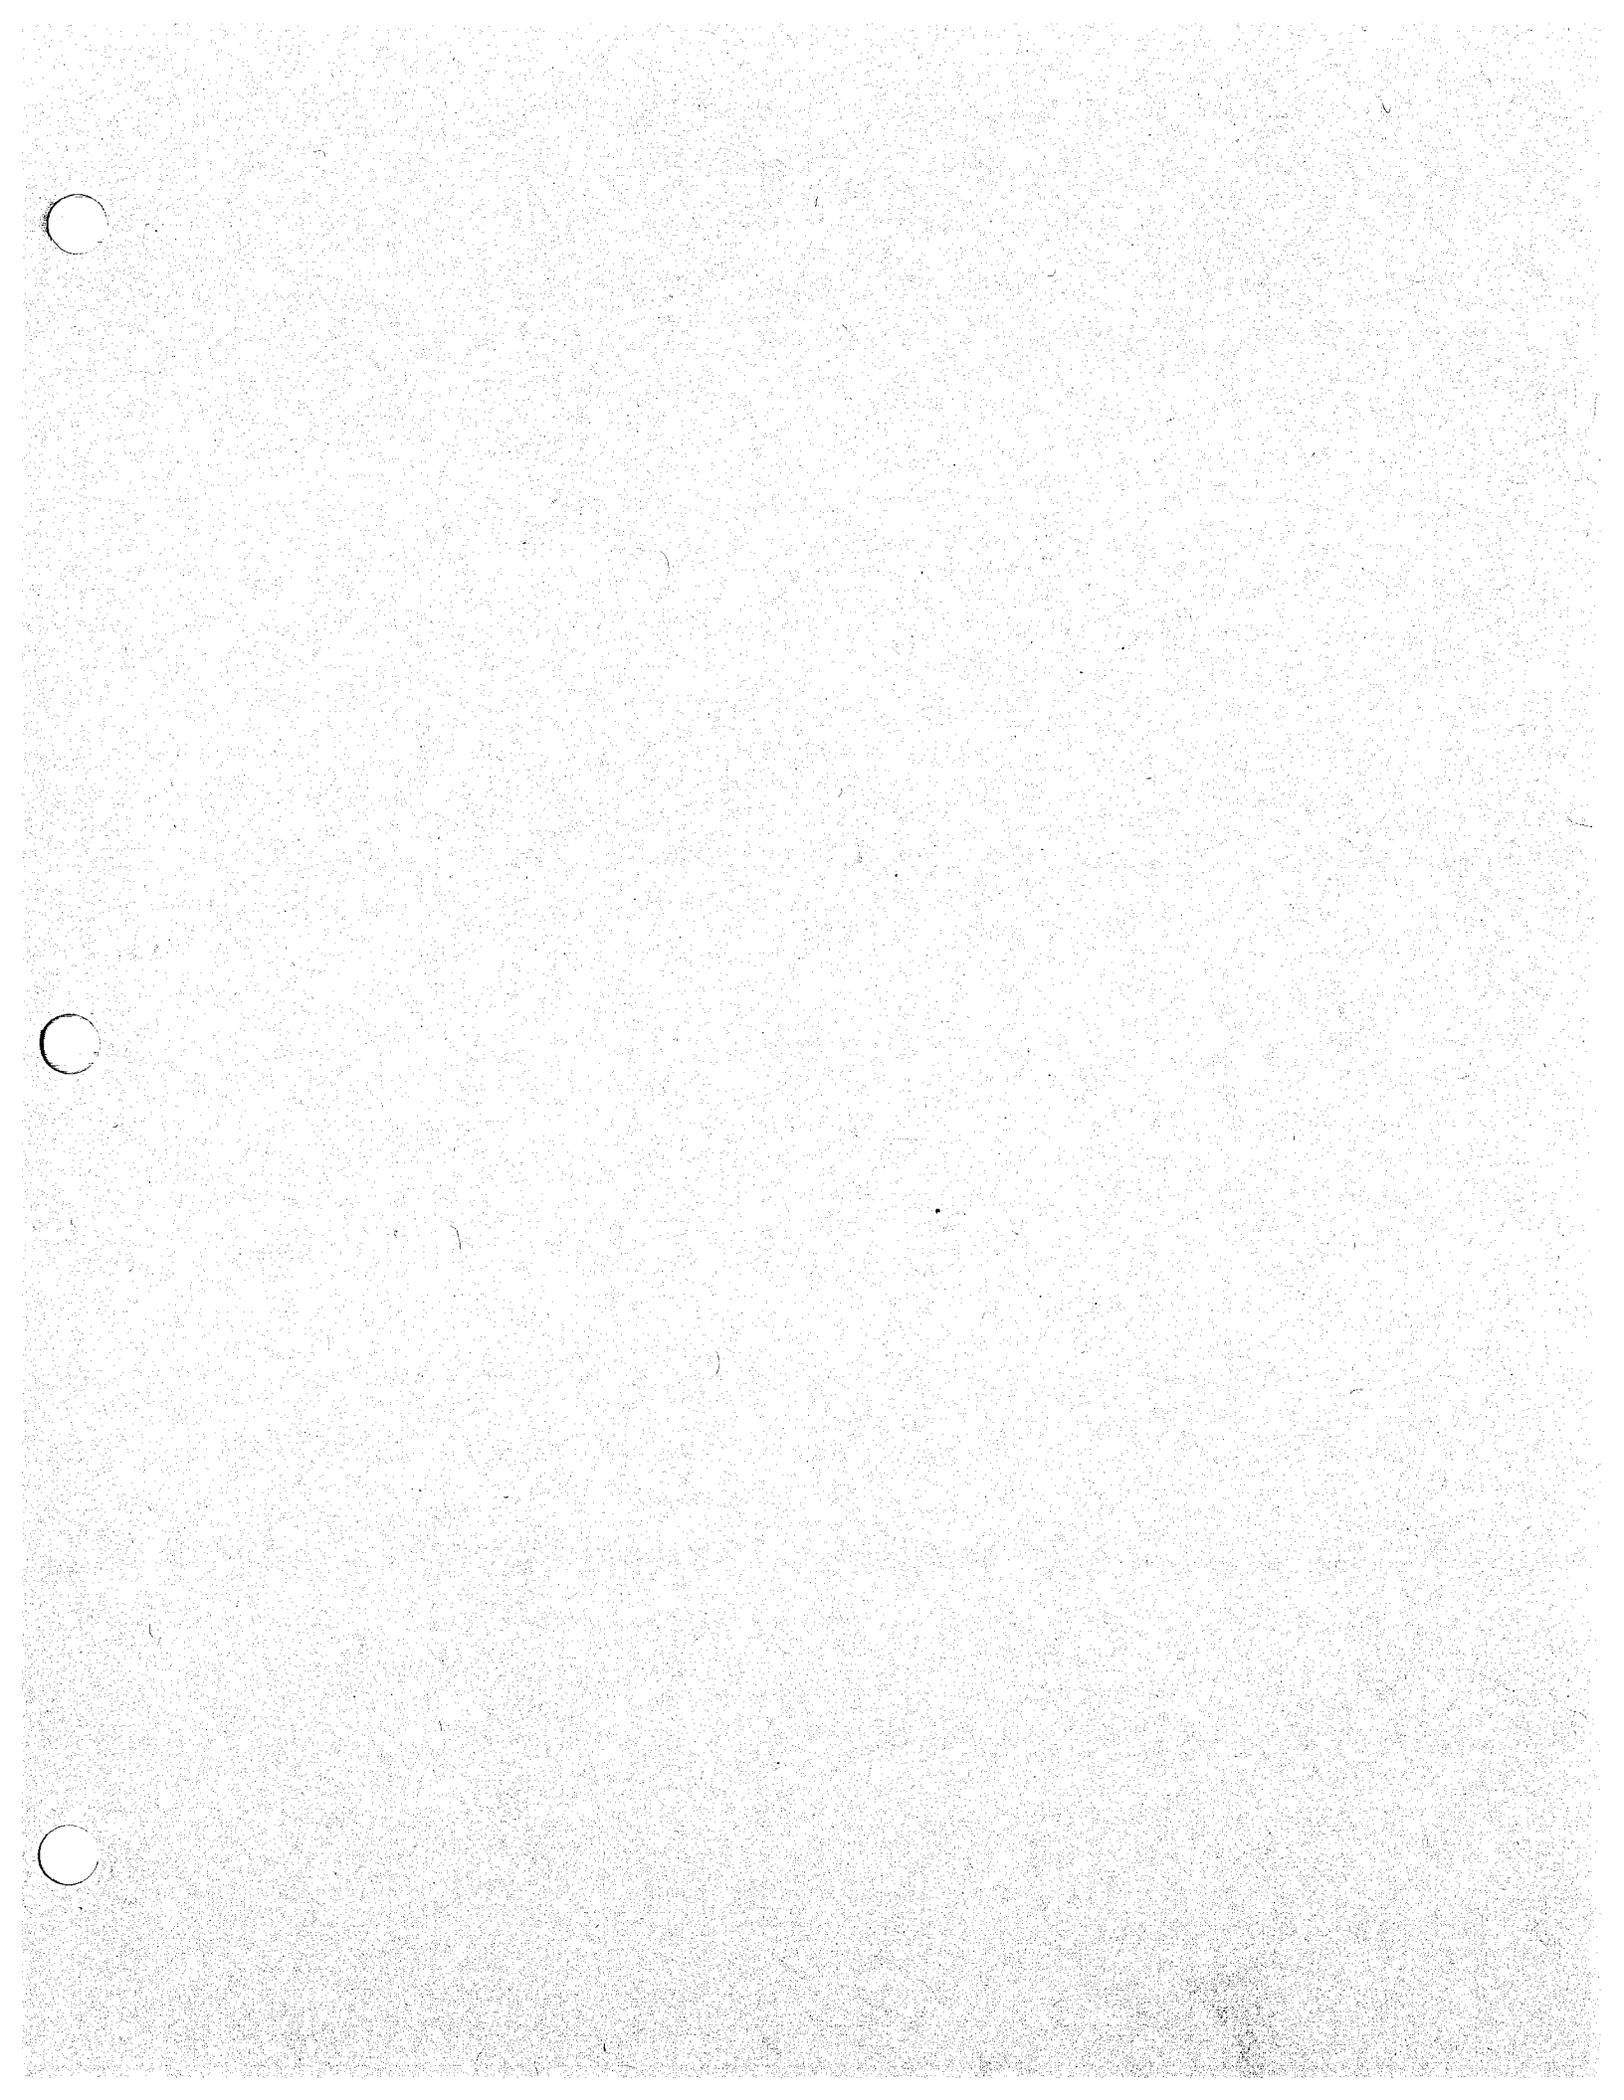

LEAD BASED PAINT SAMPLING LOG

NAF MIDWAY

THE SZARAS COMPANIES


PAGE 1 of 1

DATE SAMPLES COLLECTED: November 5, 1993

SAMPLE ID NO	SAMPLE LOCATION / DESCRIPTION	ANALYTICAL RESULTS (PPM)	CONDITION	AMOUNT
BUILDING NUMBER 971		BUILDING NAME Generator		BUILDING DESCRIPTION 1 Story
TSC PROJECT NUMBER 865		TSC INSPECTOR J. Kain and B. Kain		TSC LABORATORY ID No. 111693C
L1105-26	Interior south end office Red deck paint	161.0	Good	2,200 sq. ft.
L1105-27	Interior east wall generator room White wall paint	736.8	Fair	2,500 sq. ft.
L1105-28	Interior south side Gray paint on generator	1,591.3	Good	1,000 sq. ft.
L1105-29	Interior southeast side restroom Blue paint on door	3,128.9	Fair	500 sq. ft.
L1105-30	Interior south wall restroom Off-white paint on wall	1,273.9	Poor	600 sq. ft.
L1105-31	Interior north wall Dark red paint on wall	9,857.9	Good	300 sq. ft.
L1105-32	Interior west side safety lines Yellow and black paint on floor	81,316.5	Good	150 sq. ft.
L1105-33	Exterior south wall Beige paint on south wall	46,994.7	Poor	2,700 sq. ft.

It is assumed that anywhere the above identified lead based paint materials are found in the building, that those materials also contain lead and should be treated as such.

BID 971

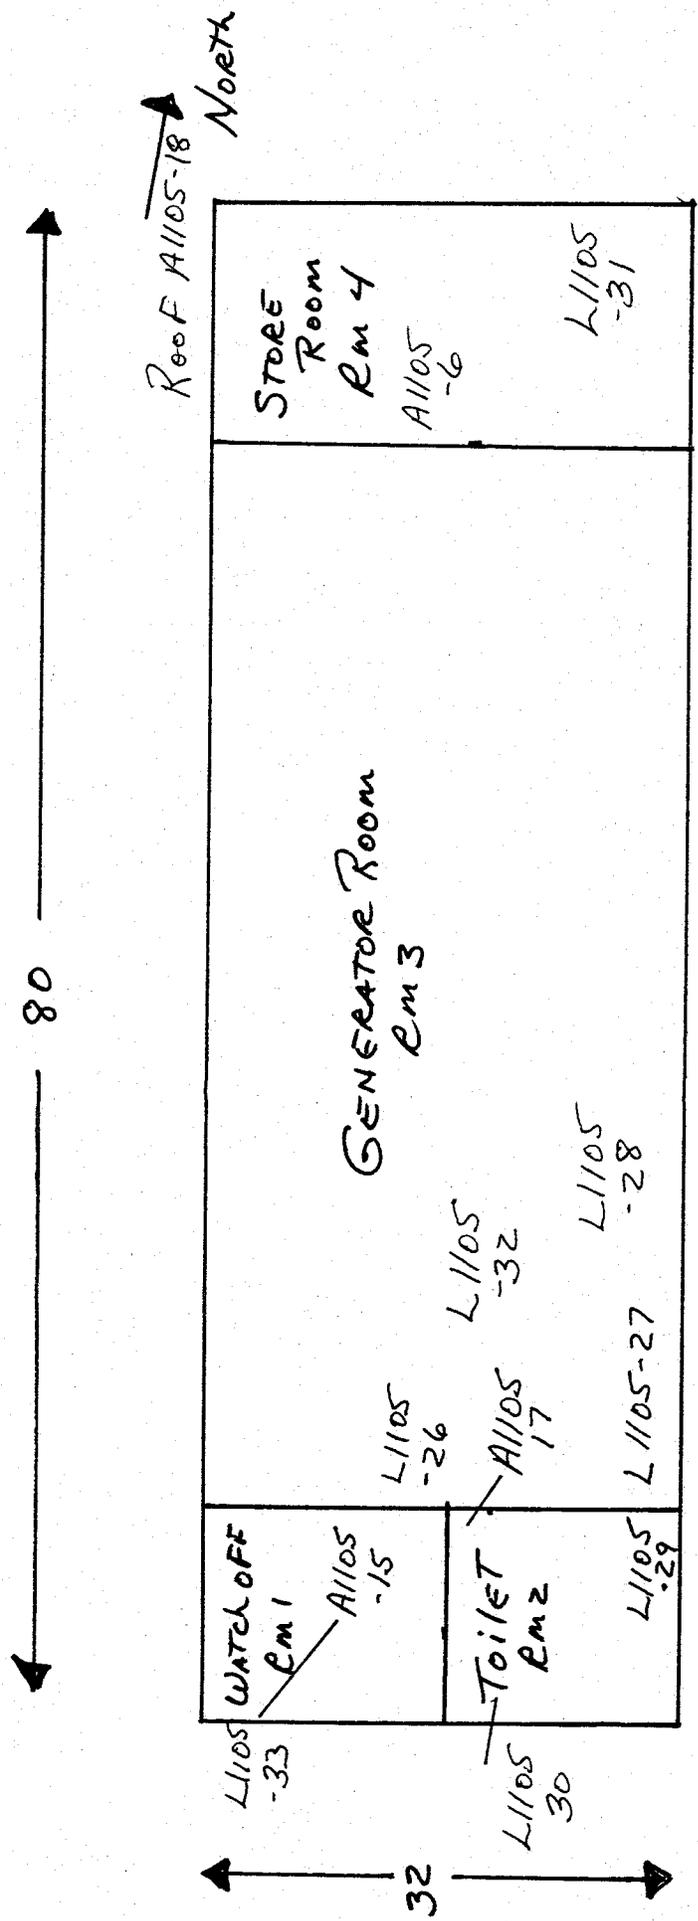

32

80

Roof A1105-18
North

L1105-33

L1105-30

WATCH OFF Rm 1

TOILET Rm 2

STORE Room Rm 4

GENERATOR ROOM Rm 3

L1105-26

L1105-32

L1105-28

L1105-27

L1105-29

A1105-6

L1105-31

Roof A1105-18

North



ASBESTOS BULK SAMPLING LOG

NAF MIDWAY

THE SZARAS COMPANIES

PAGE 1 of 1

DATE SAMPLES COLLECTED: November 5, 1993

SAMPLE ID NO	SAMPLE LOCATION / DESCRIPTION	ANALYTICAL RESULTS	FRIABLE	CONDITION	AMOUNT
BUILDING NUMBER 973		BUILDING NAME Administration Office		BUILDING DESCRIPTION 1 Story	
TSC PROJECT NUMBER 865		TSC INSPECTOR J. Kain and B. Kain		TSC LABORATORY ID No. 111693I	
INTERIOR:					
A1105-19	Northwest conference room Light brown with darker brown shades 9" x 9" floor tile	Tile - 2% Chrysotile Mastic - 1-2% Chrysotile	No	Fair	4,500 sq. ft.
A1105-20	Northwest wall on north end Mastic behind panelling	None detected	No	Fair	3,000 sq. ft.
A1105-21	Northwest wall north end Baseboard and mastic	None detected	No	Fair	600 lin. ft.
A1105-22	Northeast restroom Drywall and tape	None detected	Yes	Fair	3,000 sq. ft.
A1105-23	Air handler northwest side Expansion joint	None detected	No	Fair	25 sq. ft.
EXTERIOR:					
A1105-24	Roof southeast side Tar paper on parapet wall	None detected	No	Fair	200 sq. ft.
A1105-25	Roof southeast side Roof core	None detected	No	Fair	4,500 sq. ft.

It is assumed that anywhere the above identified asbestos containing building materials are found in the building, that those materials also contain asbestos and should be treated as such.

LEAD BASED PAINT SAMPLING LOG

NAF MIDWAY

THE SZARAS COMPANIES

PAGE 1 of 1

DATE SAMPLES COLLECTED: November 5, 1993

SAMPLE ID NO	SAMPLE LOCATION / DESCRIPTION	ANALYTICAL RESULTS (PPM)	CONDITION	AMOUNT
BUILDING NUMBER 973		BUILDING NAME Administration Office		BUILDING DESCRIPTION 1 Story
TSC PROJECT NUMBER 865		TSC INSPECTOR J. Kain and B. Kain		TSC LABORATORY ID No. 111693C
L1105-34	Interior northeast room east wall Pinkish beige paint on wall	4,388.5	Fair	6,000 sq. ft.
L1105-35	Interior northeast room Burgundy paint on 13 doorjams	1,525.0	Fair	300 sq. ft.
L1105-36	Interior northeast side officer's restroom Black deck paint	19,084.1	Fair	50 sq. ft.
L1105-37	Interior northeast officer's shower White paint on deck of shower	373.2	Fair	250 sq. ft.
L1105-38	Interior men's restroom Green paint on stalls	3,871.4	Fair	250 sq. ft.
L1105-39	Interior southeast side Career Counselor Dark green paint on north wall	808.3	Poor	500 sq. ft.
No sample collected	Interior northwest side air handler room Red deck paint Same as sample L1105-26, building 971	161.0	Poor	75 sq. ft.
L1105-40	Interior northwest side air handler entrance Gray paint on air handler	710.0	Poor	200 sq. ft.
L1105-41	Interior northwest side air handler room Blue paint on circuit breaker box	2,321.7	Fair	40 sq. ft.
L1105-44	Exterior red trim paint	7,866.9	Poor	320 sq. ft.


It is assumed that anywhere the above identified lead based paint materials are found in the building, that those materials also contain lead and should be treated as such.

79

North

Roof, A1105-24, 25


L1105-44

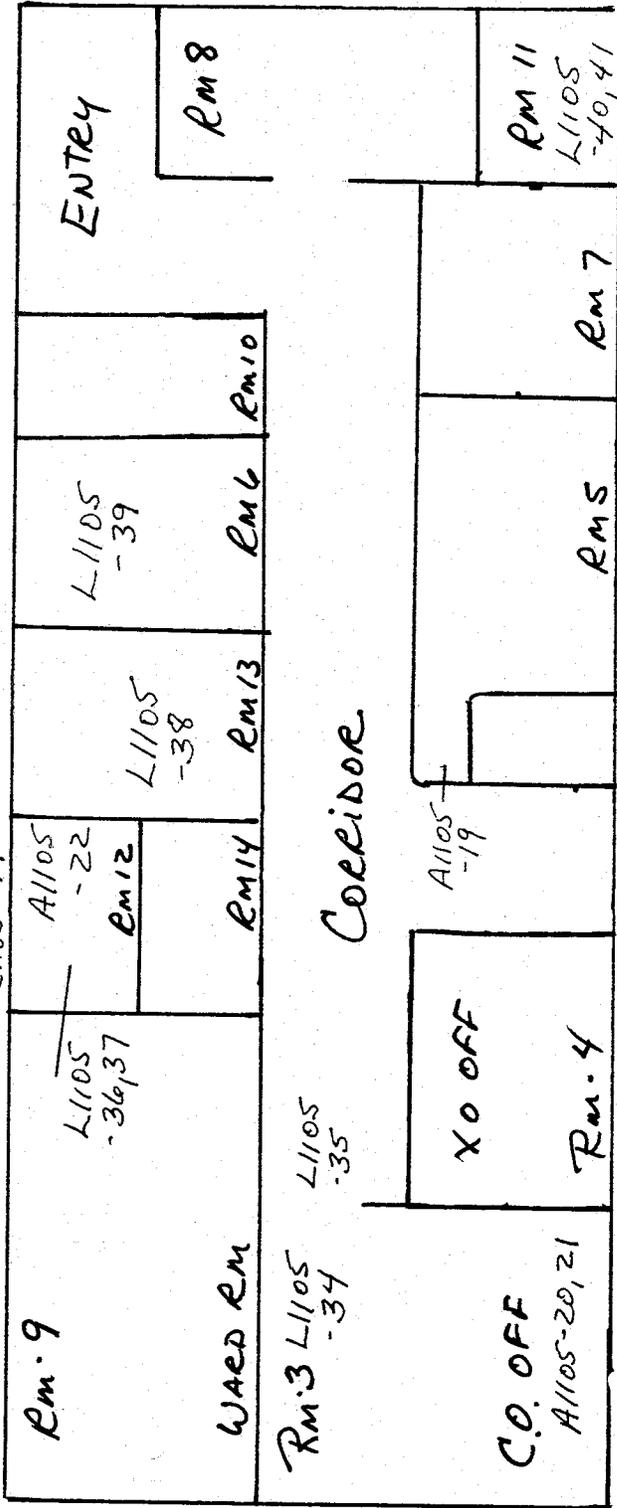

BID #973





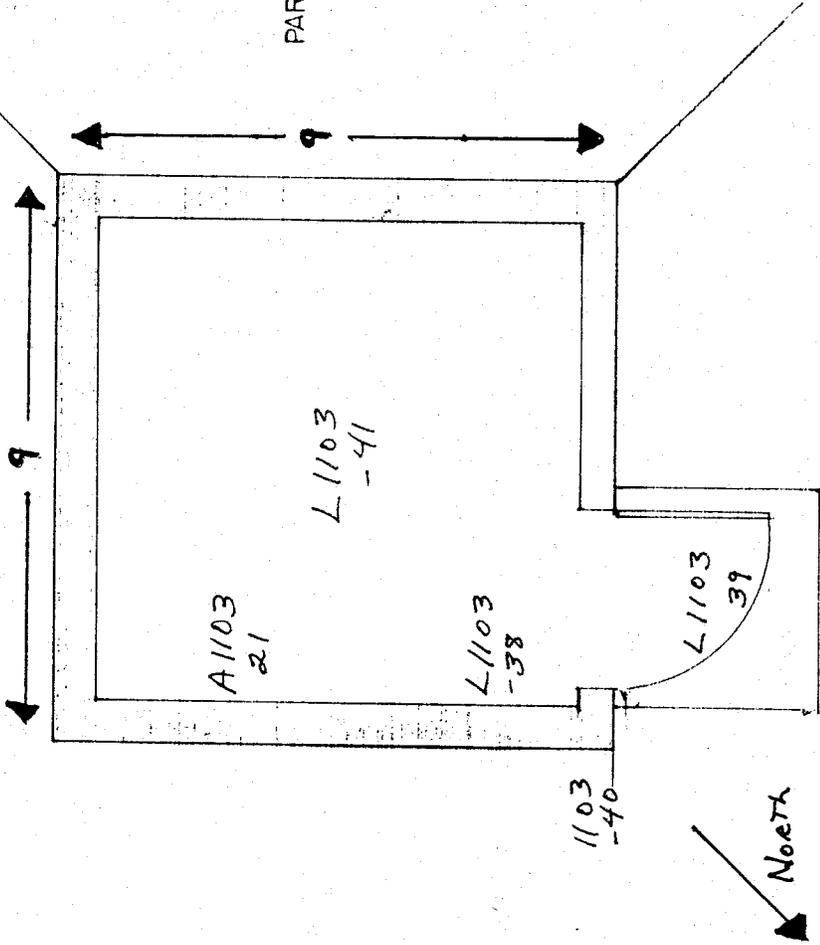


FLOOR PLAN

PIQUINQ MANAGEMENT CORPORATION
 NAVAL AIR FACILITY - MIDWAY ISLAND

TIDE GAUGE STATION, BLDG. 1122


NESTOR MCDONALD



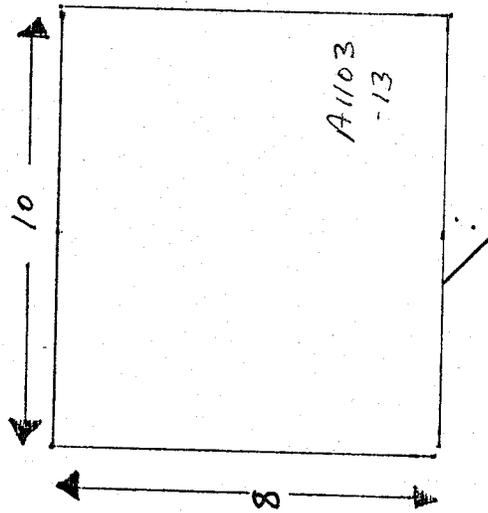

BID # 1123
ELECTRICAL
Sub STA



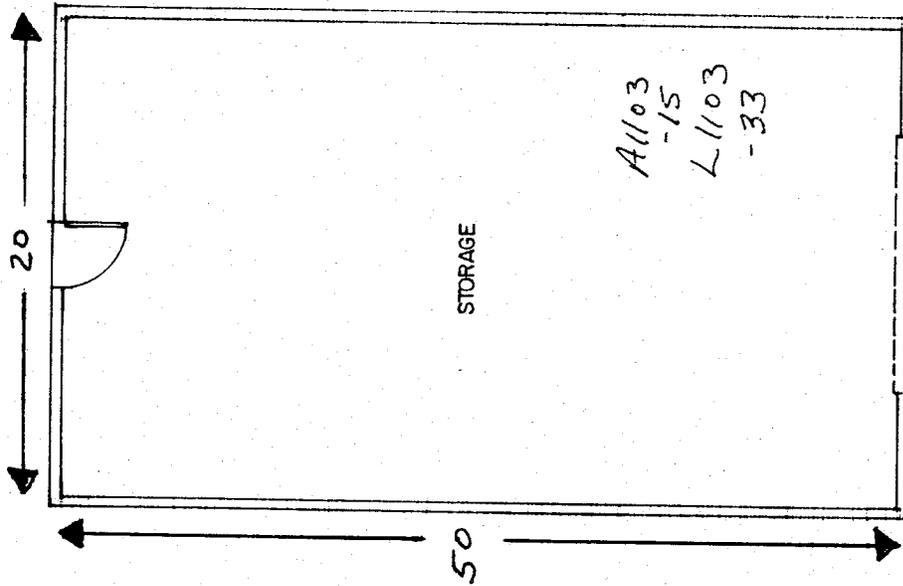


FLOOR PLAN

FIGUINQ MANAGEMENT CORPORATION
NAVAL AIR FACILITY - MIDWAY ISLAND

HARBOR STORAGE, BLDG. 1124



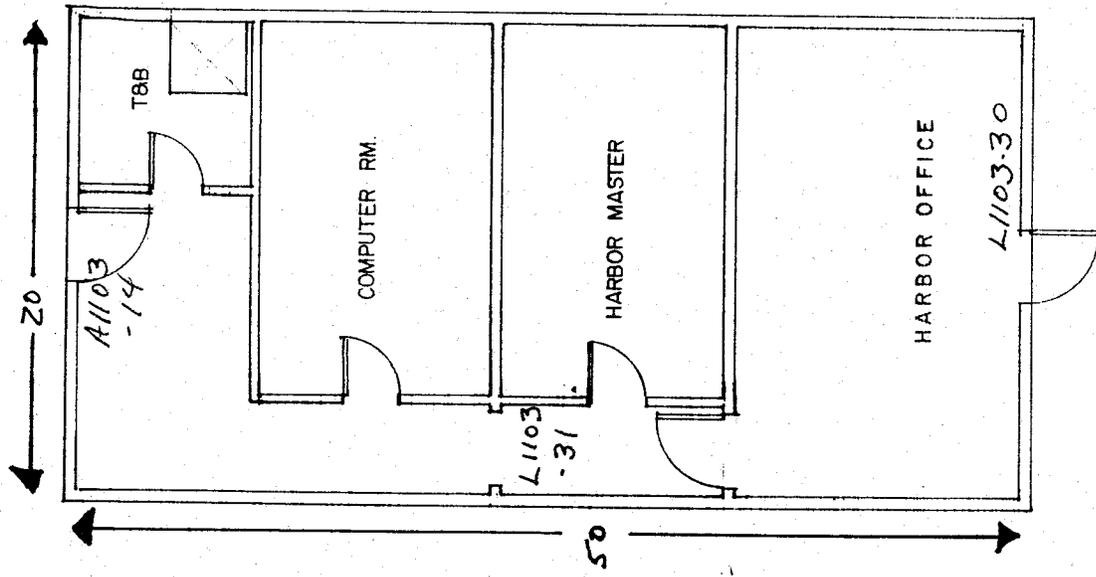


L1103-32

PIQUIN MANAGEMENT CORPORATION
 NAVAL AIR FACILITY - MIDWAY ISLAND


HARBOR OFFICE, BLDG. 1125

FLOOR PLAN



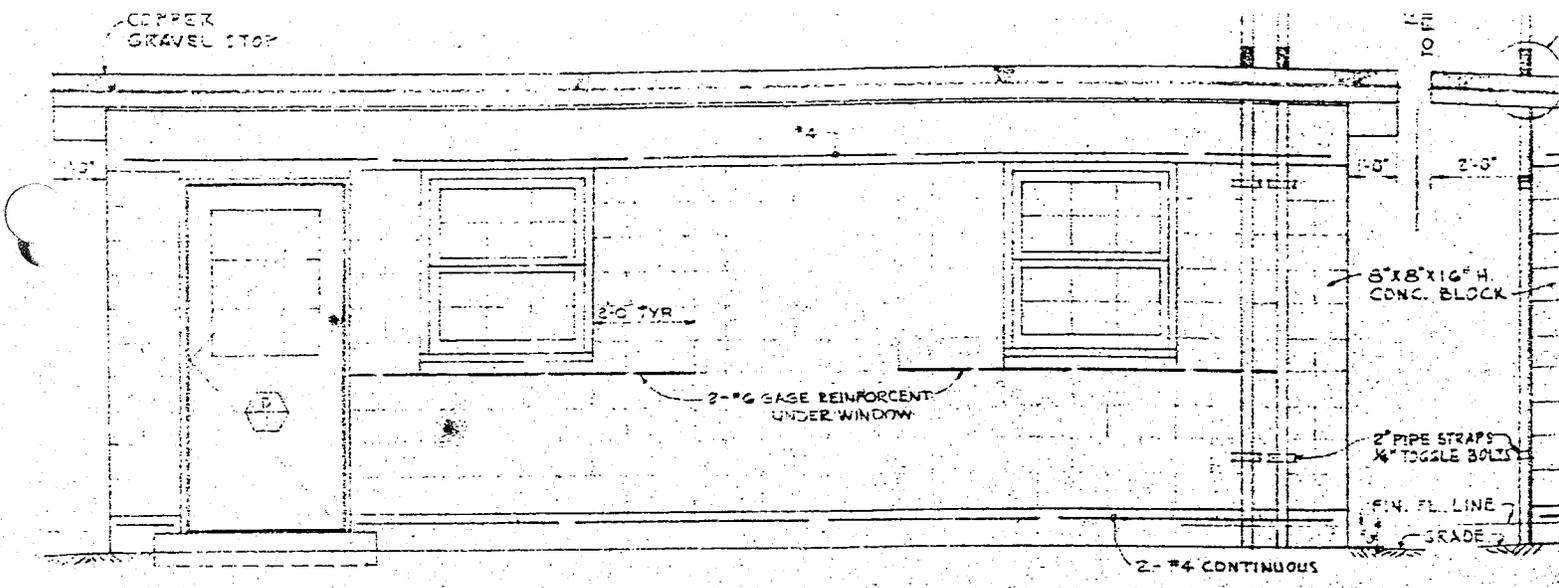

NORTH ELEVATION
SCALE 1/4" = 1'-0"

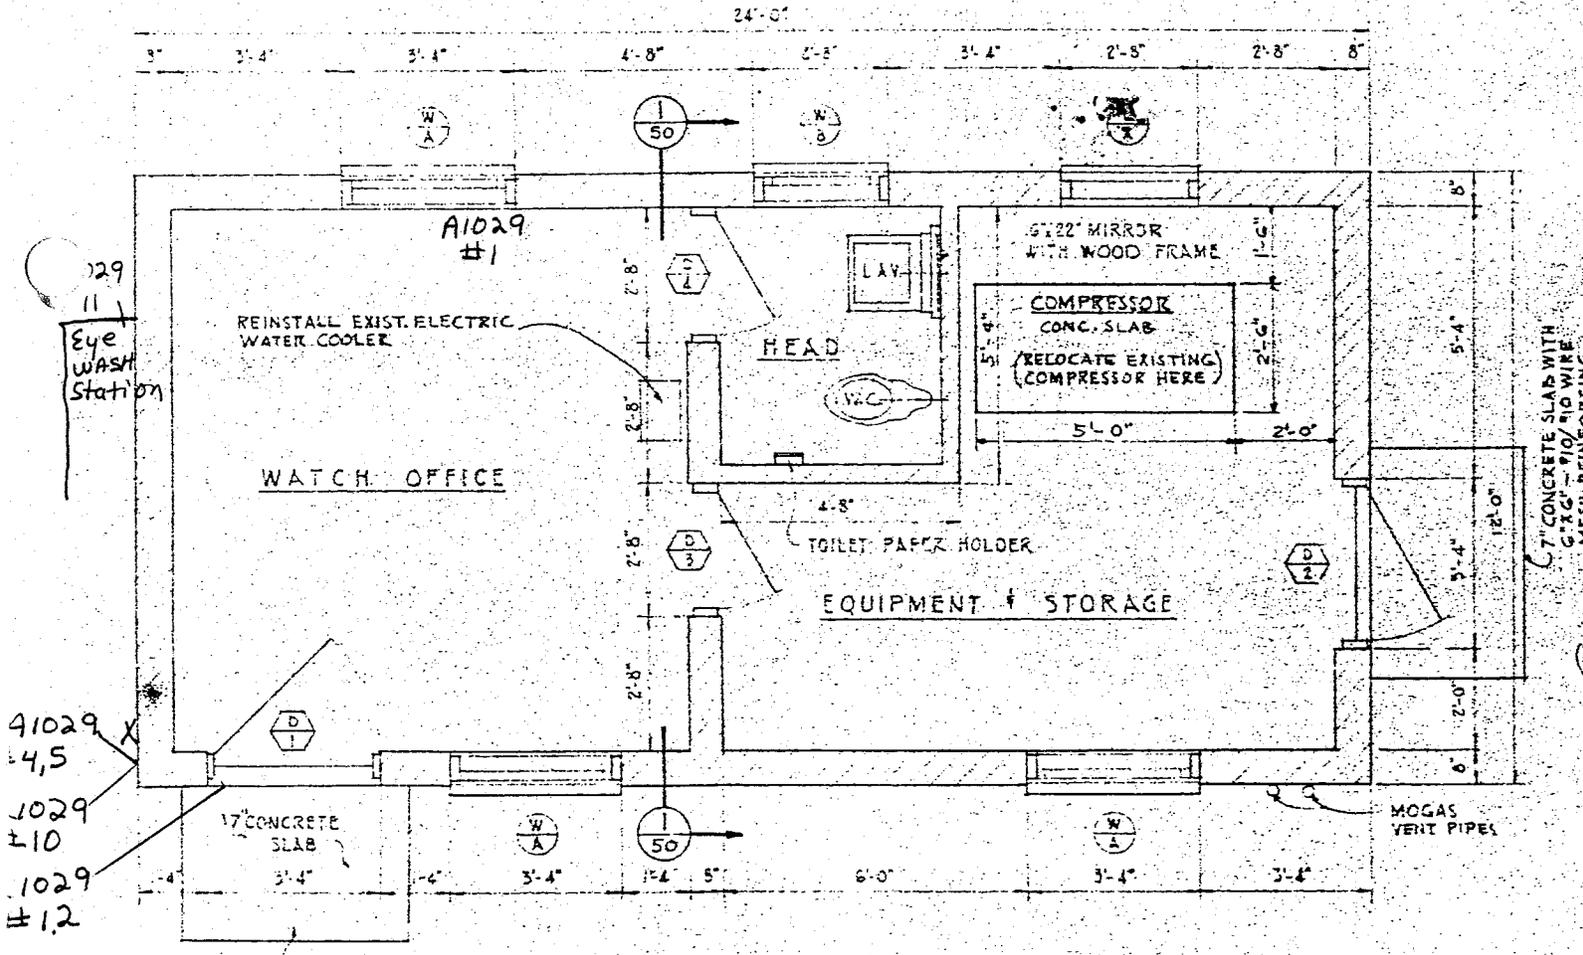

FLOOR PLAN
SCALE 1/4" = 1'-0"

1029 #1
Eye Wash Station
1029 #4,5
1029 #10
1029 #12



BLDG. #2127
MOGAS Station



ASBESTOS BULK SAMPLING LOG

NAF MIDWAY

THE SZARAS COMPANIES

PAGE 1 of 1

DATE SAMPLES COLLECTED: November 4, 1993

SAMPLE ID NO	SAMPLE LOCATION / DESCRIPTION	ANALYTICAL RESULTS	FRIABLE	CONDITION	AMOUNT
BUILDING NUMBER 2402		BUILDING NAME Cold Storage		BUILDING DESCRIPTION 1 Story	
TSC PROJECT NUMBER 865		TSC INSPECTOR J. Kain and B. Kain		TSC LABORATORY ID No. 111693H	
A1104-11	Interior northeast side, office Black with green and white 9" x 9" floor tile	Tile - 9% Chrysotile Mastic - 4% Chrysotile	No	Fair	150 sq. ft.
A1104-12	Interior Room 2 Black tar paper inside wall	None detected	No	Poor	6,500 sq. ft.
A1104-13	Interior Room 2 Concrete from wall	None detected	No	Poor	9,700 sq. ft.
A1104-14	Interior Room 4 Joint compound between black foam	None detected	No	Poor	6,000 sq. ft.
A1104-15	Interior Room 10 White board over black foam	None detected	No	Poor	6,000 sq. ft.
A1105-16	Interior ceiling Room 3 Tar paper with foil under black insulation	None detected	No	Poor	6,000 sq. ft.
A1105-17	Interior transformer room Exhaust gasket from engine	80% Chrysotile	No	Good	25 sq. ft.

It is assumed that anywhere the above identified asbestos containing building materials are found in the building, that those materials also contain asbestos and should be treated as such.



ASBESTOS BULK SAMPLING LOG

NAF MIDWAY

THE SZARAS COMPANIES

PAGE 1 of 1 DATE SAMPLES COLLECTED: November 19, 1993

SAMPLE ID NO	SAMPLE LOCATION / DESCRIPTION	ANALYTICAL RESULTS	FRIABLE	CONDITION	AMOUNT										
<table border="1" style="width: 100%; border-collapse: collapse; margin-bottom: 10px;"> <tr> <td style="width: 30%;">BUILDING NUMBER 2403</td> <td style="width: 35%;">BUILDING NAME General Storage/Fuel Office</td> <td colspan="3">BUILDING DESCRIPTION 1 Story</td> </tr> <tr> <td>TSC PROJECT NUMBER 865</td> <td>TSC INSPECTOR J. Kain and B. Kain</td> <td colspan="3">TSC LABORATORY ID No. 113093J</td> </tr> </table>						BUILDING NUMBER 2403	BUILDING NAME General Storage/Fuel Office	BUILDING DESCRIPTION 1 Story			TSC PROJECT NUMBER 865	TSC INSPECTOR J. Kain and B. Kain	TSC LABORATORY ID No. 113093J		
BUILDING NUMBER 2403	BUILDING NAME General Storage/Fuel Office	BUILDING DESCRIPTION 1 Story													
TSC PROJECT NUMBER 865	TSC INSPECTOR J. Kain and B. Kain	TSC LABORATORY ID No. 113093J													
INTERIOR:															
A1119-13	Northeast side Black with white and green streaks 9" x 9" floor tile	15% Chrysotile	No	Poor	150 sq. ft.										
A1119-14	Storage north end Black with white streaks 9" x 9" floor tile	Tile - 8% Chrysotile Mastic - 10% Chrysotile	No	Poor	260 sq. ft. mixed with A1119-15										
A1119-15	Storage north end Beige with brown and white streaks 9" x 9" floor tile	Tile - 1-2% Chrysotile Mastic - 8% Chrysotile	No	Poor	Mixed with A1119-14										
A1119-16	Southeast side Pipe lagging	37% Chrysotile	Yes	Fair	300 lin. ft. mixed with A1119-17										
A1119-17	Southeast side Pipe elbow insulation	26% Chrysotile	Yes	Fair	Mixed with A1119-16										
A1119-18	Northwest side Beige with brown streaks 9" x 9" floor tile	Tile - 10% Chrysotile Mastic - 5% Chrysotile	No	Poor	5,850 sq. ft.										
A1119-19	Fuel office Off-white with brown streaks 12" x 12" floor tile	Tile - 7% Chrysotile Mastic - 12%	No	Fair	260 sq. ft.										

It is assumed that anywhere the above identified asbestos containing building materials are found in the building, that those materials also contain asbestos and should be treated as such.

LEAD BASED PAINT SAMPLING LOG


NAF MIDWAY

THE SZARAS COMPANIES

PAGE 1 of 1 DATE SAMPLES COLLECTED: November 19, 1993

SAMPLE ID NO	SAMPLE LOCATION / DESCRIPTION	ANALYTICAL RESULTS (PPM)	CONDITION	AMOUNT
BUILDING NUMBER 2403		BUILDING NAME General Storage/Fuel Office		BUILDING DESCRIPTION 1 Story
TSC PROJECT NUMBER 865		TSC INSPECTOR J. Kain and B. Kain		TSC LABORATORY ID NO. 113093G
INTERIOR:				
L1119-24	Storage northeast side Green paint on wall	469.5	Fair	12,000 sq. ft. mixed with L1119-25, 26 & 27
L1119-25	Storage northeast side Blue paint on trim	4,238.6	Fair	Mixed with L1119-24, 26 & 27
L1119-26	Storage south east side Yellow paint on wall	224,704.3	Fair	Mixed with L1119-24, 25 & 27
L1119-27	Storage southwest side Pink with green paint on wall	2,953.5	Fair	Mixed with L1119-24, 25 & 26
L1119-35	Women's restroom White paint on ceiling	2,707.5	Poor	13,000 sq. ft.
No sample collected	Electrical room Gray paint on voltage box Same as sample L1117-65, building 350	281,887.7	Fair	250 sq. ft.
EXTERIOR:				
L1119-34	Women's Restroom door south side Beige, blue and green paint on door jamb	66,675.0	Fair	225 sq. ft.

It is assumed that anywhere the above identified lead based paint materials are found in the building, that those materials also contain lead and should be treated as such.

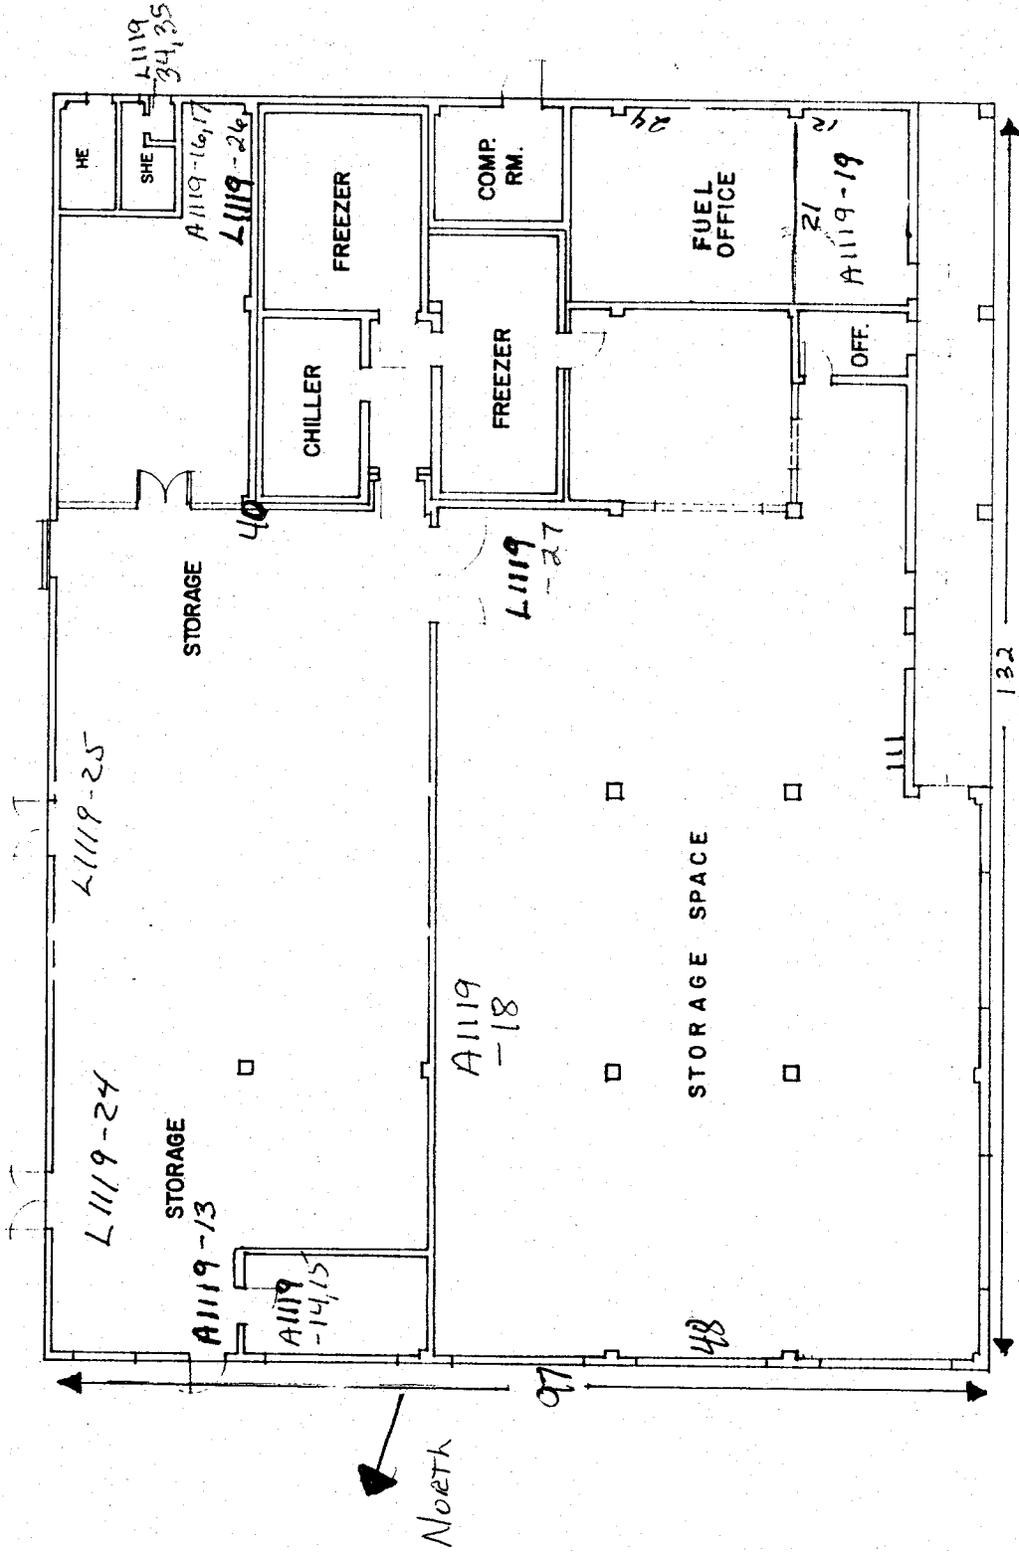

FLOOR PLAN

PICUNIQ MANAGEMENT CORPORATION
 NAVAL AIR FACILITY - MIDWAY ISLAND
GENERAL STORAGE / FUEL OFFICE
BLDG. 2403



ASBESTOS BULK SAMPLING LOG

NAF MIDWAY

THE SZARAS COMPANIES

PAGE 1 of 2 DATE SAMPLES COLLECTED: November 17, 1993

SAMPLE ID NO	SAMPLE LOCATION / DESCRIPTION	ANALYTICAL RESULTS	FRIABLE	CONDITION	AMOUNT
BUILDING NUMBER 2404		BUILDING NAME All Hands Club		BUILDING DESCRIPTION 1 Story	
TSC PROJECT NUMBER 865		TSC INSPECTOR J. Kain and B. Kain		TSC LABORATORY ID No. 113093D	
ROOF:					
A1117-11	Upper section west side Roof core; rock roof	None detected	No	Good	15,000 sq. ft.
A1117-12	Upper section west side Tar seal on vent	15% Chrysotile	No	Good	1,500 sq. ft.
A1117-13	Upper section west side White rolled roof shingle	None detected	No	Poor	500 sq. ft.
INTERIOR:					
A1117-14	North end by entrance door Beige with brown and white flecks 12" x 12" floor tile	Tile - None detected Mastic - 8% Chrysotile	No	Fair	450 sq. ft.
	2nd layer of sample A1117-14 Green floor tile		No	Unknown	Unknown
A1117-15	Ironwood Club south side Gray with orange and white streaks 9" x 9" floor tile	None detected	No	Fair	1,200 sq. ft. mixed with A1117-16 & 18
A1117-16	Ironwood Club south side Brown with orange and white streaks 9" x 9" floor tile	None detected	No	Fair	Mixed with A1117-15 & 18
A1117-17	Ironwood Club south side Suspended 2' x 4' ceiling tile	None detected	Yes	Fair	1,200 sq. ft.
A1117-18	Ironwood Club south side Green with dark green streaks 9" x 9" floor tile	Tile - None detected Mastic - <1% Chrysotile	No	Fair	Mixed with A1117-15 & 16
A1117-19	Recreation room west side Dark brown with beige and black flecks: 12" x 12" floor tile	Tile - None detected Mastic - 5% Chrysotile	No	Good	2,500 sq. ft.

It is assumed that anywhere the above identified asbestos containing building materials are found in the building, that those materials also contain asbestos and should be treated as such.

ASBESTOS BULK SAMPLING LOG

NAF MIDWAY

THE SZARAS COMPANIES

PAGE 2 of 2 DATE SAMPLES COLLECTED: November 17, 1993

SAMPLE ID NO	SAMPLE LOCATION / DESCRIPTION	ANALYTICAL RESULTS	FRIABLE	CONDITION	AMOUNT
BUILDING NUMBER 2404		BUILDING NAME All Hands Club		BUILDING DESCRIPTION 1 Story	
TSC PROJECT NUMBER 865		TSC INSPECTOR J. Kain and B. Kain		TSC LABORATORY ID No. 113093D	
A1117-20	Bar area west side Gold with brown and yellow flecks (2 layers)(black and white underneath) 12" x 12" floor tile	Tile - None detected Mastic - 5% Chrysotile	No	Good	3,400 sq. ft.
A1117-21	Cooler Black tar on ceiling	None detected	No	Fair	160 sq. ft.
A1117-22	Corridor Green with white and green 9" x 9" floor tile	Tile - None detected Mastic - 2% Chrysotile	No	Fair	300 sq. ft.
A1117-23	Accounting room Light brown with brown and gold flecks 9" x 9" floor tile	Tile - 1-2% Chrysotile Mastic - 3% Chrysotile	No	Fair	140 sq. ft.
A1117-24	Storage room west side Off-white with beige flecks 12" x 12" floor tile	Tile - <1% Chrysotile Mastic - 12% Chrysotile	No	Fair	2,300 sq. ft.
A1117-25	A/C room Expansion joint	None detected	No	Fair	50 sq. ft.
A1117-26	Outside storage room west side Light brown with brown and white flecks: 12" x 12" floor tile	2% Chrysotile	No	Fair	400 sq. ft.

It is assumed that anywhere the above identified asbestos containing building materials are found in the building, that those materials also contain asbestos and should be treated as such.

LEAD BASED PAINT SAMPLING LOG


NAF MIDWAY

THE SZARAS COMPANIES

PAGE 1 of 2 DATE SAMPLES COLLECTED: November 17, 1993

SAMPLE ID NO	SAMPLE LOCATION / DESCRIPTION	ANALYTICAL RESULTS (PPM)	CONDITION	AMOUNT
INTERIOR:				
L1117-26	Ironwood Club north side behind air handler Green paint on wall behind panelling	4,333.5	Fair	1,800 sq. ft.
L1117-27	Bar area west wall Orange paint	41,844.2	Good	500 sq. ft.
L1117-28	Recreation area Off-white paint on wall	4,436.8	Good	2,600 sq. ft.
L1117-29	Bar area south wall Gold paint over stage area	30,957.4	Good	100 sq. ft.
L1117-30	Bar and stage area Gold paint on ceiling tile above suspended tile	1,830.6	Good	3,400 sq. ft.
L1117-31	Corridor Gold paint on wall	2,874.5	Fair	1,400 sq. ft.
L1117-32	Liquor room Mauve paint on wall	1,875.8	Fair	3,700 sq. ft.
L1117-33	Accounting office Beige paint on door	2,505.9	Poor	75 sq. ft.
L1117-34	Storage room Gold paint on ceiling tiles	1,346.7	Fair	2,300 sq. ft.
L1117-35	Kitchen off storage room Gold paint on ceiling	2,732.8	Poor	500 sq. ft.
L1117-36	Storage room east wall Yellow paint	3,354.0	Fair	2,500 sq. ft.

is assumed that anywhere the above identified lead based paint materials are found in the building, that those materials also contain lead and should be treated as such.

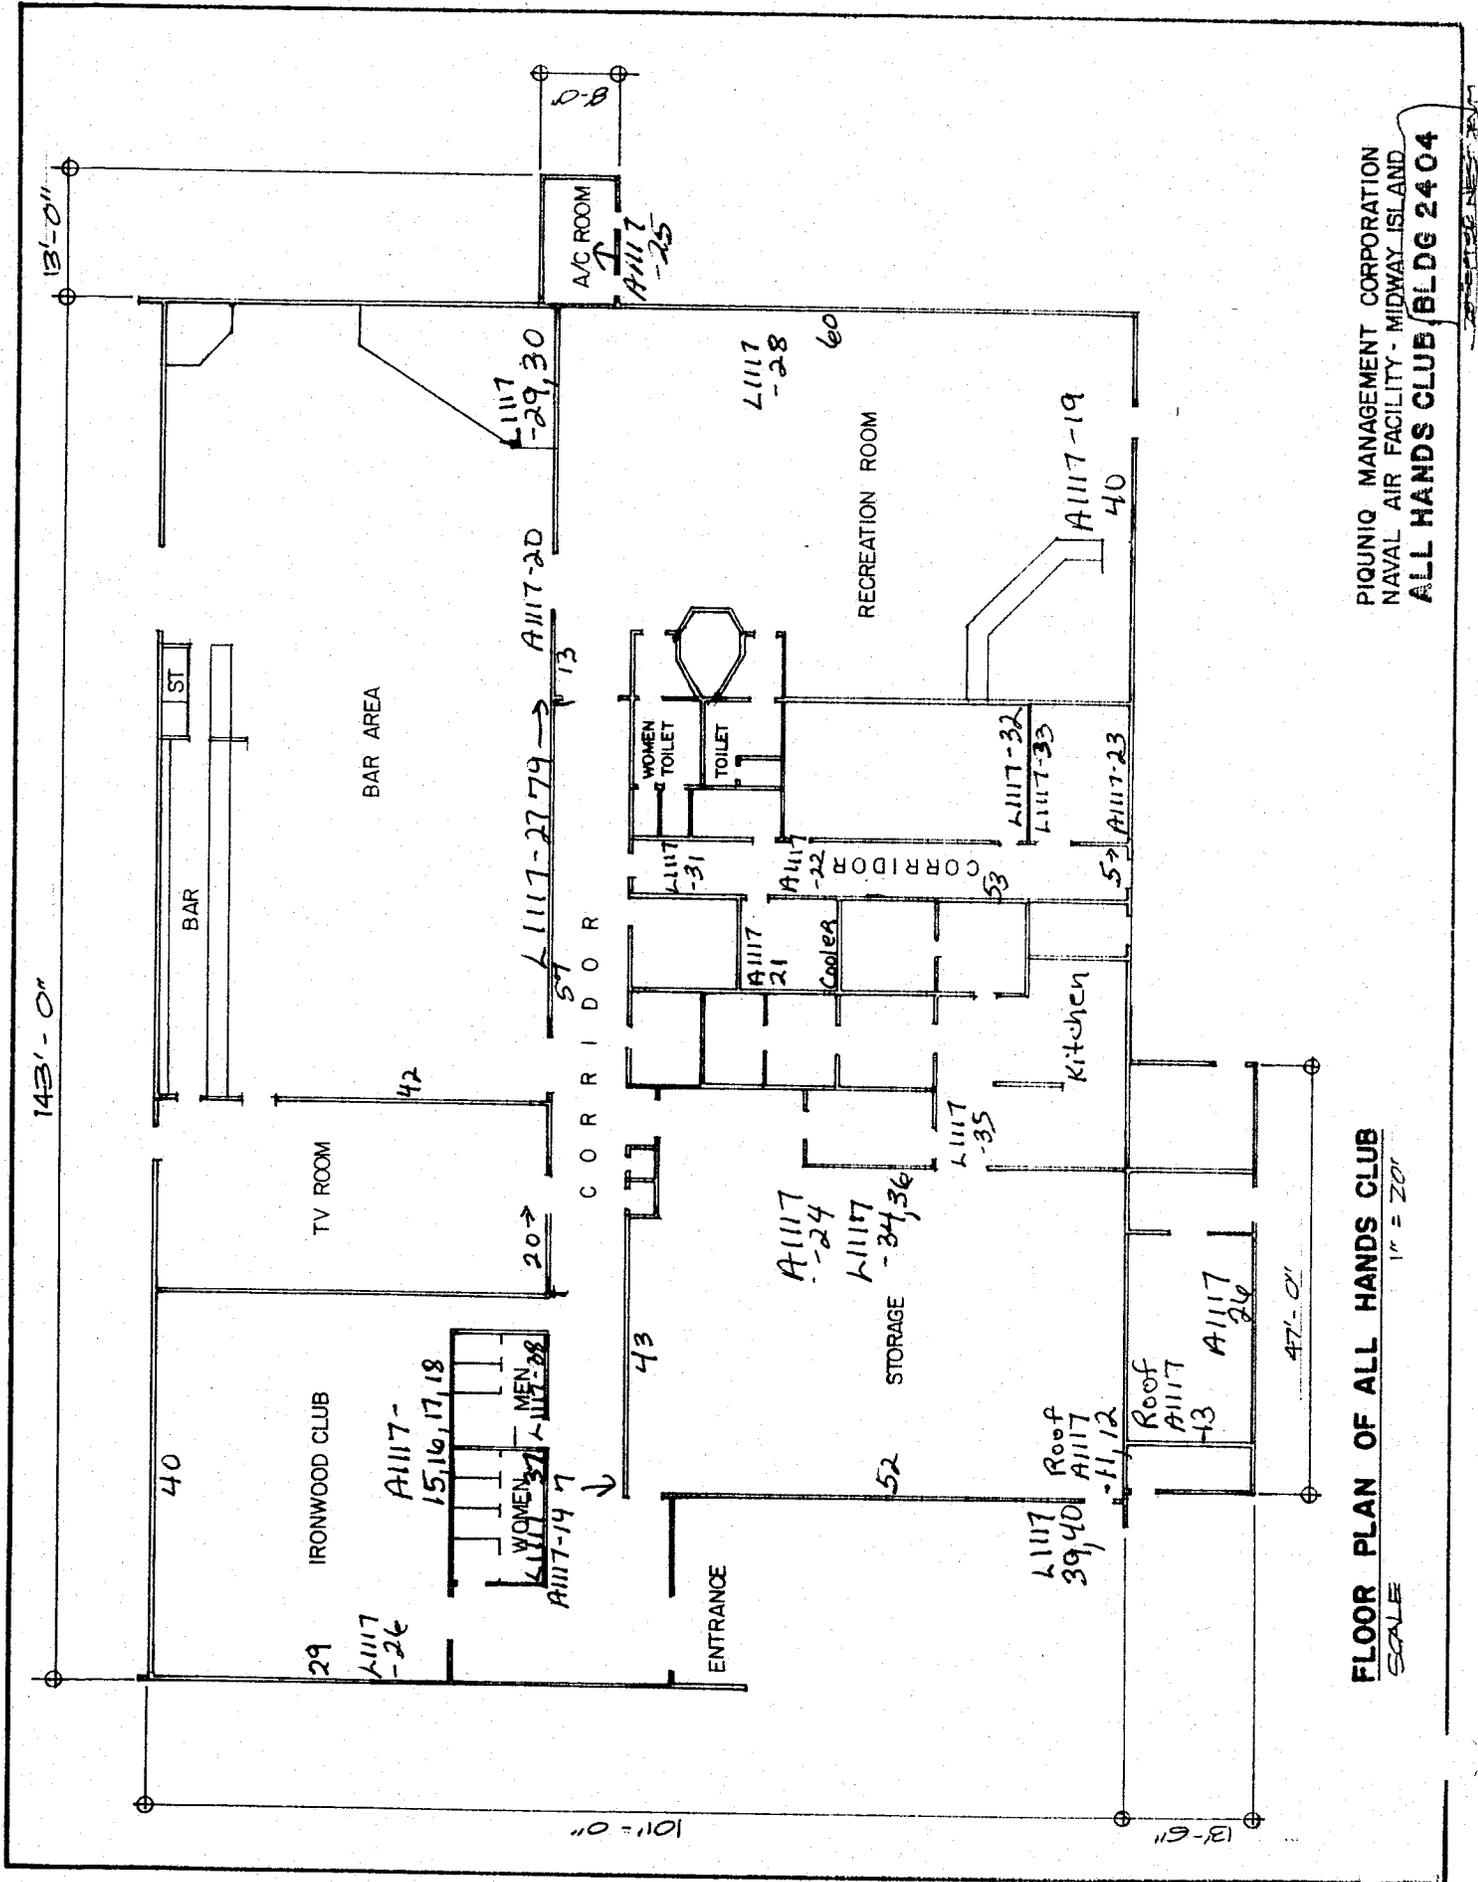

PIQUINQ MANAGEMENT CORPORATION
 NAVAL AIR FACILITY - MIDWAY ISLAND
ALL HANDS CLUB BLDG 2404

FLOOR PLAN OF ALL HANDS CLUB
 SCALE 1" = 20'



LEAD BASED PAINT SAMPLING LOG


NAF MIDWAY

THE SZARAS COMPANIES

PAGE 1 of 1 DATE SAMPLES COLLECTED: November 15, 1993

BUILDING NUMBER 2407		BUILDING NAME Electrical Sub-Station		BUILDING DESCRIPTION 1 Story	
TSC PROJECT NUMBER 865		TSC INSPECTOR J. Kain and B. Kain		TSC LABORATORY ID No. 112393E	
SAMPLE ID NO	SAMPLE LOCATION / DESCRIPTION	ANALYTICAL RESULTS (PPM)	CONDITION	AMOUNT	
	INTERIOR:				
L1115-38	Door Green paint	47,500.0	Good	100 sq. ft.	
L1115-39	2400 volt switch south side Dark gray paint on switch	575.2	Good	100 sq. ft.	
	EXTERIOR:				
L1115-40	South side Off-white paint	27,921.7	Good	800 sq. ft.	
L1115-41	Caged area north end Off-white paint on board to cage	137,196.9	Good	400 sq. ft.	

It is assumed that anywhere the above identified lead based paint materials are found in the building, that those materials also contain lead and should be treated as such.

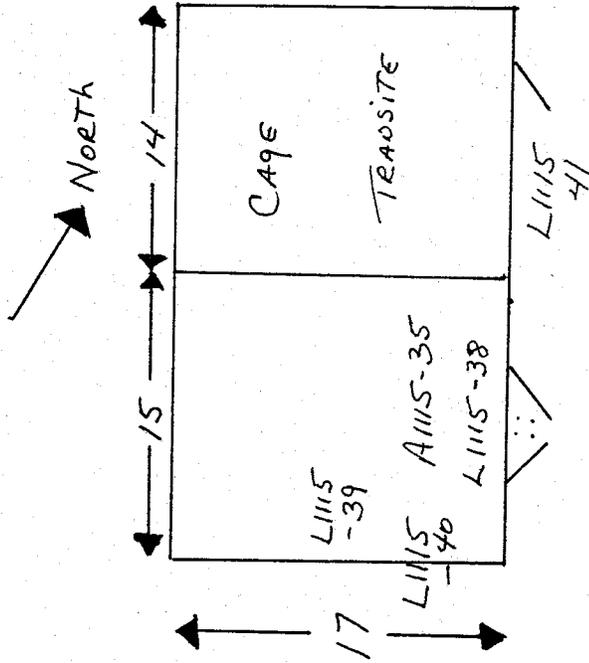

Bld # 240Z
ELECTRICAL
Sub STATION



LEAD BASED PAINT SAMPLING LOG

NAF MIDWAY


THE SZARAS COMPANIES

PAGE 1 of 1 DATE SAMPLES COLLECTED: November 15, 1993

BUILDING NUMBER 2409		BUILDING NAME Gooney Bird Memorial		BUILDING DESCRIPTION Memorial	
TSC PROJECT NUMBER 865		TSC INSPECTOR J. Kain and B. Kain		TSC LABORATORY ID No. 112393E	
SAMPLE ID NO	SAMPLE LOCATION / DESCRIPTION	ANALYTICAL RESULTS (PPM)	CONDITION	AMOUNT	
	EXTERIOR:				
L1115-44	Gun, south side Gray paint	9,340.9	Good	350 sq. ft.	
L1115-45	Blue paint on steps	951.1	Good	600 sq. ft.	
L1115-46	Concrete pillars south side White paint	472.7	Good	900 sq. ft.	
L1115-47	Gooney Bird Black paint on tail	367.5	Good	50 sq. ft.	
L1115-48	Gooney Bird Yellow paint on feet and beak	955.7	Good	30 sq. ft.	


It is assumed that anywhere the above identified lead based paint materials are found in the building, that those materials also contain lead and should be treated as such.



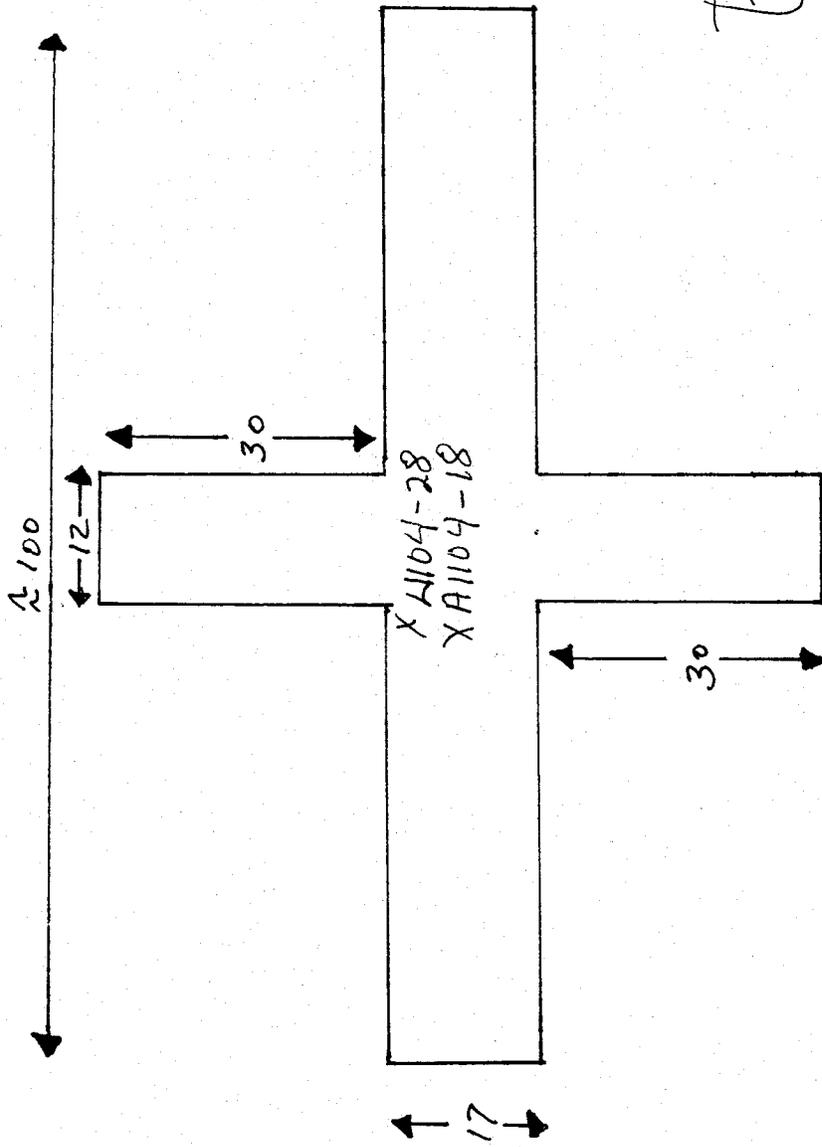


Bld # 2410
CONCRETE BUNKER



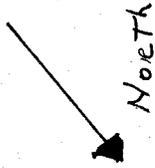

16

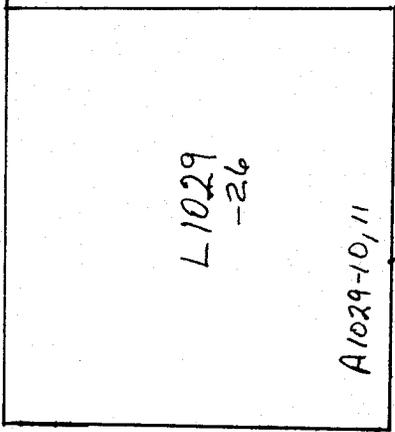

13

Bld 2411

FUEL FARM
LAB



LEAD BASED PAINT SAMPLING LOG

NAF MIDWAY

THE SZARAS COMPANIES


PAGE 1 of 1

DATE SAMPLES COLLECTED: November 1, 1993

SAMPLE ID NO	SAMPLE LOCATION / DESCRIPTION	ANALYTICAL RESULTS (PPM)	CONDITION	AMOUNT
BUILDING NUMBER 2412		BUILDING NAME Fuel Farm Storage		BUILDING DESCRIPTION 1 Story
TSC PROJECT NUMBER 865		TSC INSPECTOR J. Kain and B. Kain		TSC LABORATORY ID No. 110893M
L1029-28	Interior north side 1st floor Brown paint on doorjamb inside 3 ft. up, door (2), window frame (2) and garage door	447.9	Fair	400 sq. ft.
L1029-29	Interior northwest side garage 1st floor White paint on northwest wall	30,447.4	Poor	1,700 sq. ft.
L1029-30	Interior northwest side garage 1st floor Black paint on floor	59,944.4	Fair	710 sq. ft.
L1029-31	Exterior north side roof Silver paint on tin	1,011.4	Fair	1,000 sq. ft.
L1029-32	Exterior north side roof fascia board Brown paint on trim board	16,450.0	Fair	60 sq. ft.
L1029-33	Exterior west end (shed end) Off-white (with light green below) paint on tin	6,326.5	Fair	1,200 sq. ft.

It is assumed that anywhere the above identified lead based paint materials are found in the building, that those materials also contain lead and should be treated as such.


BID 2412
FUEL FARM
STORAGE

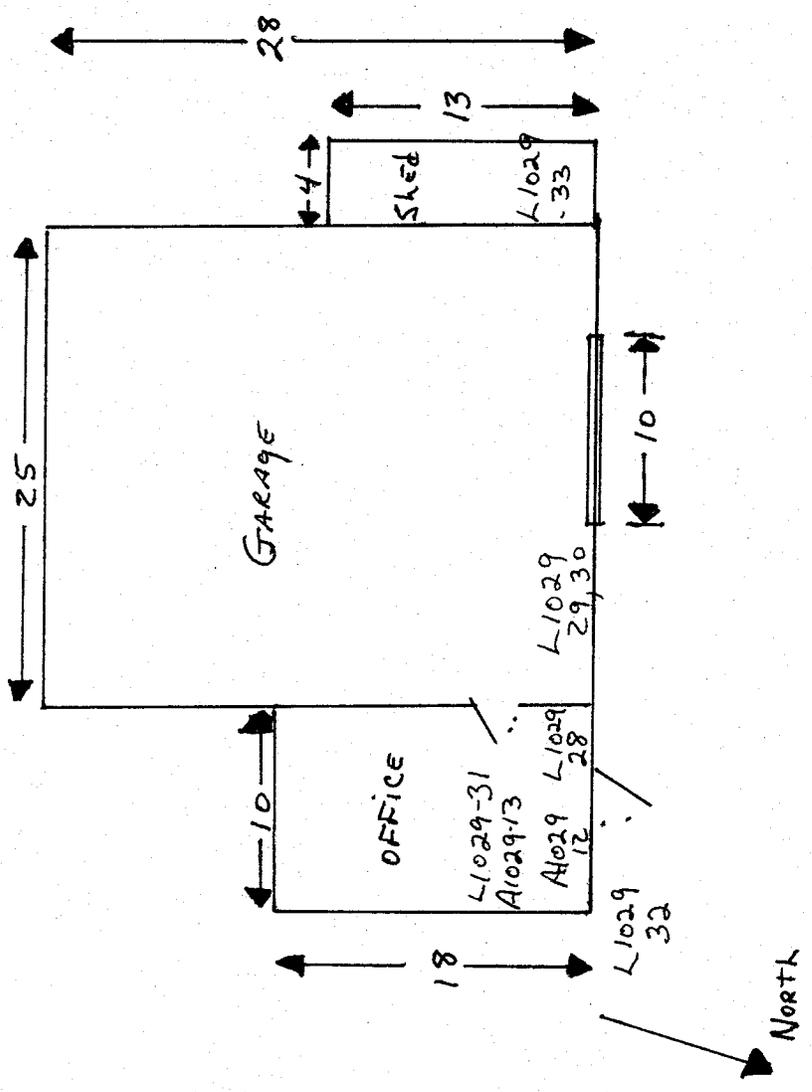







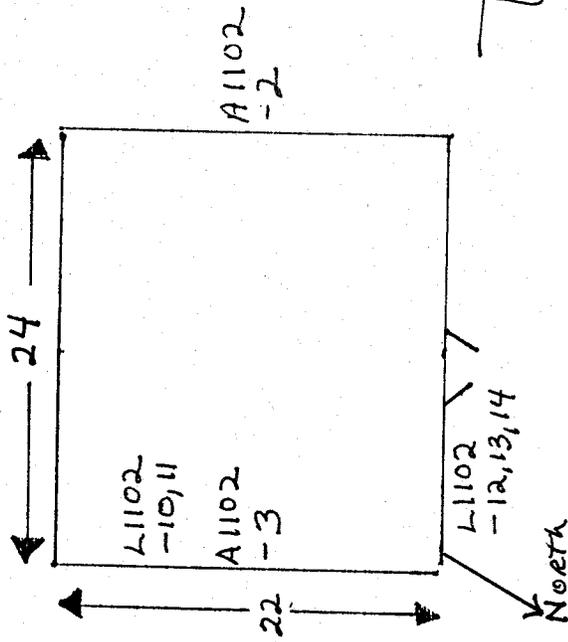

Bld. # 3142
GENERATOR ROOM

LEAD BASED PAINT SAMPLING LOG


NAF MIDWAY

THE SZARAS COMPANIES

PAGE 1 of 1 DATE SAMPLES COLLECTED: November 15, 1993

SAMPLE ID NO	SAMPLE LOCATION / DESCRIPTION	ANALYTICAL RESULTS (PPM)	CONDITION	AMOUNT								
<table border="1" style="width: 100%; border-collapse: collapse;"> <tr> <td style="width: 30%;">BUILDING NUMBER 3501</td> <td style="width: 35%;">BUILDING NAME R-3 Pumping Station</td> <td colspan="2">BUILDING DESCRIPTION 1 Story</td> </tr> <tr> <td>TSC PROJECT NUMBER 865</td> <td>TSC INSPECTOR J. Kain and B. Kain</td> <td colspan="2">TSC LABORATORY ID No. 112393E</td> </tr> </table>					BUILDING NUMBER 3501	BUILDING NAME R-3 Pumping Station	BUILDING DESCRIPTION 1 Story		TSC PROJECT NUMBER 865	TSC INSPECTOR J. Kain and B. Kain	TSC LABORATORY ID No. 112393E	
BUILDING NUMBER 3501	BUILDING NAME R-3 Pumping Station	BUILDING DESCRIPTION 1 Story										
TSC PROJECT NUMBER 865	TSC INSPECTOR J. Kain and B. Kain	TSC LABORATORY ID No. 112393E										
INTERIOR:												
L1115-1	Transformer room south side Gray paint on voltage box	106,612.9	Poor	500 sq. ft.								
L1115-2	Transformer room Green paint on door	20,989.6	Fair	100 sq. ft.								
L1115-3	South side Blue paint on pipes	23,611.1	Good	500 sq. ft.								
L1115-4	South side Medium green paint on floor	7,600.0	Fair	1,500 sq. ft.								
L1115-5	South side Orange paint on handrail	52,313.8	Good	150 sq. ft.								
L1115-6	North side Light green paint on pillars/ceiling	692.6	Fair	1,500 sq. ft.								
No sample collected	White paint on wall Same as sample L1112-43, building 347	23,833.3	Good	1,400 sq. ft.								
EXTERIOR:												
No sample collected	Door Brown paint Same as sample L1112-39, building 347	12,150.5	Good	1,300 sq. ft.								
No sample collected	Step Yellow paint on concrete Same as sample L1112-40, building 347	39,795.9	Fair	50 sq. ft.								
No sample collected	Wall Off-white paint Same as sample L1112-38, building 347	1,818.4	Good	1,800 sq. ft.								
L1115-7	West end Medium blue paint on 12" pipes	None detected	Fair	20 Ft.								

It is assumed that anywhere the above identified lead based paint materials are found in the building, that those materials also contain lead and should be treated as such.

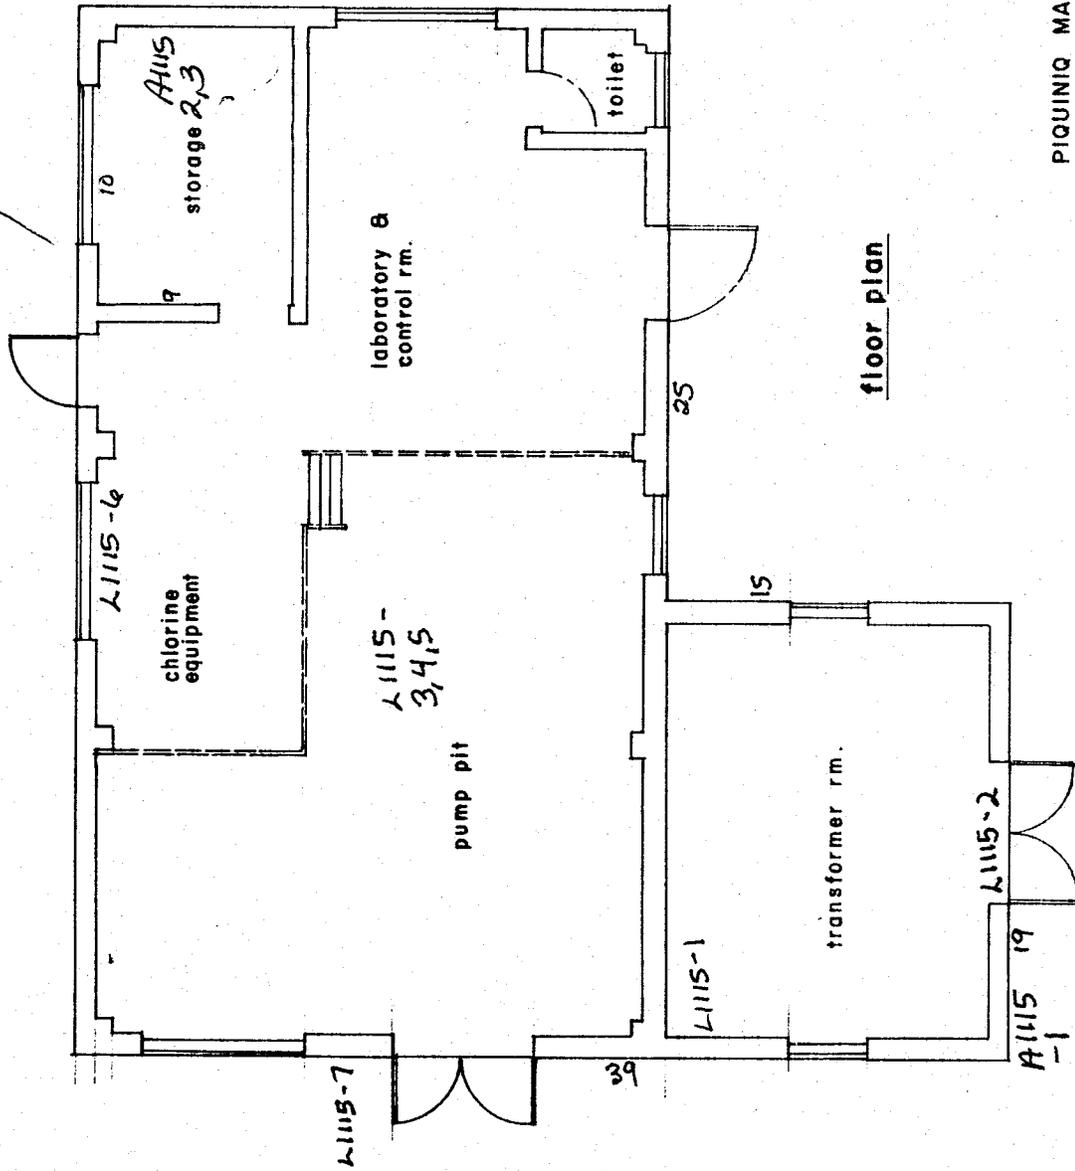

floor plan

PIQUINIQ MANAGEMENT CORPORATION
NAVAL AIR FACILITY - MIDWAY ISLAND

R-3 PUMPING STATION BLDG. 3501



ASBESTOS BULK SAMPLING LOG

NAF MIDWAY

THE SZARAS COMPANIES

PAGE 1 of 2 DATE SAMPLES COLLECTED: November 22, 1993

SAMPLE ID NO	SAMPLE LOCATION / DESCRIPTION	ANALYTICAL RESULTS	FRIABLE	CONDITION	AMOUNT
BUILDING NUMBER 3502		BUILDING NAME Galley		BUILDING DESCRIPTION 1 Story	
TSC PROJECT NUMBER 865		TSC INSPECTOR J. Kain and B. Kain		TSC LABORATORY ID No. 113093I	
INTERIOR:					
A1122-20	Dry storage west side Beige with shades of brown flecks 12" x 12" floor tile	Tile - 3% Chrysotile Mastic - 8% Chrysotile	No	Good	1,000 sq. ft.
A1122-21	Corridor Suspended 2' x 2' ceiling tiles	None detected	Yes	Good	4,000 sq. ft.
A1122-22	Dining area center Off-white with beige and white flecks 12" x 12" floor tile	Tile - 4% Chrysotile Mastic - 12% Chrysotile	No	Good	5,800 sq. ft.
A1122-23	A/C room Green with white streaks 9" x 9" floor tile	Tile - 5% Chrysotile Mastic - 4% Chrysotile	No	Poor	75 sq. ft.
	2nd layer of sample A1122-23 Red 9" x 9" floor tile	Tile - 20% Chrysotile Mastic - 5% Chrysotile	No	Poor	Included with sample A1122-23
A1122-24	Dining area east side Glue-on 1' x 1' ceiling tile	None detected	Yes	Good	8,000 sq. ft.
	Note: No access to glue/mastic. Ceiling is 2 years old.				
A1122-27	Boiler room Boiler #1 - soft insulation	35% Chrysotile	Yes	Good	1,200 sq. ft.
A1122-28	Boiler room Boiler #1 - hard insulation	None detected	Yes	Good	1,200 sq. ft.
A1122-29	Boiler room Gasket on end of boiler #1	None detected	Yes	Good	100 sq. ft.
A1122-30	Boiler room Gasket on end of boiler #1	None detected	Yes	Good	100 sq. ft.

It is assumed that anywhere the above identified asbestos containing building materials are found in the building, that those materials also contain asbestos and should be treated as such.

LEAD BASED PAINT SAMPLING LOG

NAF MIDWAY

THE SZARAS COMPANIES

PAGE 1 of 2 DATE SAMPLES COLLECTED: November 22, 1993

SAMPLE ID NO	SAMPLE LOCATION / DESCRIPTION	ANALYTICAL RESULTS (PPM)	CONDITION	AMOUNT										
<table border="1" style="width: 100%; border-collapse: collapse;"> <tr> <td style="width: 30%;">BUILDING NUMBER 3502</td> <td style="width: 40%;">BUILDING NAME Galley</td> <td colspan="3">BUILDING DESCRIPTION 1 Story</td> </tr> <tr> <td>TSC PROJECT NUMBER 865</td> <td>TSC INSPECTOR J. Kain and B. Kain</td> <td colspan="3">TSC LABORATORY ID No. 113093H</td> </tr> </table>					BUILDING NUMBER 3502	BUILDING NAME Galley	BUILDING DESCRIPTION 1 Story			TSC PROJECT NUMBER 865	TSC INSPECTOR J. Kain and B. Kain	TSC LABORATORY ID No. 113093H		
BUILDING NUMBER 3502	BUILDING NAME Galley	BUILDING DESCRIPTION 1 Story												
TSC PROJECT NUMBER 865	TSC INSPECTOR J. Kain and B. Kain	TSC LABORATORY ID No. 113093H												
EXTERIOR:														
L1122-40	West side Yellow paint on wall	434.7	Good	15,000 sq. ft.										
L1122-48	Southeast wall Off-white paint	288.2	Good	6,900 sq. ft.										
No sample collected	Roof 10 lead seals in 3" pipes	N/A	Good	20 lin. ft.										
INTERIOR:														
L1122-41	Men's restroom north side Glossy off-white paint on wall	142.4	Good	1,200 sq. ft.										
L1122-42	Dry storage north wall Flat off-white paint	108.1	Good	7,000 sq. ft.										
L1122-43	Dry storage ceiling Off-white paint	1,303.9	Poor	6,000 sq. ft.										
L1122-44	Janitor closet Off-white with yellow paint on wall	16,712.5	Fair	250 sq. ft.										
L1122-45	Dining area south wall Off-white paint	179.2	Good	8,300 sq. ft.										
L1122-46	Dining area south wall Brown paint on baseboard	68.7	Fair	130 sq. ft.										
L1122-47	Dining area east wall Beige paint on window trims	175.6	Good	300 sq. ft.										
L1122-49	A/C room on northwest side Orange paint on floor	88,000.0	Good	100 sq. ft.										

It is assumed that anywhere the above identified lead based paint materials are found in the building, that those materials also contain lead and should be treated as such.

LEAD BASED PAINT SAMPLING LOG



NAF MIDWAY

THE SZARAS COMPANIES

PAGE 2 of 2 DATE SAMPLES COLLECTED: November 22, 1993

SAMPLE ID NO	SAMPLE LOCATION / DESCRIPTION	ANALYTICAL RESULTS (PPM)	CONDITION	AMOUNT
L1122-50	Boiler room east side of boiler #2 Orange paint on frame	11,337.5	Good	700 sq. ft.
L1122-51	Boiler room east wall Gray paint	579.2	Good	200 sq. ft.
L1122-52	Boiler room east wall Light green paint	8,571.4	Good	1,800 sq. ft.
L1122-53	Boiler room east wall Dark green paint	13,005.1	Good	400 sq. ft.
L1122-54	Boiler room boiler #2 Silver paint on pipes	53,963.4	Good	2,000 sq. ft.

It is assumed that anywhere the above identified lead based paint materials are found in the building, that those materials also contain lead and should be treated as such.

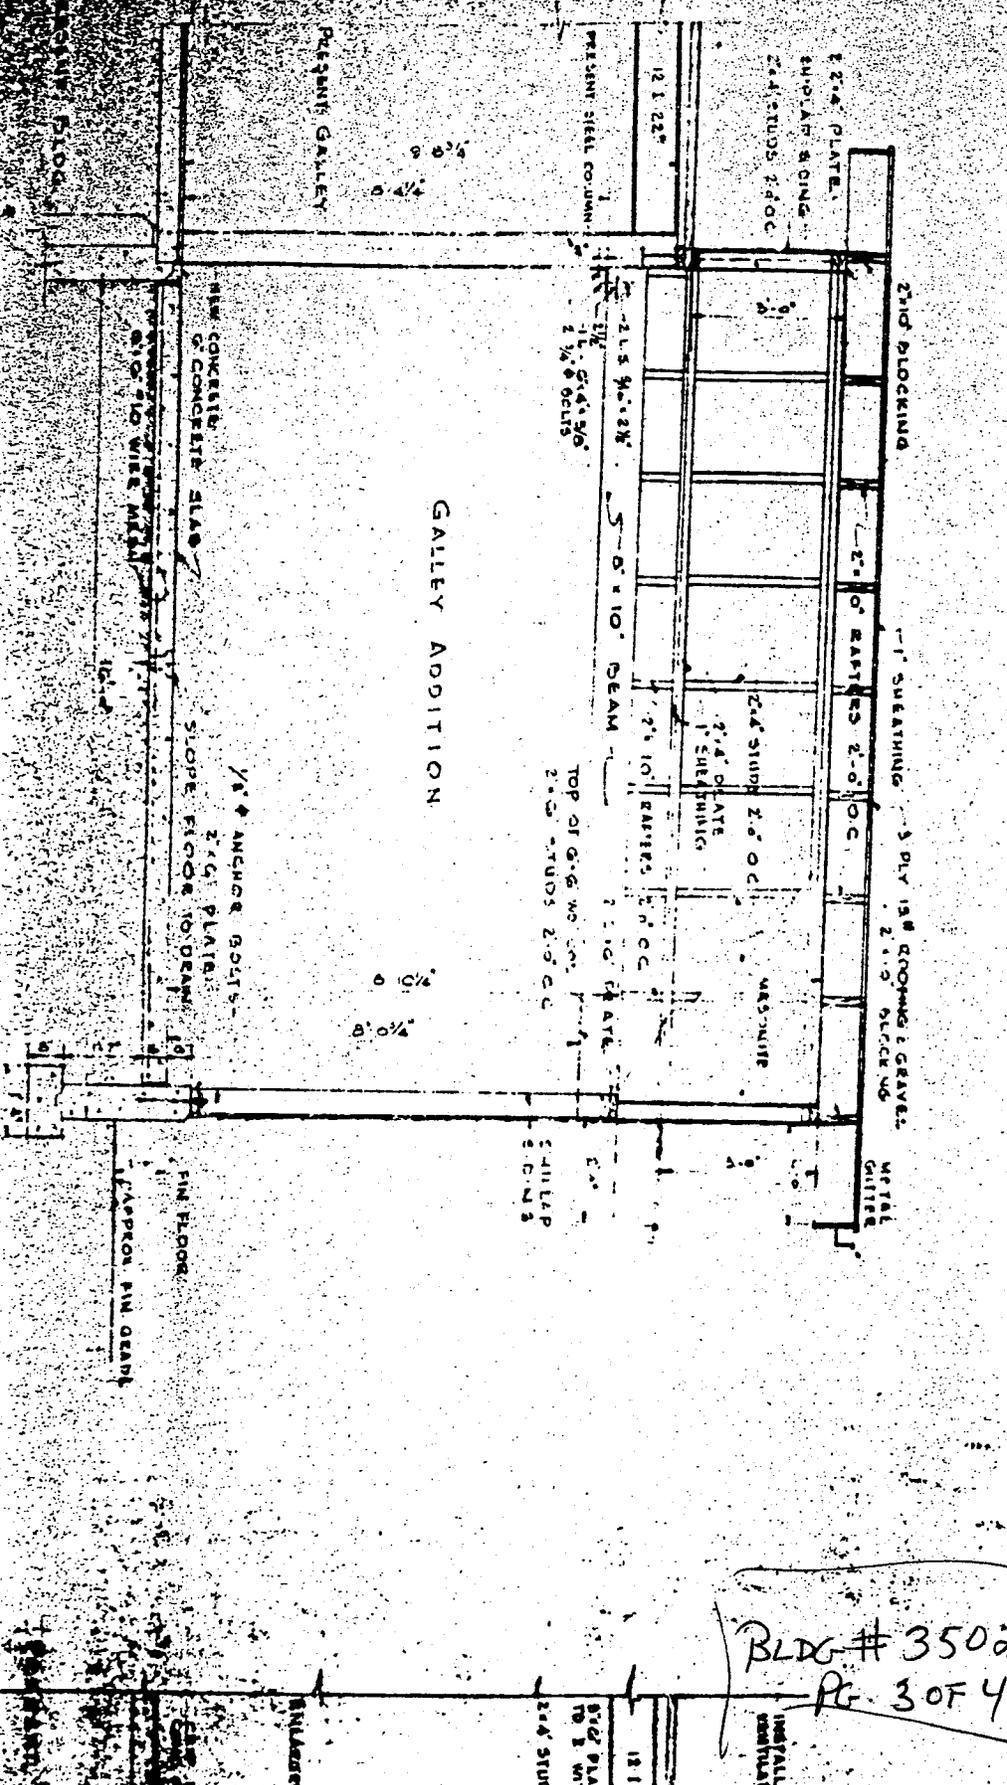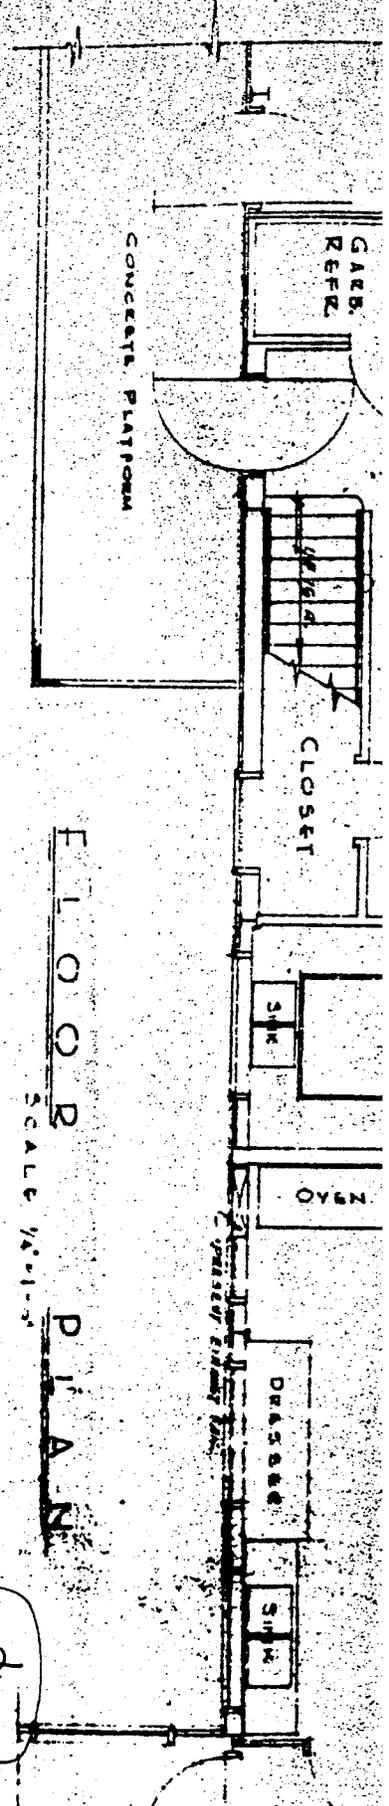

GALLEY ADDITION

SECTION A-A

SCALE 1/8" = 1'-0"

BLDG # 3502
PG. 3 OF 4

INSTALL
ventilation

INSTALL

INSTALL



LEAD BASED PAINT SAMPLING LOG


NAF MIDWAY

THE SZARAS COMPANIES


PAGE 1 of 1 DATE SAMPLES COLLECTED: November 19, 1993

SAMPLE ID NO	SAMPLE LOCATION / DESCRIPTION	ANALYTICAL RESULTS (PPM)	CONDITION	AMOUNT								
<table border="1" style="width: 100%; border-collapse: collapse; margin-bottom: 10px;"> <tr> <td style="width: 30%;">BUILDING NUMBER 3503</td> <td style="width: 35%;">BUILDING NAME BEQ Charlie Barracks</td> <td colspan="2">BUILDING DESCRIPTION 3 Story</td> </tr> <tr> <td>TSC PROJECT NUMBER 865</td> <td>TSC INSPECTOR J. Kain and B. Kain</td> <td colspan="2">TSC LABORATORY ID No. 113093G</td> </tr> </table>					BUILDING NUMBER 3503	BUILDING NAME BEQ Charlie Barracks	BUILDING DESCRIPTION 3 Story		TSC PROJECT NUMBER 865	TSC INSPECTOR J. Kain and B. Kain	TSC LABORATORY ID No. 113093G	
BUILDING NUMBER 3503	BUILDING NAME BEQ Charlie Barracks	BUILDING DESCRIPTION 3 Story										
TSC PROJECT NUMBER 865	TSC INSPECTOR J. Kain and B. Kain	TSC LABORATORY ID No. 113093G										
INTERIOR:												
L1119-18	Day room 1st floor Off-white paint on wall	5,016.5	Fair	58,000 sq. ft. mixed with L1119-20								
L1119-19	Stairwell north end 1st floor Gray paint on floor	559.0	Fair	3,000 sq. ft.								
L1119-20	Stairs north end 2nd floor Beige paint on wall	6,570.0	Good	Mixed with L1119-18								
L1119-21	North end 2nd floor Brown paint on baseboard	265.6	Fair	6,000 sq. ft.								
L1119-22	Hallway north end 2nd floor Brown paint on exit door	8,440.0	Good	800 sq. ft.								
L1119-23	Hallway north end 2nd floor Off-white paint on wall	599.4	Good	Mixed with L1119-18								
EXTERIOR:												
No sample collected	Off-white paint on wall Same as sample L1119-8, building 3504	197.9	Good	17,000 sq. ft.								
Note: Barracks in general are all the same color with the same floor tile.												


It is assumed that anywhere the above identified lead based paint materials are found in the building, that those materials also contain lead and should be treated as such.

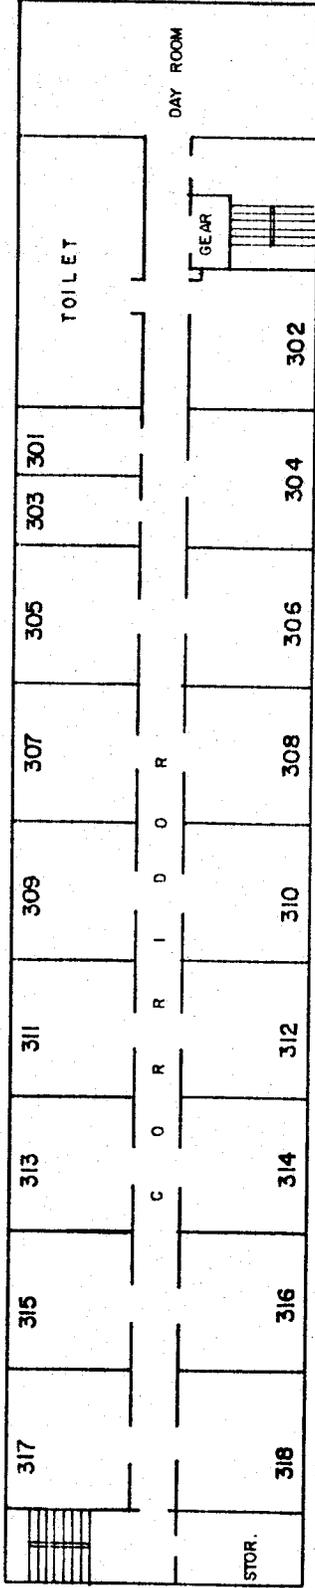

THIRD FLOOR PLAN

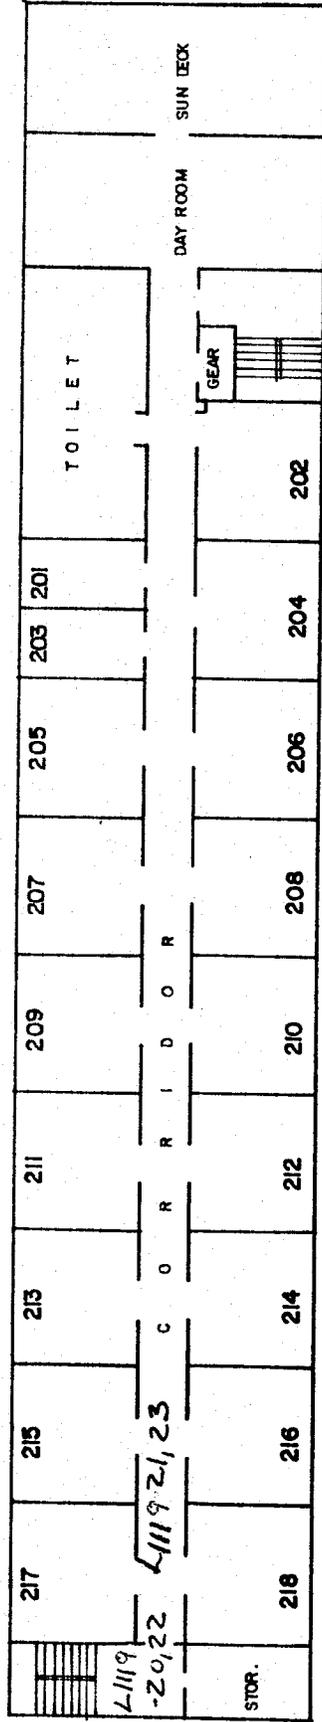

SECOND FLOOR PLAN

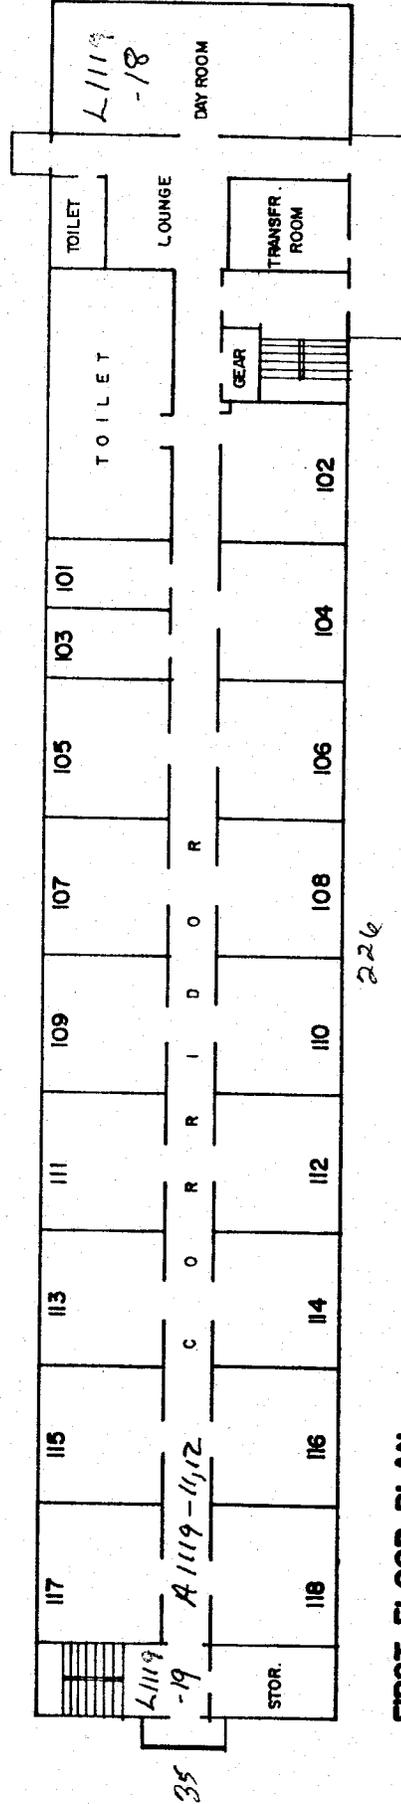


FIRST FLOOR PLAN

PIQUINQ MANAGEMENT CORPORATION
 NAVAL AIR FACILITY - MIDWAY ISLAND
B.E.Q. CHARLIE, BLDG. NO. 3503

226

4'-0" x 6'-0" CONC. SLAB 4" THICK WITH 6x6-8/8 WWF (TYPICAL AT ALL EXTERIOR DOORS)
THICKEN SLAB TO 6" ALL AROUND (TYP)

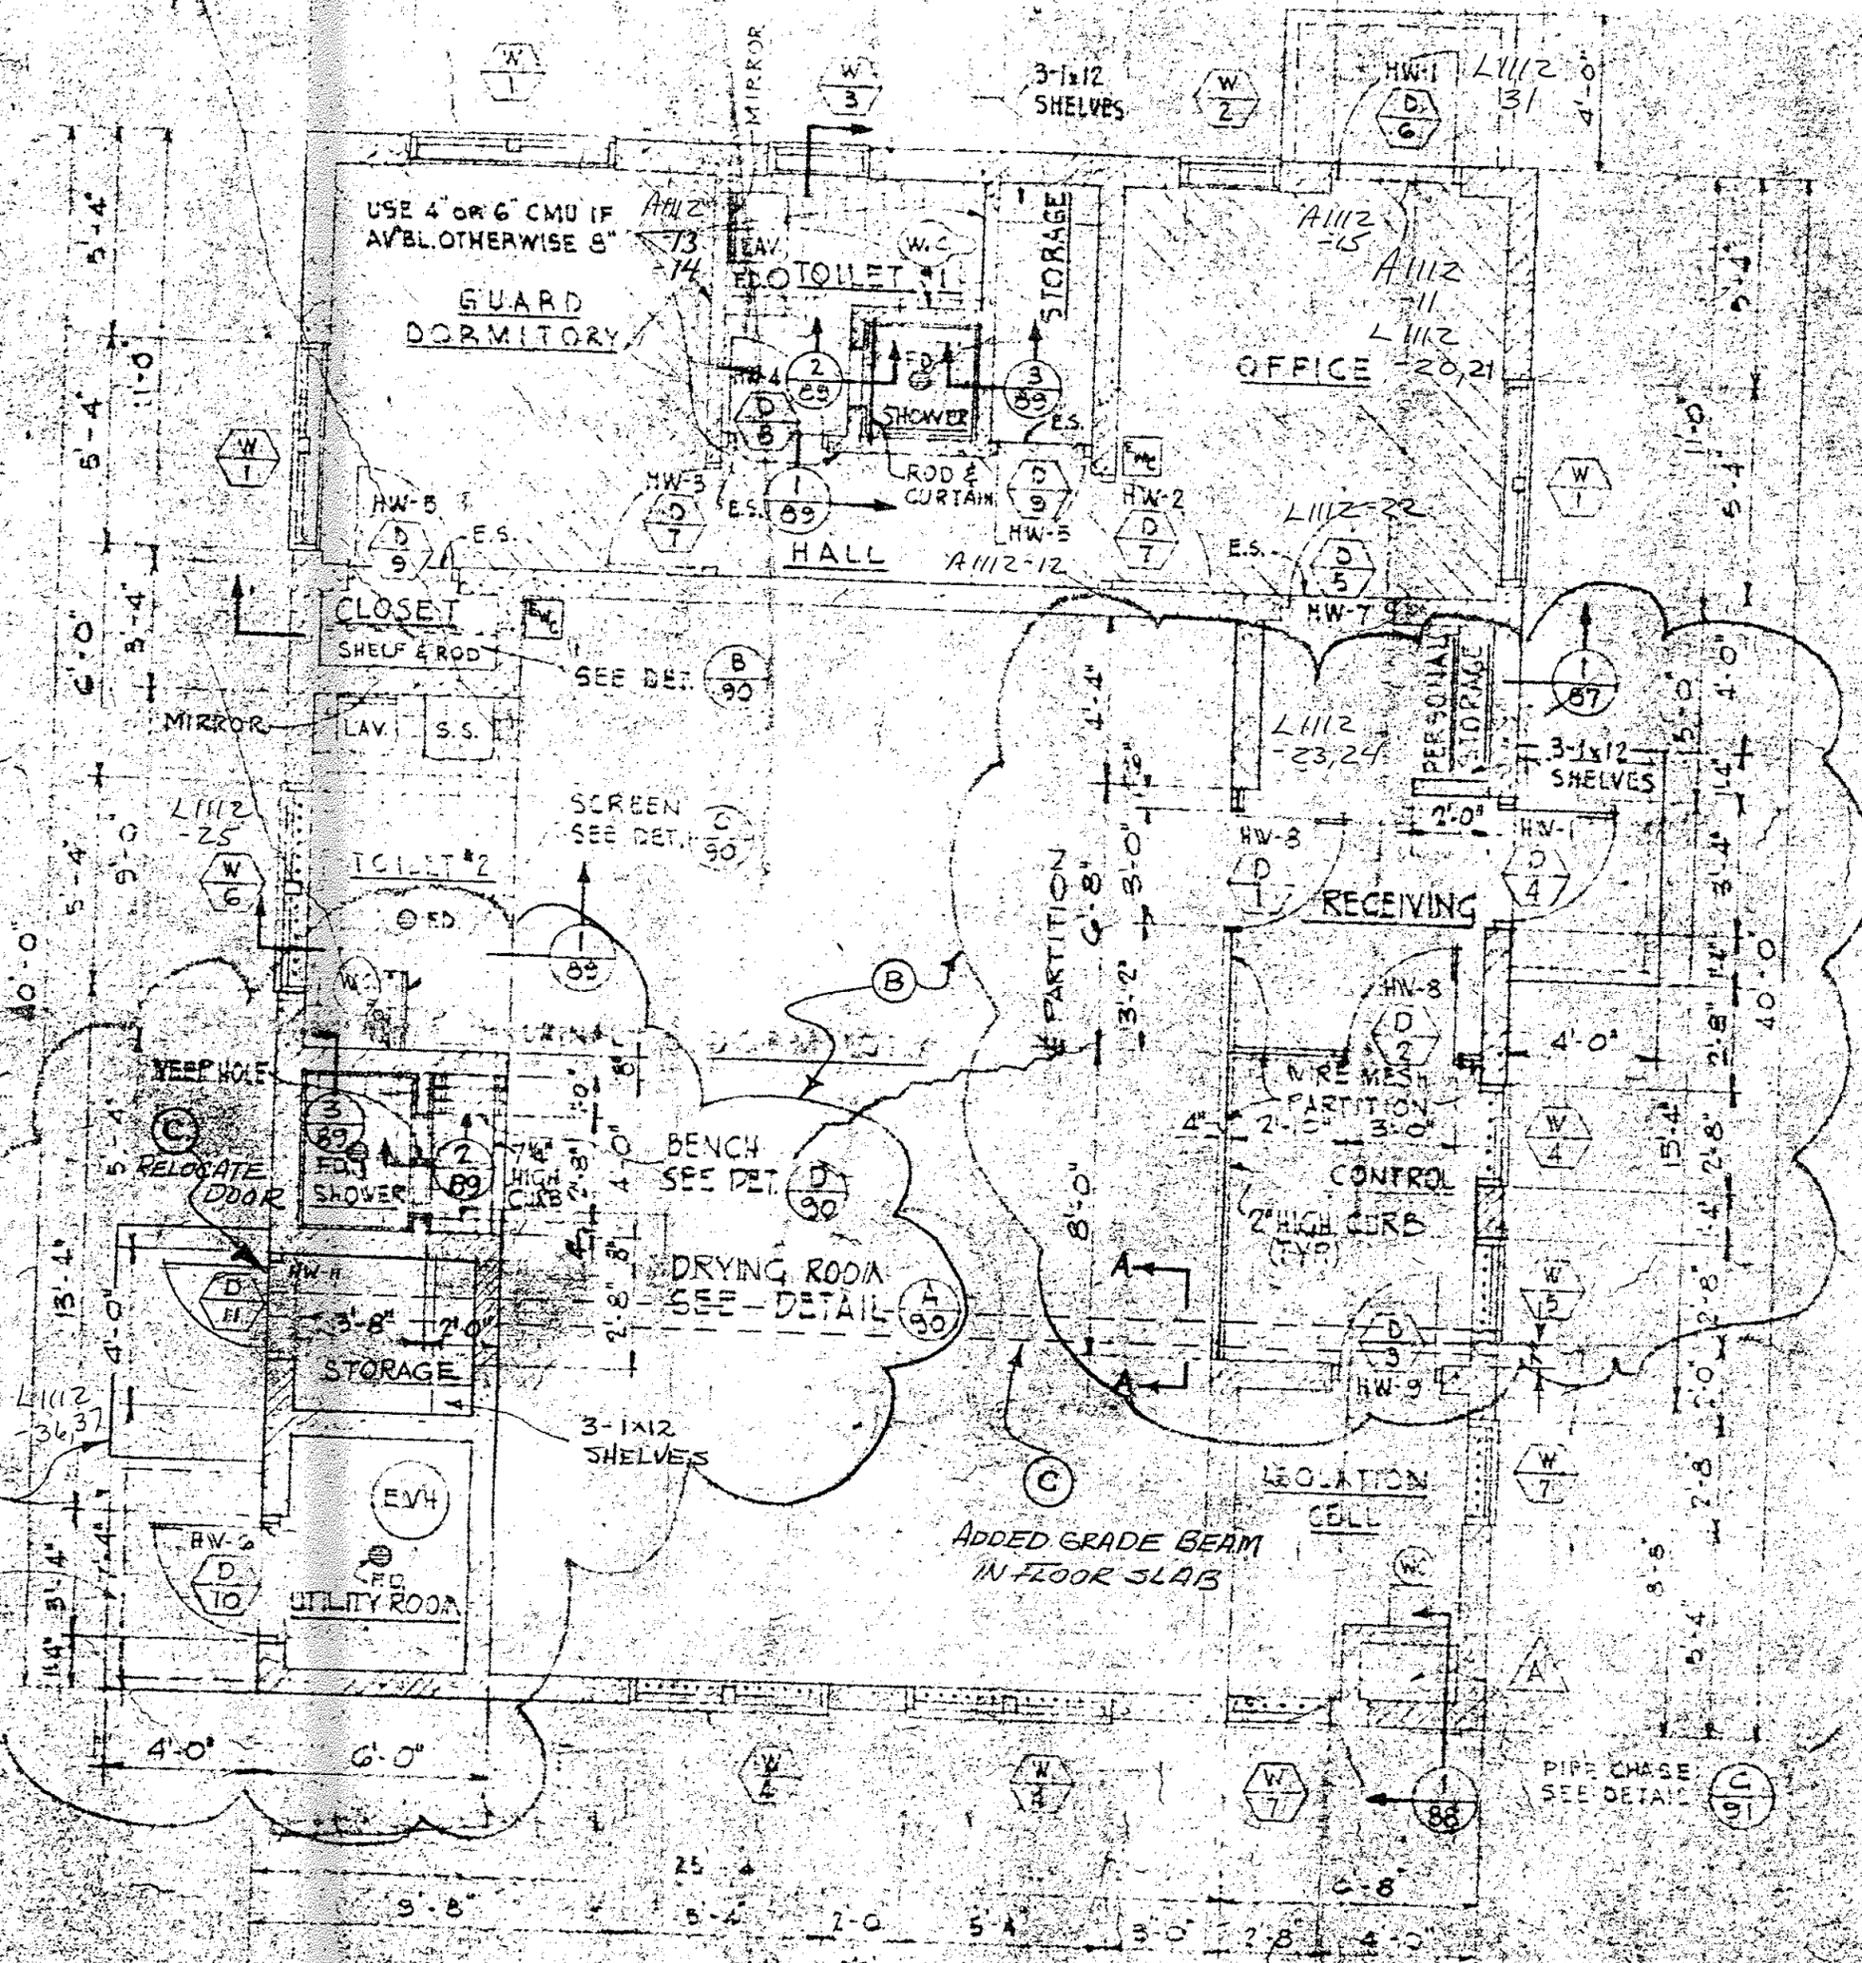

BUDG # 3513
BLDG 3513



LEAD BASED PAINT SAMPLING LOG


NAF MIDWAY

THE SZA RAS COMPANIES

PAGE 1 of 1 DATE SAMPLES COLLECTED: November 12, 1993

SAMPLE ID NO	SAMPLE LOCATION / DESCRIPTION	ANALYTICAL RESULTS (PPM)	CONDITION	AMOUNT								
<table border="1" style="width: 100%; border-collapse: collapse;"> <tr> <td style="width: 30%;">BUILDING NUMBER 3514</td> <td style="width: 35%;">BUILDING NAME Security Police Office</td> <td colspan="2">BUILDING DESCRIPTION 1 Story</td> </tr> <tr> <td>TSC PROJECT NUMBER 865</td> <td>TSC INSPECTOR J. Kain and B. Kain</td> <td colspan="2">TSC LABORATORY ID No. 112393A</td> </tr> </table>					BUILDING NUMBER 3514	BUILDING NAME Security Police Office	BUILDING DESCRIPTION 1 Story		TSC PROJECT NUMBER 865	TSC INSPECTOR J. Kain and B. Kain	TSC LABORATORY ID No. 112393A	
BUILDING NUMBER 3514	BUILDING NAME Security Police Office	BUILDING DESCRIPTION 1 Story										
TSC PROJECT NUMBER 865	TSC INSPECTOR J. Kain and B. Kain	TSC LABORATORY ID No. 112393A										
	INTERIOR:											
L1112-32	South wall Beige paint	20,025.0	Fair	700 sq. ft.								
L1112-33	West wall Blue paint	485.7	Fair	150 sq. ft.								
L1112-34	North wall Black paint on baseboard	312.5	Good	30 sq. ft.								
	EXTERIOR:											
No sample collected	Brown paint on door Same as sample L1112-22, building 3513	414.5	Fair	150 sq. ft.								
L1112-35	North wall Beige paint	1,238.5	Fair	600 sq. ft.								

It is assumed that anywhere the above identified lead based paint materials are found in the building, that those materials also contain lead and should be treated as such.

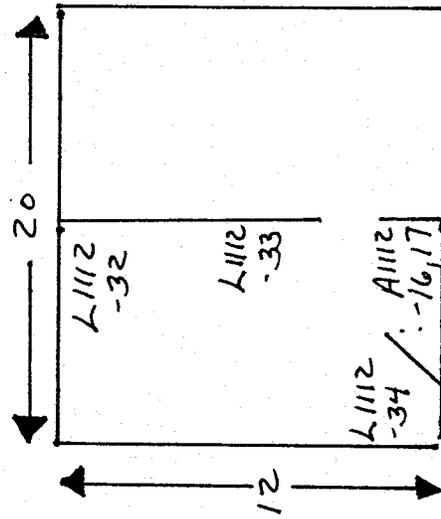

Bld # 3514
Security Police
OFFICE

L1112
35



LEAD BASED PAINT SAMPLING LOG


NAF MIDWAY

THE SZARAS COMPANIES

PAGE 1 of 1 DATE SAMPLES COLLECTED: November 16, 1993

SAMPLE ID NO	SAMPLE LOCATION / DESCRIPTION	ANALYTICAL RESULTS (PPM)	CONDITION	AMOUNT								
<table border="1" style="width: 100%; border-collapse: collapse;"> <tr> <td style="width: 30%;">BUILDING NUMBER 3515</td> <td style="width: 35%;">BUILDING NAME Laundry Room</td> <td colspan="2">BUILDING DESCRIPTION 1 Story</td> </tr> <tr> <td>TSC PROJECT NUMBER 865</td> <td>TSC INSPECTOR J. Kain and B. Kain</td> <td colspan="2">TSC LABORATORY ID No. 113093B</td> </tr> </table>					BUILDING NUMBER 3515	BUILDING NAME Laundry Room	BUILDING DESCRIPTION 1 Story		TSC PROJECT NUMBER 865	TSC INSPECTOR J. Kain and B. Kain	TSC LABORATORY ID No. 113093B	
BUILDING NUMBER 3515	BUILDING NAME Laundry Room	BUILDING DESCRIPTION 1 Story										
TSC PROJECT NUMBER 865	TSC INSPECTOR J. Kain and B. Kain	TSC LABORATORY ID No. 113093B										
INTERIOR:												
L1116-32	East wall Pale yellow paint	2,045.4	Fair	1,700 sq. ft.								
L1116-33	Door frame south side Blue paint	3,010.7	Fair	450 sq. ft.								
EXTERIOR:												
L1116-34	South side Off-white paint on wall	440.5	Good	1,700 sq. ft.								
L1116-35	South side Red paint on floor	209.5	Poor	25 sq. ft.								
No sample collected	Brown paint on door Same as sample L1116-37, building 3529	161.8	Fair	600 sq. ft.								

It is assumed that anywhere the above identified lead based paint materials are found in the building, that those materials also contain lead and should be treated as such.

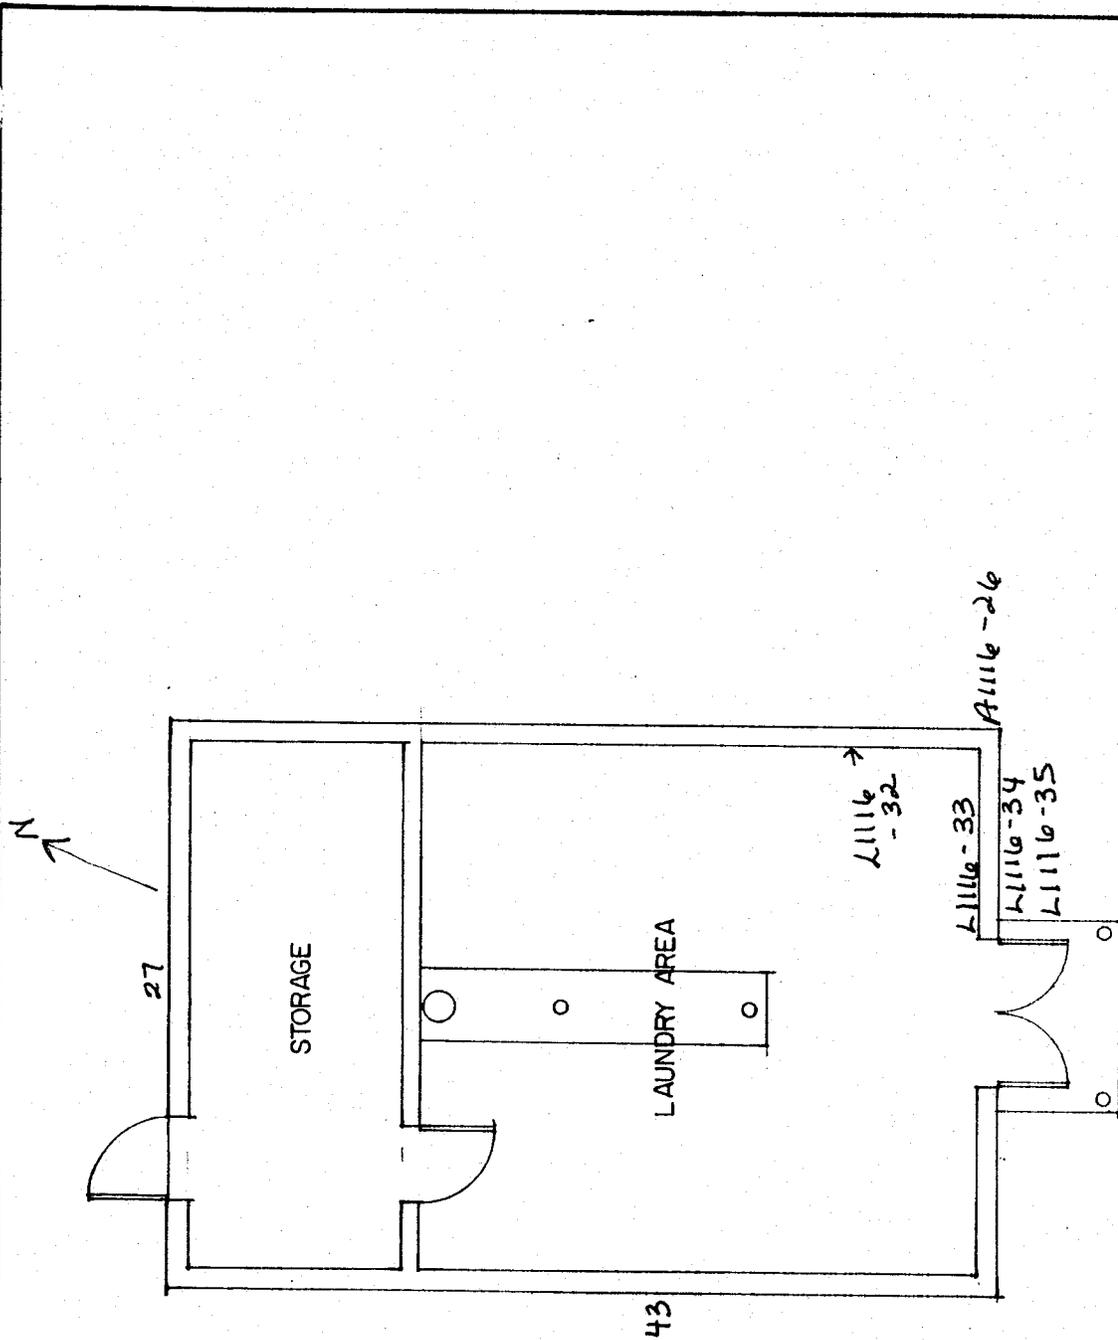


FLOOR PLAN

PIQUINQ MANAGEMENT CORPORATION
 NAVAL AIR FACILITY - MIDWAY ISLAND

LAUNDRY DETACHED, BLDG. 3515



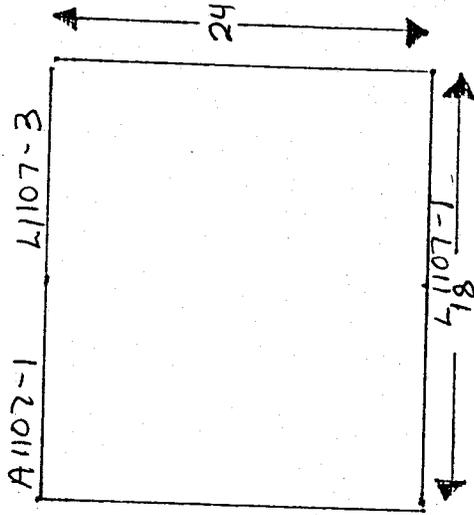


BLDG. # 3516 Pavilion







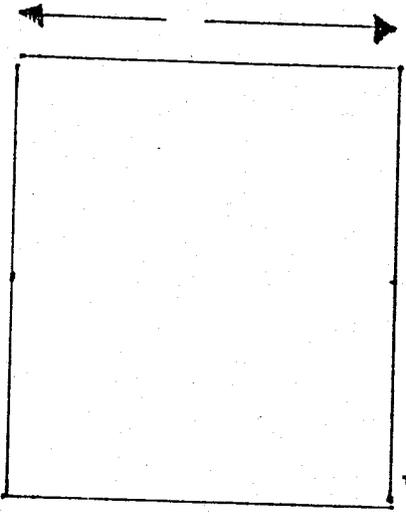

no sample collected
same as #3516

BDG. #3519 Pavilion



ASBESTOS BULK SAMPLING LOG

NAF MIDWAY

THE SZARAS COMPANIES

PAGE 1 of 1 DATE SAMPLES COLLECTED: November 12, 1993

SAMPLE ID NO	SAMPLE LOCATION / DESCRIPTION	ANALYTICAL RESULTS	FRIABLE	CONDITION	AMOUNT
INTERIOR:					
A1112-22	Lobby Light green with white and shades of green flecks: 12" x 12" floor tile	Tile - 1-2% Chrysotile Mastic - None detected	No	Good	3,000 sq. ft.
A1112-23	Photo Lab 2' x 4' suspended ceiling tile	None detected	Yes	Good	350 sq. ft.
A1112-24	Working area Drywall	None detected	Yes	Fair	9,000 sq. ft.
A1112-26	Men's Gym White 1' x 1' ceiling tile	None detected	Yes	Good	650 sq. ft.
A1112-25	Roof north end Roof core	None detected	No	Good	9,700 sq. ft.

It is assumed that anywhere the above identified asbestos containing building materials are found in the building, that those materials also contain asbestos and should be treated as such.

LEAD BASED PAINT SAMPLING LOG


NAF MIDWAY

THE SZARAS COMPANIES

PAGE 1 of 1 DATE SAMPLES COLLECTED: November 12, 1993

SAMPLE ID NO	SAMPLE LOCATION / DESCRIPTION	ANALYTICAL RESULTS (PPM)	CONDITION	AMOUNT								
<table border="1" style="width: 100%; border-collapse: collapse;"> <tr> <td style="width: 30%;">BUILDING NUMBER 3521</td> <td style="width: 35%;">BUILDING NAME MWR Hobby Shop</td> <td colspan="2">BUILDING DESCRIPTION 1 Story</td> </tr> <tr> <td>TSC PROJECT NUMBER 865</td> <td>TSC INSPECTOR J. Kain and B. Kain</td> <td colspan="2">TSC LABORATORY ID No. 112393A</td> </tr> </table>					BUILDING NUMBER 3521	BUILDING NAME MWR Hobby Shop	BUILDING DESCRIPTION 1 Story		TSC PROJECT NUMBER 865	TSC INSPECTOR J. Kain and B. Kain	TSC LABORATORY ID No. 112393A	
BUILDING NUMBER 3521	BUILDING NAME MWR Hobby Shop	BUILDING DESCRIPTION 1 Story										
TSC PROJECT NUMBER 865	TSC INSPECTOR J. Kain and B. Kain	TSC LABORATORY ID No. 112393A										
	INTERIOR:											
L1112-46	Ceramic work area Light green paint on wall	161.9	Good	15,000 sq. ft.								
L1112-47	Ceramic work area Dark green paint on door	327.9	Good	3,000 sq. ft.								
L1112-48	Photo room Eggshell paint on wall	255.7	Good	600 sq. ft.								
L1112-49	Working area White paint on ceiling	451.0	Fair	2,500 sq. ft.								
L1112-50	Working area White with yellow paint below on conduit	1,427.2	Poor	125 sq. ft.								

It is assumed that anywhere the above identified lead based paint materials are found in the building, that those materials also contain lead and should be treated as such.

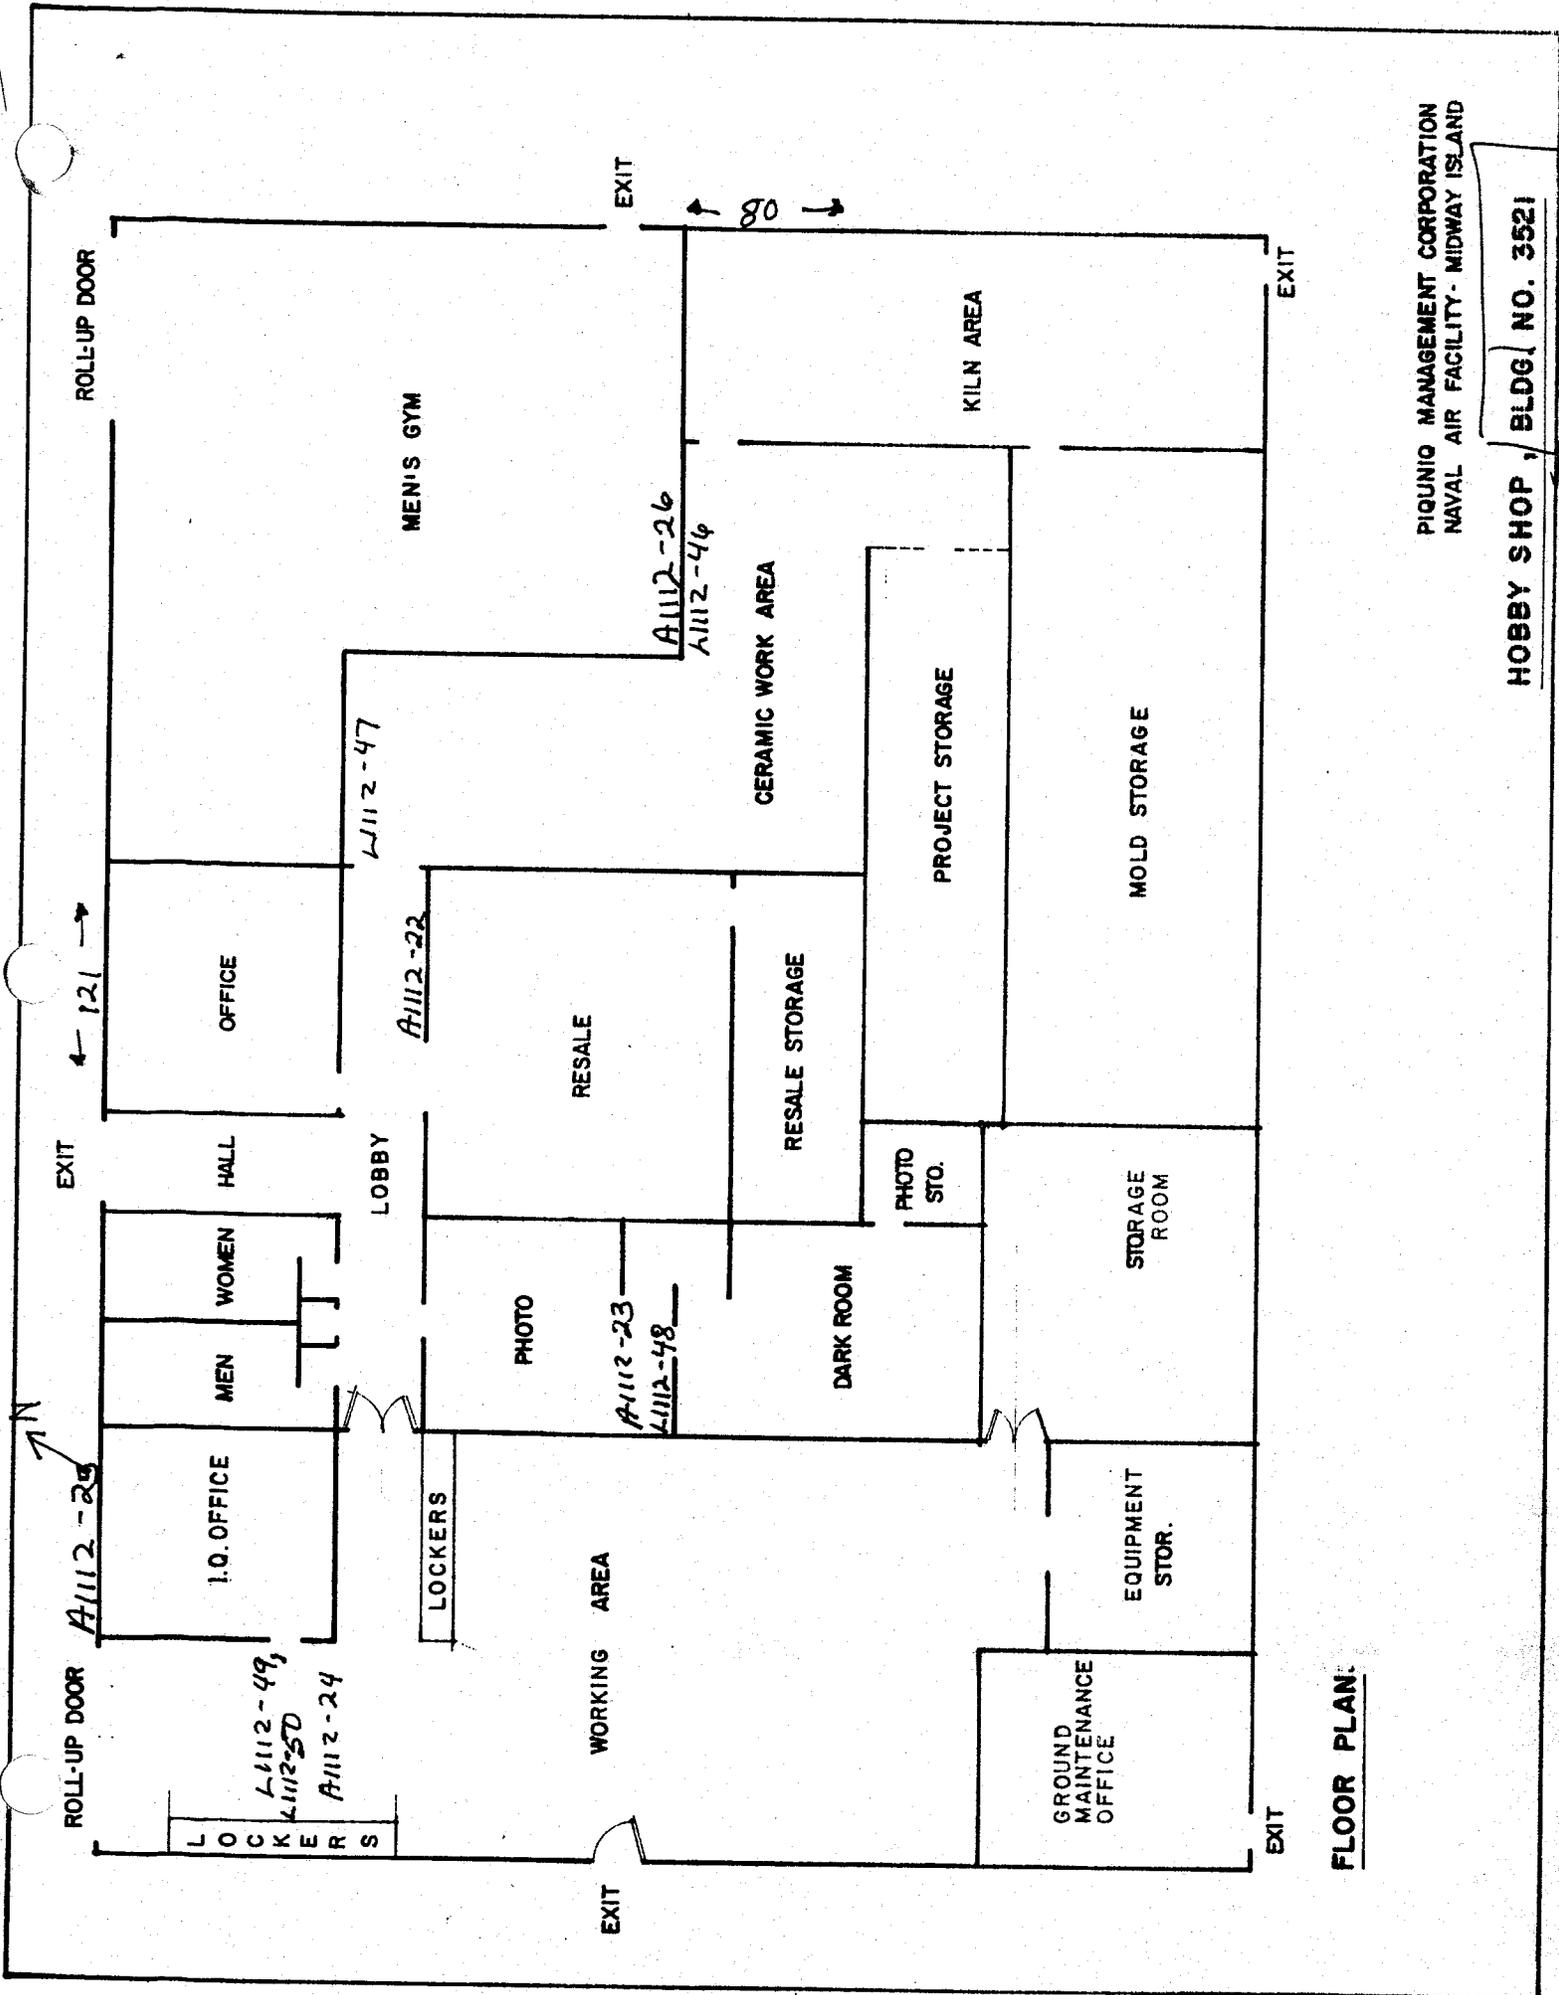

FLOOR PLAN:

PIQUINO MANAGEMENT CORPORATION
 NAVAL AIR FACILITY - MIDWAY ISLAND

HOBBY SHOP, BLDG. NO. 3521



LEAD BASED PAINT SAMPLING LOG

NAF MIDWAY


THE SZARAS COMPANIES

PAGE 1 of 1

DATE SAMPLES COLLECTED: November 4, 1993

SAMPLE ID NO	SAMPLE LOCATION / DESCRIPTION	ANALYTICAL RESULTS (PPM)	CONDITION	AMOUNT
BUILDING NUMBER 3522		BUILDING NAME Boat House		BUILDING DESCRIPTION 1 Story
TSC PROJECT NUMBER 865		TSC INSPECTOR J. Kain and B. Kain		TSC LABORATORY ID No. 111693B
L1104-1	Interior office Gray paint on deck	21.8	Fair	650 sq. ft.
L1104-2	Exterior south side White paint on wood	None detected	Poor	3,600 sq. ft.
L1104-3	Exterior south side Brown paint on sliding door	4.4	Poor	3,000 sq. ft.
L1104-4	Interior north restroom Red deck paint	165.1	Fair	150 sq. ft.
L1104-5	Interior north restroom White paint on wall	None detected	Good	800 sq. ft.
L1104-6	Interior workshop Dark gray paint on shop wall	3,064.8	Good	1,100 sq. ft.
L1104-7	Interior fire sprinkler in workshop Red paint on pipe	86,710.5	Good	400 lin. ft.

It is assumed that anywhere the above identified lead based paint materials are found in the building, that those materials also contain lead and should be treated as such.

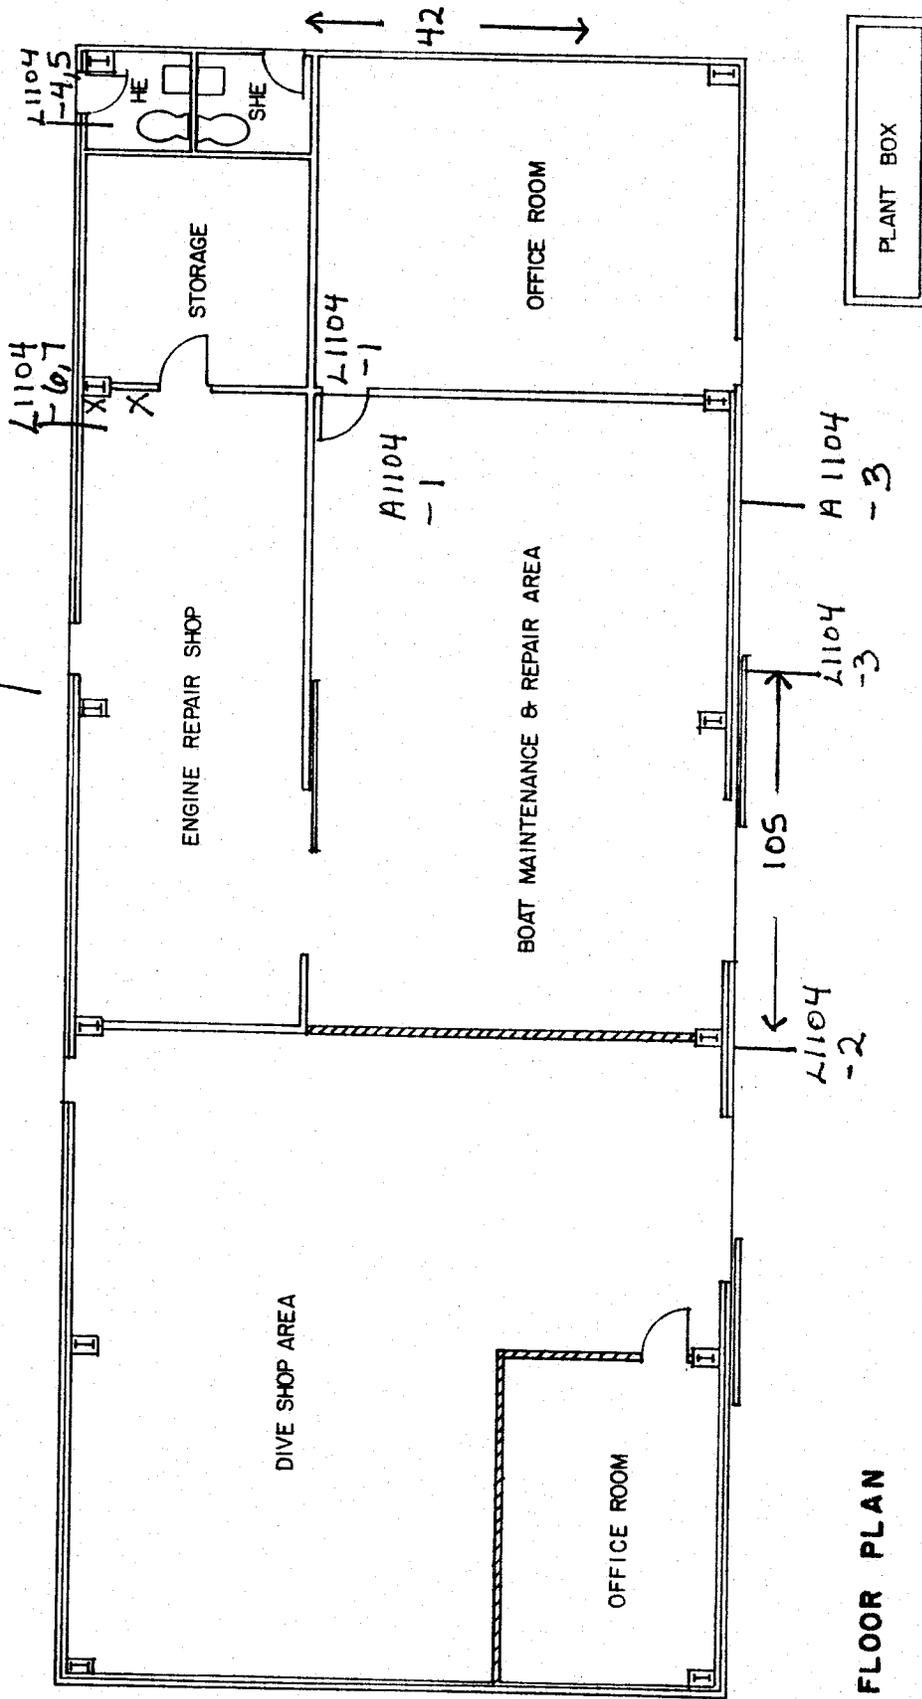


FLOOR PLAN

PIQUINIC MANAGEMENT CORPORATION
 NAVAL AIR FACILITY - MIDWAY ISLAND

BOATHOUSE, BLDG. NO. 3522

02/11/81 ESTERUM



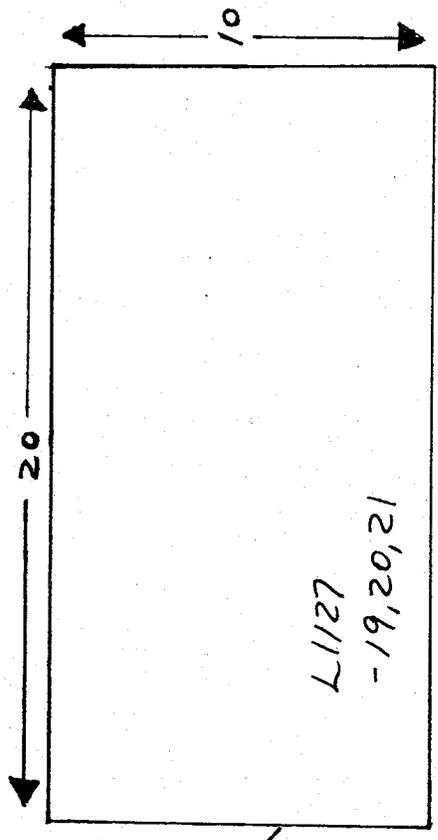

L1127
-19,20,21

20

10

L1127
-24
NORTH


L1127-22
TANK-23
JP-5
#3525

BID # 3524
Boiler Room

BID #3525
FUEL TANK






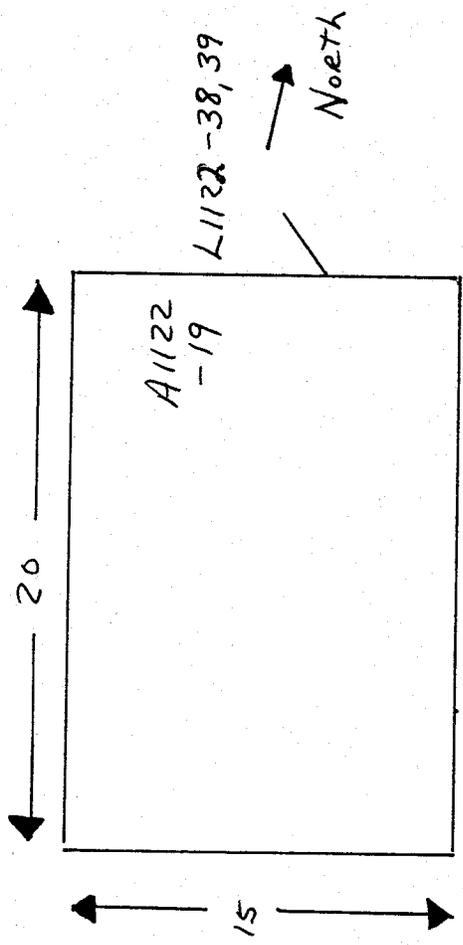

Bid # 3526
A/c Room



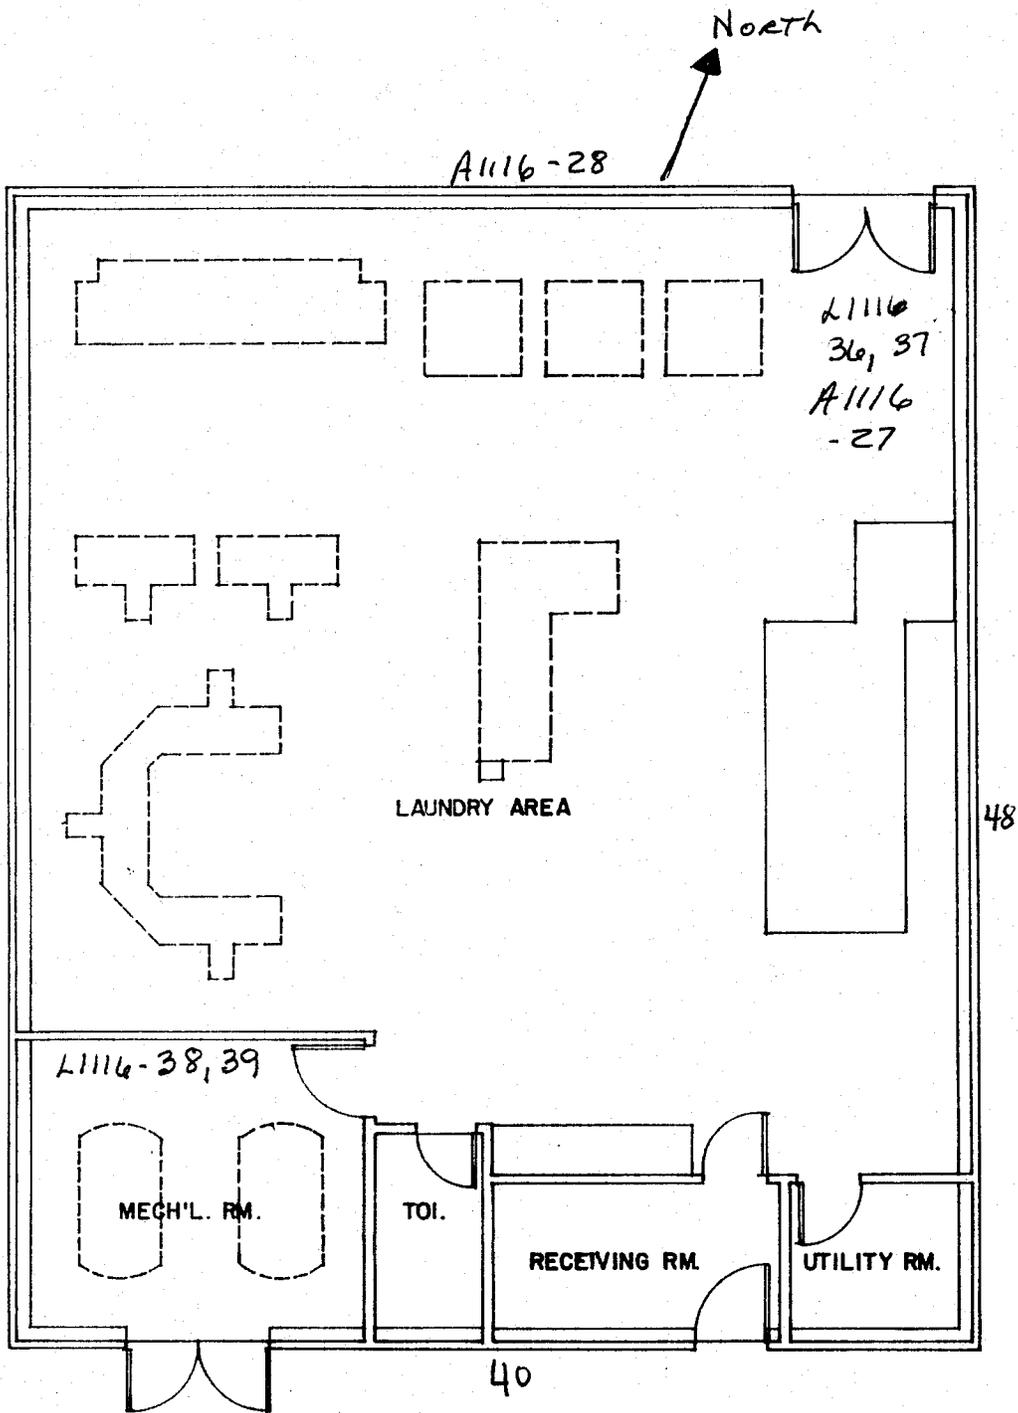

FLOOR PLAN

PIQUINQ MANAGEMENT CORPORATION
 NAVAL AIR FACILITY- MIDWAY ISLAND
BASE LAUNDRY, BLDG. NO. 3529

