THE SZARAS COMPANIES

ASBESTOS AND LEAD-BASED PAINT

SURVEY REPORT

conducted at

NAF MIDWAY ISLAND

for

Ogden Environmental and Energy Services

680 Iwilei Road, Suite 660

Honolulu, HI 96817

Ogden Project #CTO 125
TSC Project #865

Report prepared by
The Szaras Companies
December 30, 1993
Revised February 18, 1994

3659 INDIA STREET, STE. 202 • SAN DIEGO, CA 92103 • 619/299-1203 • FAX 619/299-1204

SIGNATURE PAGE

The survey was conducted by:

Janice Kain	Inspection Team Leader
Bryan Kain	Inspector (Health & Safety Officer)

ACM samples were analyzed by:

Environmental Testing Associates
United States Testing Company, Inc.

LBP samples were analyzed by:

Southland Labs
Forensic Analytical

The report was compiled by:

Helen Ryan
JoAnn Ogaard

All sampling results and report were reviewed and approved by:

Ralph M. Szaras, M.S.
Industrial Hygienist
Certified Asbestos Consultant

February 18, 1994
Date

TABLE OF CONTENTS

SCOPE OF PROJECT 1

SITE DESCRIPTION 1

SAMPLING AND ANALYSIS PROCEDURES 2
- ASBESTOS 2
  - Sample Collection Procedures 2
  - Sample Analysis 6
- **LEAD** 7
  - Formulating an Inspection Plan 7
  - Selecting Components in Each Building to be Tested 7
  - Sample Collection 9
  - Sample Analysis 10

REGULATIONS 11
- ASBESTOS 11
- LEAD 12

DESCRIPTION OF SAMPLING REPORT LOGS 13
- Asbestos Bulk Sampling Log 13
- Lead-Based Paint Sampling Log 14
- QA/QC Sample Log 15
- Building Plot Plans 18

LIST OF BUILDINGS SURVEYED 19

SIGNATURE PAGE 29

ASBESTOS QA/QC LOGS

LEAD BASED PAINT QA/QC LOGS

BUILDING SAMPLING LOGS AND PLOT PLANS

SCOPE OF PROJECT

This project consisted of assessing the entire facility for the presence of asbestos containing materials (ACM), and lead-based paint (LBP). All identified ACM and LBP are reported as to the type and amount present per building and identified by sample number on a building plot plan.

SITE DESCRIPTION

The study site encompasses the two main islands, Sand and Eastern Islands, contained within the Midway Atoll, which lies at the Northwestern end of the Hawaiian Island chain approximately 1,100 miles northwest of Honolulu. Sand Island is inhabited by Piquniq Management and Fish and Wildlife personnel. The island serves mainly as a NAF, communications outpost, and ship docking facility. There are approximately 225 different structures on Sand Island, comprising some 1.24 million square feet of floor area. Eastern Island contains approximately 25 structures, comprising approximately 35,000 square feet.

Classification of Buildings at NAF Midway Island*

Classification	Number of Units
Barracks	7
BEQ/Housing	3
Bunkers	18
Electrical Sub Station	22
Housing	4
Housing	38
Housing	8
Housing	3
Misc. (abandoned buildings, concrete pads, flag poles, etc.)	12
Operations	69
Personal Services	19
Picnic Pavilion	10
Storage	19
Tanks (fuel or water storage)	17

*Classifications may not be completely accurate as some buildings were abandoned or demolished and Operations building usage changed frequently.

SAMPLING AND ANALYSIS PROCEDURES

ASBESTOS

Sample Collection Procedures

The asbestos containing material (ACM) survey was conducted to identify all suspect ACM in the buildings at NAF Midway. The site technicians followed the Asbestos Hazard Emergency Response Act in establishing functional areas with homogenous materials throughout the buildings. Each building was considered a functional area and the suspect materials homogenous throughout the functional area. However, in several circumstances, homogenous materials were identified throughout groups of buildings due to similar construction and proximity to each other as explained later in this report.

Only suspect ACM was collected. No samples were collected of nonsuspect building materials nor were nonsuspect ACM materials noted on the sampling logs. In similar buildings certain materials were present in some but not others. For example, in the housing area similar buildings would have floor tile in some of the buildings but not in others even though the buildings were built at the same time and had other similar construction materials.

To assist the reader in visualizing the building that was being inspected, the site technician tried to identify the type of building construction in the description section of each sampling log. This enables the reader to better understand why in a three story building only 2 or 3 samples were collected, such as a poured in place concrete building with a concrete roof and floors. Where on the other hand, a one story building may have had a dozen samples collected in it because it had many different types of floor coverings, ceiling materials, etc.

As the inspection progressed, the same type of building materials started to appear throughout groups of buildings. For example, in the Family Housing Area there was a consistency of the same types of floor tiles, ceiling tiles and roofing material. Initial samples of similar materials collected throughout these buildings had similar results, i.e., contained "x" percent asbestos or were non-detected for asbestos. The technicians had the results of the initial samples relayed to them in the field to assist them in making sample collection decisions. Therefore, the technicians would not collect another sample of the material but would note on the building log that the similar material was present in the building and referred the result back to the original samples collected. This procedure was not practiced in buildings dissimilar in construction or not in proximity to each other but only with homogenous materials in similar functional areas.

The similar buildings grouped for functional area and homogenous materials for sampling purposes were in the base housing area. The groupings are as follows:

2-STORY SINGLE FAMILY RESIDENCE (10 EACH)

Building Nos.: 414-419 and 421-424

QUANTITIES OF MATERIALS PRESENT

The following approximate quantities represent the surface areas of where the lead-based paint or asbestos containing material has been used in this type of housing unit. Quantities are per unit.

Roof	-	1,500 sq. ft.
Exterior Walls	-	4,000 sq. ft.
Interior Walls	-	6,220 sq. ft.
Floor	-	2,385 sq. ft.
Ceilings	-	2,385 sq. ft.

1-STORY DUPLEX (5 EACH)

Building Nos.: 4208, 4209, 4210, 4212 and 330

QUANTITIES OF MATERIALS PRESENT

The following approximate quantities represent the surface areas of where the lead-based paint or asbestos containing material has been used in this type of housing unit. Quantities are per unit.

Roof	-	3,000 sq. ft.
Exterior Walls	-	2,600 sq. ft.
Interior Walls	-	3,475 sq. ft.
Floor	-	1,390 sq. ft.
Ceilings	-	1,390 sq. ft.
Pipe Insulation	-	50 lineal feet

2-STORY 4-PLEXES (47 EACH)

Building Nos.: 4205, 4206, 4207, 6301-6324, 6327-6345

QUANTITIES OF MATERIALS PRESENT

The following approximate quantities represent the surface areas of where the lead-based paint or asbestos containing material has been used in this type of housing unit. Quantities are per unit.

Roof	-	3,800 sq. ft.
Exterior Walls	-	4,300 sq. ft.
Interior Walls	-	2,325 sq. ft. x 4 units
Floor	-	890 sq. ft. x 4 units
Ceilings	-	890 sq. ft. x 4 units
Pipe Insulation	-	50 lineal feet x 4 units
Stair Treads	-	800 sq. ft.

All buildings in each group were inspected but only representative samples were collected since the building materials were consistent throughout each group of housing. The logs represent the type of materials found throughout each particular group of housing.

The sampling logs generated for this report represent samples collected of all suspect ACM. If a material was present in a building but was not suspect for asbestos, then it was not noted on the log. In addition, after a particular material was collected 2 to 3 times, no additional sample was collected of that material within the same building, or group of buildings that were judged similar in construction materials as noted above. The material present was noted on the building log sheet but the sample number indicated "No sample collected" and the sample location/description referred to a similar sample previously collected by sample number and building number.

The steps taken in conducting the inspection were as follows:

1. Reviewing the results of any previous inspections if available.
2. Reviewing working drawings or as-built drawings including structural/ electrical/mechanical as well as change orders and abatement reports if available.
3. Organizing the building inspection by type of ACM and by floor and areas within each floor. Conducting an initial building walk-through.
4. Preparing sampling materials and administrative materials.

5. Coordinating with the building owner the notification to occupants, when necessary.
6. Conducting inspection and sample collection. Sample collection was performed in accordance with the Asbestos Hazard Emergency Response Act (AHERA) regulations.
7. Samples were analyzed by Environmental Testing Associates, a participant in the National Institute of Sciences and Technology and the National Voluntary Laboratory Accreditation Program (NVLAP) and all chain of custody documentation was maintained.
8. The sampling report identifies all areas surveyed, all material sampled, all material that was positive for asbestos content, whether or not it is friable or nonfriable, and an assessment of its condition.

The following are the inspection procedures that the TSC accredited inspectors follow as part of the TSC's operations manual.

A. Surfacing Materials

1. Spread the plastic drop cloth and set up other equipment, e.g., ladder as determined necessary by the inspection team's Health and Safety Officer.
2. Put on protective equipment as determined by the inspection team's Health and Safety Officer.
3. Label container with its identification number and record number, sample location, and type of material sampled on a sampling data form. Always place the label on the container itself, not on the lid, as lids can be inadvertently switched by a laboratory when handling numerous sample containers.
4. Mark the location of the sample on the sampling diagram and record the sample identification number on the plan diagram as well.
5. Moisten area where sample is to be extracted (spray the immediate area with water).
6. Extract sample using a clean knife to cut out or scrape off a small piece of the material. Be sure to penetrate all layers of material. Be careful not to disturb adjacent material.
7. Place sample in a container and tightly seal it.
8. Wipe the exterior of the container with a wet wipe to remove any material which may have adhered to it during sampling.
9. Clean your tools with wet wipes and wet mop or vacuum area with a High Efficiency Particulate Air (HEPA) vacuum to clean all debris if necessary.
10. Fill hole with caulking compound on highly friable material and/or spray with acrylic/adhesive (to minimize subsequent fiber release) or for appearance.
11. Repeat the above steps at each sample location. Place sample containers in plastic bags.

12. Discard protective clothing, wet wipes and rags, cartridge filters, and drop-cloth in a labeled plastic bag. Seal and retain the bag until lab results are received, at which time dispose of the bag as asbestos-contaminated waste if tests were positive for asbestos. (Labels should read: "Danger - Contains Asbestos Fibers - Avoid Creating Dust - Cancer and Lung Disease Hazard".)

B. Thermal System Insulation

Sampling thermal insulation materials follows the same procedural sequence as laid out above. Obtain samples from exposed/damaged areas if possible. However, random sampling will require sampling of some intact material. Sampling holes can be patched with plastic spackling, caulk, or fibrous glass plus wetable fibrous glass cloth.

C. Miscellaneous Materials

Miscellaneous materials such as floor tile, transite panels and piping, roofing material, etc., pose unique sampling procedures which the inspector will have to adapt on a case-by-case basis. However, sampling will follow the same protective sequences outlined in the procedures for sampling surfacing materials.

NOTE: As the survey was being conducted, repair work was being performed on the buildings which may have involved some of the ACM. The results obtained in this survey represent the conditions present at the time of sample collection.

Sample Analysis

The laboratory selected for sample analysis is a successful participant in the National Voluntary Laboratory Accreditation Program (NVLAP).

Polarized Light Microscopy (PLM) is the EPA-approved method for analyzing bulk material for asbestos. This method of analysis is relatively inexpensive. PLM utilizes a light microscope equipped with polarizing filters. The identification of asbestos fiber bundles is determined by the visual properties displayed when the sample is treated with various dispersion staining liquids. Identification is substantiated by the actual structure of the fiber and the effect of polarized light on the fiber, all of which is viewed by the technician. The characteristics reviewed for asbestos identification are as follows:

Isotropism	Birefringince
Morphology	Pleochroism
Color	Dispersion Staining Color
Relief	Becke Line

The limit of detection of asbestos by PLM is about one percent (1%) by area. Samples containing lower levels of asbestos are not reliably detected by this technique and it is recommended that they be submitted for additional gravimetric TEM analysis.

There may be discrepancies in estimating the exact percentage of asbestos in side-by-side samples. These discrepancies are not as serious as the presence/absence result since any sample of friable material which contains more than one percent (1%) of asbestos is designated as ACM. However, the comparison of the asbestos percentage estimated by the testing laboratory can provide useful information on the reliability of the analysis . Discrepancies may occur as a result of sample contamination, inconsistent procedures, differences in technique, or mistakes (e.g., mislabeling of sample). Of course, some variability in the "true" asbestos content of ACM would be expected from one location to another. Ordinarily the percentage for each QA sample as compared with the percentage for its corresponding regular sample should not exceed ten percent (10%).

Any disagreement about the type of asbestos mineral (Chrysotile, Amosite, Crocidolite) present will be resolved by additional analyses. Information on mineral type may be important when evaluating alternative methods of managing ACM, especially if removal of the ACM is under consideration.

LEAD

Formulating an Inspection Plan

An "LBP Testing Plan" is defined as a listing of the specific dwelling units, common areas, and exterior areas to be tested (completely and unambiguously defined, say, by address and unit number) and a delineation of the specific architectural components to be tested in each room of each unit, each common area and each building exterior.

Selecting Components in Each Building to be Tested

In the interior of each building in the sample, it is the inspector's job to test a surface that is representative of each type of painted and varnished component in every area, room, closet, pantry, hall, and part of a divided room (e.g., living room/dining room). On the building exterior, there is a similar requirement to test every type of painted and varnished component. Commonly encountered interior components which must be tested if painted or varnished include: ceilings; crown molding; walls; chair rails; doors; door trim; floors; fireplaces; radiators and other heating units; shelves; shelf supports; stair treads; stair risers; stair stringers; newel posts; railing caps; balustrades; windows and trim, including sashes, window heads, jambs, sills and

stools; built-in cabinets; columns; beams; bathroom vanities; counter tops; and air conditioners. Typical exterior components include: painted roofing, chimneys, flashing, gutters and downspouts; ceilings; soffits; fascias; cornerboards; bulkheads; doors and door trim; fences; floors; joists; lattice work; railings and railing caps; siding; handrails; stair risers and treads; stair stringers; columns; balustrades; windows sills, casings; sashes and wells; and, air conditioners.

The lists are not intended to be exhaustive; unlisted components that are encountered must still be tested. Also, if two components of the same type have, or are suspected to have, a different painting history, both must be tested. For example, if there are two baseboards in a room that have different color paint, then both must be tested. As another example, if a wall is divided by a chair rail, both parts of the wall must be tested.

In addition to the interior and exterior of each unit in the sample, the inspector must also test every common area in the building, both interior and exterior. Examples include hallways, stairways, laundry and recreational rooms, playgrounds, community centers, and boundary fences. The components encountered in common areas are generally similar to those encountered in unit interiors and exteriors. However, the same testing principal applies: **a representative area on each painted and varnished surface with a distinct painting history must be tested.** This is especially important in common areas, since such areas tend to be larger than the rooms in an individual unit, so that there is more opportunity for different painting histories on the same component.

A specific protocol for selecting interior, exterior, and common area components for testing is as follows:

1. Inspect the building and develop a complete list of all areas to be sampled. An interior area is defined as a room, part of a divided room such as a living room/dining room, closet, pantry, hall, or stairs. Exterior areas include siding, porches, garages, patios, decks, sheds, and boundary fences. Common areas include hallways, lobbies, stairways, laundry rooms, recreational and community centers, and playgrounds.

2. Within each area, determine all painted and varnished components which are candidates for testing, including repeats, i.e. components, such as walls, which occur more than once in the area.

3. Where a component is repeated, randomly select one from the list for testing. This was accomplished by using a calculator with a random number key.

4. Select a location on each component for collecting a paint sample. The inspector exercised judgment to select a representative sampling location. Record the location of every sample taken for future reference and in case confirmatory sampling is needed.

NOTE: As this survey was being conducted buildings were being repainted. Therefore, the results obtained in this survey represent the conditions present at the time of sample collection.

The sampling protocol outlined in the report was not strictly adhered to on this project because of the complexity and uniqueness of the occupied areas. In fact, the random sampling plan depicted in the report would have been inadequate on this project and the technician's judgement dictated a more comprehensive sampling scheme. The only sampling protocol recommended by the regulatory agencies is for large housing complexes. There are no standards, procedures, etc., stipulated for commercial or industrial applications. Current trend is to try to adapt the housing sampling protocol to other applications and then couple it with the technician's experience.

In this project, there was no consistency of paint application throughout the base nor even throughout any one particular building. Each office or command quarters, etc., within a building would have their areas painted in their colors with the possibility of three or four different colors in one room or on one wall. Therefore, the random sampling protocol as outlined was deemed inadequate by the technician and samples were collected of every different color paint or stain in the building. Thus there is no statistical test to which the sampling criteria can be subject to.

In conclusion, a more comprehensive sampling plan was conducted than a recommended random sampling scheme.

Sample Collection

The samples collected for laboratory analysis were approximately 2 square inches or larger. Samples contained all layers of paint down to the substrate.

Preparing the sample container:

- On the label, identify the exact location where the sample was taken (for example, ceiling, room #2, first floor, 401 Maple Avenue, Jones City, SS) and the sample number assigned on the inspection form.
- Affix the label to the outside of the baggie.

There are two general methods that are suggested, all of which are fairly messy. A tray or other container was held under the sampled surface to catch debris which falls.

The first method is a cutting or punching method:

1. Apply clear, pressure sensitive adhesive tape over an area slightly larger than the sample to be collected.

2. Cut through the paint layers with a punch or template/sharp knife combination of known area.

3. Remove the paint and a thin layer of substrate beneath it using a sharp chisel having the same dimensions as a side of the square.

4. A HEPA vacuum or wet wipe was used to clean the area and dispose of any residual material in a plastic disposal bag.

The second method is a cutting method:

1. Using a sharp knife or scalpel, score the area of paint in question to an appropriate size, attempt to lift the paint off by sliding the thin blade along the score and underneath the paint, and remove a section down to the wood or plaster, making sure all layers of paint are intact. Care was taken to avoid including wood, paper, or plaster in the sample.

2. A HEPA vacuum or wet wipes were used to clean the area and dispose of any residual material in a plastic disposal bag.

   After using either method, the technician would re-check to ensure that the samples were properly labeled for shipment to the laboratory.

Care was taken to be certain that the samples are not mired with dirt or soil and that there was no more than one sample in a single bag.

Sample Analysis

Laboratory selection is a critical part of lead-based paint analysis. Although there are currently no accreditation programs for lead paint analysis, accreditation in metals analysis with the use of Atomic Absorption ICP and Flame were the determining factor in selecting the laboratory. The laboratories that TSC utilizes, Southland Labs and

Forensic Analytical, are successful participants in the National Institute of Occupational Safety and Health (NIOSH) Proficiency Analytical Testing Program for metals. For this project, all sample analysis was performed using Atomic Absorption ICP in accordance with the EPA 6010 Method.

Analysis methods for lead have two main steps: sample preparation and instrumental analysis.

To perform quantitative metals analysis by atomic spectroscopic techniques (Flame AA, ICP-AES, and GFAA), the sample must be solubilized prior to the instrumental measurement. Components of the samples which are not completely solubilized will not be quantitatively transported through the inlet systems of the analytical instrumentation. This will result in low analyte recoveries. Solubilization of the sample is carried out through digestion during sample preparation. The sample digestion procedure must be capable of breaking up all analyte containing molecular species in order to avoid low analyte recoveries. Acids are generally used to perform this task. After samples have been prepared, analysis if completed by making measurements on instrumentation which generate a response related to the quantity of lead in the prepared sample. Different instruments can be used and each instrument has its own unique detection capability for measuring lead in a sample. Typical detection limits for lead are 0.5 mg/L using Flame AA, 0.05 mg/L using ICP and 0.001 mg/L using GFAA. Instrumental detection limits for these techniques are always expressed in mass-volume units and converted to parts per million (ppm) because only liquid samples can be directly injected into the instrumentation. Sample or method detection limits are calculated from these Instrumental detection limits by multiplying the weight and/or dilution factors resulting from sample dissolution with the instrumental detection limit. In addition, reported limits or quantitation (the level which represents the lower reportable value) is typically 5 of 10 times above the sample or method detection limit. This is done primarily due to the uncertainly of quantitation which exists in any analyses method as one approaches the instrumental detection limit. Analysis data which is below 5 times the sample detection limit is less accurate than data above this level.

REGULATIONS

ASBESTOS

It is important to know whether the ACM is friable or nonfriable because:

FRIABLE Asbestos Containing Material is highly regulated and must be removed prior to renovation or demolition. Friable ACM means any material containing more than 1.0% asbestos by weight and that, when dry, can be crumbled, pulverized or reduced to a powder by hand pressure.

NONFRIABLE Asbestos Containing Material is also regulated and can become friable during renovation or removal and occupants as well as workers must be protected. Nonfriable ACM means any material containing more than 1.0% asbestos by weight and that, when dry, cannot be crumbled, pulverized or reduced to a powder by hand pressure.

This is in accordance with the US EPA's National Emissions Standards for Hazardous Air Pollutants (NESHAPS) 40 CFR 61, Subpart M, Section 61.145, Standards for Demolition and Renovation. However, if demolition of nonfriable ACM is performed manually, proper personal protective measures must be employed per the Occupational Safety and Health Administration's (OSHA) Title 29, 1910.1001 regarding worker exposure to asbestos airborne contaminants.

LEAD

Currently there is no regulatory standard for the concentration of lead in paint to be considered a hazardous material. However, there are recommended guidelines that are used as an industry standard at this time. These guidelines are found in the U.S. Department of Housing and Urban Development (HUD) "Lead-Based Paint: Interim Guidelines for Hazard Identification and Abatement in Public and Indian Housing"; September 1990.

The HUD Guidelines stipulate that any paint that contains more than 1.0 mg/cm^2 or 0.5% (5000 ppm) by weight is considered lead-based paint. The Consumer Products Safety Commission considers any paint with more than 600 ppm lead as lead-based paint. However, the CPSC has no regulatory affect.

Under the EPA's Resource Conservation and Recovery Act (RCRA), any waste material that contains more than 5 parts per million of the hazardous material is considered a hazardous waste. However, the method of measurement is quite different. The recommended testing procedure is known as the Toxicity Characteristic Leaching Procedure (TCLP). Based upon preliminary testing of abatement waste as

part of HUD's Demonstration Project, large debris such as doors are unlikely to be classified as hazardous waste. However, paint chips, HEPA vacuum filters, and certain wash waters are likely to fail the toxicity test.

DESCRIPTION OF SAMPLING REPORT LOGS

For each building surveyed, an individual sampling result log was generated for ACM and LBP samples. A building plot plan is also provided for each building indicating the samples collected in each building.

Asbestos Bulk Sampling Log

1.	Building Number:	Building number as identified at project site by occupant
2.	Building Name:	Building name as identified at project site by occupant
3.	Building Description:	Building use as defined by TSC Site Surveillance Technician
4.	TSC Project No.:	TSC's project control number
5.	TSC Inspector:	Primary TSC inspector(s)
6.	TSC Laboratory ID No.:	TSC laboratory number assigned to samples collected from this building
7.	Sample ID No.:	Specific number assigned to sample -(A): Denotes suspected ACM -(914): Denotes date collected October 14th -(-x): Denotes specific sample numbers
8.	Sample Location/ Description:	What part of the building the sample was collected from and what type of material was collected. Sometimes this sample may be exactly the same material as a previous sample and the description will refer to the previous sample.
9.	Analytical Result:	%; Percent of asbestos in the material Chrysotile, etc.; Name of type of asbestos None Detected; No asbestos identified in the sample

10.	Friable:	"Yes" the material is friable or "NO" the material is not friable but "nonfriable".
11.	Condition:	Good: No apparent damage Fair: Less than 10% of the material is damaged Poor: More than 10% of the material is damaged
12.	Amount:	Approximate amount of ACM present in square feet or number of items.

Lead-Based Paint Sampling Log

1.	Building Number:	Building number as identified at project site by occupant
2.	Building Name:	Building name as identified at project site by occupant
3.	Building Description:	Building use as defined by TSC Site Surveillance Technician
4.	TSC Project No.:	TSC's project control number
5.	TSC Inspector:	Primary TSC inspector(s)
6.	TSC Laboratory ID No.:	TSC laboratory number assigned to samples collected from this building
7.	Sample ID No.:	Specific number assigned to sample -(L): Denotes suspected LBP -(914): Denotes date collected October 14th -(-x): Denotes specific sample numbers
8.	Sample Location/ Description:	What part of the building the sample was collected from and what type of material was collected. Sometimes this sample may be exactly the same material as a previous sample and the description will refer to the previous sample.
9.	Analytical Results:	Parts of lead per million parts of suspect material and can

be converted to percentage by dividing by 10,000. (cannot be converted to mg/cm^2)

10. Condition: Good: No apparent damage
Fair: Less than 10% of the material is damaged
Poor: More than 10% of the material is damaged

11. Additional Comments: Approximate quantity of material identified in square feet

QA/QC Sample Log

Separate logs for ACM and LBP list the sample collected and the control sample. Control samples were obtained by collecting an additional sample for every 20th sample collected. The control samples were submitted to another laboratory, United States Testing Company, Inc. (also NVLAP participants), for ACM analysis, and Forensic Analytical for LBP analysis.

Several discrepancies were noted between the original ACM sample collected and the QC sample collected. All QC samples were collected next to or were split samples of original sample. The following is a summary and explanation of the discrepancies:

POSITIVE VS. NEGATIVE RESULTS

SAMPLE #	MATERIAL	ORIGINAL RESULT	QA/QC RESULT
A1104-20	12" x 12" off-white/beige floor tile	Tile: 1-2% Chrysotile Mastic: 6% Chrysotile	None detected
A1122-1	9" x 9" red w/beige and gray floor tile	8% Chrysotile	None detected
A1123-27	12" x 12" red stamped floor tile	Tile: 2% Chrysotile Mastic: 1-2% Chrysotile	None detected
A1105-17	12" x 12" beige w/orange and brown floor tile	6% Chrysotile	None detected
A1118-12	9" x 9" black w/white floor tile	15% Chrysotile	None detected
A1025-3	Light brown w/dark brown floor tile	Tile: 8%% Chrysotile Mastic: 15% Chrysotile	None detected

SAMPLE #	MATERIAL	ORIGINAL RESULT	QA/QC RESULT
A1111-11	Gray and white stair tread	Tile: 20% Chrysotile Mastic: 1-2% Chrysotile	None detected
A1125-4	Tar wrap on pipe	20% Chrysotile	None detected

Positive vs. Negative Results Discussion:
It is not uncommon for two different laboratories, both of which are NVLAP accredited, to report different results on material such as floor and ceiling tiles since these products contain significant amounts of cellulose materials. Analysts with limited experience may not report the presence of asbestos for fear of misreporting. Questionable samples should be analyzed by Transmission Electron Microscopy (TEM) to verify asbestos content.

The laboratory used to analyze the original samples, Environmental Testing Associates, is owned and run by Daniel M. Baxter, who wrote part of the PLM protocol for the EPA in 1982. In addition, Mr. Baxter also participated in the changes to the protocol in 1989. The changes will require that any sample that is none detected for asbestos content should be verified by TEM Analysis. The ramifications of these changes are significant as you can understand in regards to the cost of conducting inspections. TEM analysis costs approximately 4-6 times more than PLM analysis. These changes should become effective sometime in 1994.

LAYERED FLOOR COVERING SAMPLES

SAMPLE #	MATERIAL	ORIGINAL RESULT	QA/QC RESULT
A1125-8	12" x 12" green w/white floor tile	Tile: None detected Mastic: 8% Chrysotile	Tile: 2% Chrysotile Mastic: 2% Chrysotile

Layered Floor Covering Samples Discussion:
During the sample preparation for microscopic analysis the analyst may not have separated the mastic from the tile sufficiently when analyzing the tile and therefore incorrectly identify the tile as containing asbestos. In either case, the mastic would adhere to the floor tile during floor tile removal and therefore the tile would need to be disposed of as contaminated material.

VARIATIONS IN QUANTITIES PRESENT

SAMPLE #	MATERIAL	ORIGINAL RESULT	QA/QC RESULT
A1126-26	9" x 9" white w/gray floor tile	Tile: 15% Chrysotile Mastic: None detected	Tile: 5% Chrysotile Mastic: None detected
A1116-1	9" x 9" green w/beige floor tile	Tile: 2% Chrysotile Mastic: 5% Chrysotile	5% Chrysotile
A1116-18	9" x 9" green w/white floor tile	Tile: None detected Mastic: 25% Chrysotile	2% Chrysotile
A1116-25	9" x 9" brown w/white floor tile	Tile: None detected Mastic: 12% Chrysotile	Tile: None detected Mastic: 2% Chrysotile
A1126-26	9" x 9" white w/gray floor tile	15% Chrysotile	Tile: 5% Chrysotile Mastic: 5% Chrysotile
A1122-16	9" x 9" light brown/brown and yellow floor tile	Tile: 15% Chrysotile Mastic: 10% Chrysotile	3% Chrysotile
A1123-22	9" x 9" beige w/green floor tile	Tile: 10% Chrysotile Mastic: 15% Chrysotile	Tile: 2% Chrysotile Mastic: 5% Chrysotile
A1119-13	9" x 9" black w/white floor tile	15% Chrysotile	Tile: 3%% Chrysotile Mastic: 5% Chrysotile
A1113-15	9" x 9" black w/beige and green floor tile	Tile: 8% Chrysotile Mastic: 7% Chrysotile	10% Chrysotile
A1113-14	12" x 12" turquoise w/white floor tile	Tile: 2% Chrysotile Mastic: 30% Chrysotile	Tile: 2% Chrysotile Mastic: 2% Chrysotile
A1108-2	Red floor tile	Tile: 10% Chrysotile Mastic: None detected	20% Chrysotile
A1102-12	Green transite	25% Chrysotile	45% Chrysotile

Variations in Quantities Present Discussion:
During sample preparation the analyst may not adequately separate the tile from the mastic and analyze it as one material and not two separate materials. In those instances, the results were consistent in respect to whether or not asbestos was present. The other samples where there is a difference of greater than 10% variance between the laboratories, both reported quantities in excess of 1% asbestos, therefore identifying the material as asbestos containing material. Regulations pertaining to handling and disposal of ACM are not different for 1% ACM or 100% ACM.

LAYERED ROOF SAMPLE

SAMPLE #	MATERIAL	ORIGINAL RESULT	QA/QC RESULT
A1105-10	Multi-layer roof core	Layer 1: 65% Chrysotile Layer 2: 60% Chrysotile	35% Chrysotile

Layered Roof Sample Discussion:
The QA laboratory chose not to separate the layers of material. However, both laboratories also agreed that the material was asbestos containing.

Building Plot Plans

The building plot plans were provided by the base personnel. Some were computer generated and some were hand drawn. About 40% of the buildings did not have plot plans and TSC Technicians drew rough plot plans for sampling identification. None of the plots are drawn to scale. Sample locations are hand drawn on the plot plans with corresponding sample ID Numbers.

LIST OF BUILDINGS SURVEYED
EASTERN ISLAND

BUILDING NUMBER	BUILDING NAME
126	Concrete Building
244	No Name Available
7135	Mess Hall
7136	Generator Room
7137	Operations Building
9101	Transmitter Building
9102	Generator Room
9104	Microwave Relay Room
9117	No Name Available
9120	Tank
9121	Tank
9122	Quonset Hut
9123	Generator Room
9127	Barracks
9128	Back Wash Station
9130	Water Tank
9131	Fresh Water Pump House
9132	Concrete Tunnel
9201	Communication Facility
9204	Bunker

LIST OF BUILDINGS SURVEYED
SAND ISLAND

BUILDING NUMBER	BUILDING NAME
S-25	Fuel Tank
110	Abandoned Electrical Room
117	Concrete Pad
140	Electrical Sub Station
144	Power Plant DIESEL BY FUEL FARM
151	SeaBee Hangar
170	Electrical Room
173	Concrete Slab
174	Harbor Storage
175	Paint Locker
180	Electrical Sub Station
181	Public Toilet
189	Public Toilet
200	Electrical Sub Station
S225	MoGas Station
S228	Sewer Pump House
232	Fuel Storage Tin Shed
233	Fuel Storage Tin Shed
259	Midway Mall
S269	MoGas Station
300	Electrical Sub Station
309	Power Plant
S314	Loading Ramp

BUILDING NUMBER	BUILDING NAME
S323	Sewer Pump House
330	Housing Complex
332	Generator Room
335	Barracks
336	Barracks
340	Electrical Sub-Station
342	Paint Shop
343	Garage and HE Auto
347	R-3 Chlorinator Building
348	PW Administration Shop
349	Galley Warehouse
350	Electrical Sub-Station
353	Carpenter Shop
354	Old Power Plant
360	Electrical Sub-Station
S361	Pesticide Storage
365	Abandoned Laundry
393	Ski Warehouse
394	Hot Water Heater Building
S395	JP-5 Tank
400	Electrical Sub-Station
S402	Fuel Tank
410	Pavilion
S421	Satellite Dishes
424	Housing
425	TV Satellite Room

331 CHURCH

BUILDING NUMBER	BUILDING NAME
S426	Satellite Dishes
S464	Fuel Farm MoGas Pump House
502	AT&T
503	Electrical Sub-Station
520	Extinguisher Room Storage
521	Communications Center
576	Paint Storage
578	Barracks
579	Barracks
580	Hazardous Material Storage
S582	Tank JP-5
586	Crash Fire Rescue
594	Storage Room
595	607 Supply Squadron Hangar
596	607 FWD Squadron Hangar
S598	Abandoned Concrete Building
649	Playground
S692	Sewer Pump House
865	Fuel Tank
964	Generator
S966	Wind Sock
S967	Wind Sock
968	Antenna Comm. Building
969	Pipeline Building
970	NAVOcean Pro Fac
971	Generator

BUILDING NUMBER	BUILDING NAME
973	Administration Office
976	Anchor
S1119	Electrical Sub Station
1122	U.S. Dept. of Commerce Tide Station
1123	Electrical Sub-Station
1124	Harbor Storage
1125	Harbor Master
2127	Fuel Farm Office
2402	Cold Storage
2403	General Storage / Fuel Office
2404	All Hands Club
2407	Electrical Sub-Station
2409	Gooney Bird Memorial
2410	Bunker
2411	Fuel Farm Lab
2412	Fuel Farm Storage
2413	Toilet
2414	Engineering Department Testing Lab
S3127 and S3126	Potable Water Storage
S3128 and S4123	Tennis Courts
3142	Generator Room
3501	R-3 Pumping Station
3502	Galley
3503	BEQ Charlie Barracks
3504	BEQ Delta Barracks
3505	Barracks

BUILDING NUMBER	BUILDING NAME
3506	Flammable Storage
3509	Flammable Storage
3509	Electrical Sub-Station
3510	Concrete Pad
3511	Electrical Sub-Station
3512	Gymnasium
3513	Police Security Headquarters
3514	Security Police Office
3515	Laundry Room
3516	Recreation Pavilion
S3520	Anchor
3521	MWR Hobby Shop
3522	Boat House
S3523	Anchor
3524	Boiler Room
3525	JP-5 Tank
3526	A/C Room
S3527	Security Office Sign
S3528	Fuel Pump Stand
3529	Base Laundry - Dry Cleaners
S4121	Tennis Court
S4129	Fuel Pier
S4129	Pier
S4129	Pier Storage Room (Fuel Farm)
S4136	Concrete Pad
4140	Contractor's House

BUILDING NUMBER	BUILDING NAME
4201	AV Gas Pump House
4203	BOQ Bravo Barracks
4204	BOQ Charlie Barracks
4206	Housing 4-Plex
4209	Housing Duplex
4210	Housing Duplex
4212	Housing
4213	Chapel
4214	Electrical Sub-Station
5126	Sewer Pump House
5150	Sewer Pump House
5182	Water Pump House
5187	Abandoned Building
5247	Tank
5267	Electrical Sub-Station
5295	Standby Generator
S5296	Tank JP-5
S5296	Tank
5301	Electrical Sub-station
5303	Water Treatment Plant
5304	Water Tower
5307	Control Tower
5308	Paint Shop
5309	PW Paint Storage/Old Receiver Building
5338	Transformer
5339	Water Treatment Storage R-2

BUILDING NUMBER	BUILDING NAME
5340	Electrical Sub-Station
5341	Chlorinator Building
5342	Telephone Exchange
5350	Electrical Sub-Station
5360	Electrical Sub-Station
5361	Electrical Sub-Station
5378	Electrical Sub-Station
5379	Navigational Lights
5392	Storage Balloon Inflation Building
5393	Hydrogen Generator AVI Meteor Facility
5399	Electrical Distribution
S6146	Bunker
6169	Concrete Pad
6171	Concrete Pad
6172	Concrete Pad
6173	Concrete Pad
6176	Concrete Pad
S6194	Bunker
S6195	Bunker
6325	Concrete Pad
6333	Housing 4-Plex
6334	Abandoned Housing 4-Plex
6338	Housing 4-Plex
6339	Housing 4-Plex
6341	George Cannon School
6348	CPO Club

BUILDING NUMBER	BUILDING NAME
6349	Ammunition Bunker
6350	Concrete Pad
6352	Concrete Pad
6353	Concrete Pad
6354	Bunker
S6355	Ball Field Pavilion
S6356	Baseball Field Dugout
S7112	Bunker
S7113	Bunker
S7118	Bunker
S7119	Bunker
S7121	Bunker
S7122	Bunker
S7123	Bunker
S7124	Bunker
S7125	Bunker
7140	Concrete Pad
8103	Receiver Building
8104	Electrical Sub-Station
8105	Pumping Station
8106	Electrical Sub-Station
8107	PDC Storage / Administration
8108	Hazardous Waste Storage
8109	Guard Tower
S9131	Concrete Tank Encasement
9135	Storage Shed

BUILDING NUMBER	BUILDING NAME
9144	Barbecue Pit
9145	Tacan Building
9146	Steam Plant Laundry
S9147	Fuel Tank
9148	Fuel Tank
9149	Pump House
Behind Building # 4201	Defueler Tank
Behind number S464	JP5 Defueler Pump House
No Number Available	No Name Available
No Number Available	Cemetery
Runway 6-24	Runway Marking
No Number Available	Concrete Pad
No Number Available	Concrete Pad
No Number Available	Concrete Pad
No Number Available	Concrete Pad
No Number Available	Radar Antenna Building
61 and S5310	Fire Hydrant and Flag Pole
Miscellaneous Tanks	Water Storage Tanks
Miscellaneous Tanks	Fuel Farm - Farm Tanks
Miscellaneous Tanks	Tanks
No Number Available	Miniature Golf Course
No Number Available	Electrical Sub-Station
Base Housing	2-Story Single Family Residence
Base Housing	1-Story Duplexes
Base Housing	2-Story 4-Plexes

NAF MIDWAY
ASBESTOS QC SAMPLES

		ORIGINAL SAMPLE		QA/QC SAMPLE	
BLDG	SAMPLE DESCRIPTION	SAMPLE ID #	SAMPLE RESULT	SAMPLE ID #	SAMPLE RESULT
No #	Green rolled shingle and tar paper	A1103-16	ND	A1103-16Q	ND
No #	Gray floor tile	A1103-5	Tile - <1% Chrysotile Mastic-<1% Chrysotile	A1103-5Q	Tile - ND Mastic - ND
Housing	Green w/white streaks 12" x 12" floor tile	A1125-8	Tile - ND Mastic - 8% Chrysotile	A1125-8Q	Tile - 2% Chrys. Mastic-2% Chrys.
Housing	Red w/gold streaks 9" x 9" floor tile	A1127-5	7% Chrysotile	A1127-5Q	5% Chrysotile
Housing	Blue w/brown and white streaks 12" x 12" floor tile	A1127-11	Tile - <1% Chrysotile Mastic - ND	A1127-11Q	Tile - ND Mastic - ND
Housing	Beige w/brown 12" x 12" floor tile	A1124-1	Tile - 3% Chrysotile Mastic - 5% Chrysotile	A1124-1Q	Tile - ND Mastic-3% Chrys
Housing	Red w/white streaks 9" x 9" floor tile	A1125-1	Tile - 1% Chrysotile Mastic - 8% Chrysotile	A1125-1Q	Tile - ND Mastic-5% Chrys.
Housing	Tar wrap on pipe	A1125-4	20% Amosite	A1125-4Q	ND
Housing	Light gray with black and white marble 9" x 9" floor tile	A1126-18	Tile - 4% Chrysotile Mastic -ND	A1126-18Q	2% Chrysotile
Housing	With w/gray and black streaks 9" x 9" floor tile	A1126-26	Tile - 15% Chrysotile Mastic-ND	A1126-26Q	Tile - 5% Chrys. Mastic - ND
Pump House	Black material on pipes	A1028-38	20% Chrysotile	A1028-38Q	25% Chrysotile
S-25	Black debris by tank	A1029-19	ND	A1029-19Q	ND
151	Cloth on exhaust system	A1104-23	70% Chrysotile	A1104-23Q	80% Chrysotile
151	Off white w/beige 12" x 12" floor tile	A1104-20	Tile - 1-2% Chrysotile Mastic - 6% Chrysotile	A1104-20Q	ND
259	Mustard w/brown flecks 12" x 12" floor tile	A1115-23	ND	A1115-23Q	ND
259	Red w/black flecks 9" x 9" floor tile	A1112-40	Tile - 8% Chrysotile Mastic - <1% Chrys.	A1112-40Q	Tile - 10% Chrys. Mastic-3% Chrys.
259	Off-white w/gray flecks 12" x 12" floor tile	A1112-38	Tile - <1% Chrysotile Mastic - 4% Chrysotile	A1112-38Q	Tile - 2% Chrys. Mastic-5% Chrys.
[illegible]	Red w/beige and gray 9" x 9" floor tile	A1122-1	8% Chrysotile	A1122-1Q	ND
[illegible]	Lt. brown w/dark brown and beige 9" x 9" floor tile	A1115-26	Tile - 10% Chrysotile Mastic - 1-2% Chrys.	A1115-26Q	Tile - 5% Chrys. Mastic-2% Chrys.

NAF MIDWAY
ASBESTOS QC SAMPLES

		ORIGINAL SAMPLE		QA/QC SAMPLE	
BLDG	SAMPLE DESCRIPTION	SAMPLE ID #	SAMPLE RESULT	SAMPLE ID #	SAMPLE RESULT
335	Expansion joint on air handler	A1106-26	ND	A1106-26Q	ND
336	Brown w/orange 9" x 9" floor tile	A1106-12	6% Chrysotile	A1106-12Q	2% Chrysotile
342	Green w/white 9" x 9" floor tile	A1116-18	Tile - ND Mastic - 25% Chrys.	A1116-18Q	2% Chrysotile
347	Red w/white streaks 9" x 9" floor tile	A1112-20	Tile - 6% Chrysotile Mastic - 5% Chrysotile	A1112-20Q	Tile - 5% Chrys. Mastic-5% Chrys.
348	Green w/beige 9" x 9" floor tile	A1116-1	Tile - 2% Chrysotile Mastic - 5% Chrysotile	A1116-1Q	5% Chrysotile
353	Brown w/white 9" x 9" floor tile	A1116-25	Tile - ND Mastic - 12% Chrys.	A1116-25Q	Tile - ND Mastic-2% Chrys.
354	Concrete	A1115-16	ND	A1115-16Q	ND
365	Brown sheet vinyl	A1117-28	ND	A1117-28	ND
[illegible]	Rolled roof	A1117-27	ND	A1117-27Q	ND
393	Black w/white streaks 9" x 9" floor tile	A1115-12	5% Chrysotile	A1115-12Q	Tile - <1% Chrys. Mastic-2% Chrys.
423	Black w/blue and white 9" x 9" floor tile	A1126-31	2% Chrysotile	A1126-31Q	2% Chrysotile
423	White w/gray 9" x 9" floor tile	A1126-26	15% Chrysotile	A1126-26Q	Tile - 5% Chrys. Mastic-5% Chrys.
502	Light brown w/brown and yellow 9" x 9" floor tile	A1122-16	Tile - 15% Chrysotile Mastic - 10% Chrys.	A1122-16Q	3% Chrysotile
578	Beige w/gray swirls 12" x 12" floor tile	A1110-31	2% Chrysotile	A1110-31Q	ND
578	Black stairtred	A1110-40	ND	A1110-40Q	ND
578	Gold w/brown and beige flecks 12" x 12" floor tile	A1110-33	ND	A1110-33Q	Tile - ND Mastic - 5%
578	Woven material on exhaust stack	A1110-43	90% Chrysotile	A1110-43Q	90% Chrysotile
[illegible]9	Sand color w/brown and white 9" x 9" floor tile	A1110-16	Tile - 2% Chrysotile Mastic - 3% Chrysotile	A1110-16Q	2% Chrysotile
[illegible]	Green 9" x 9" floor tile	A1110-4	Tile - 3% Chrysotile Mastic - 2% Chrysotile	A1110-4Q	Tile - 2% Chrys. Mastic-2% Chrys

NAF MIDWAY
ASBESTOS QC SAMPLES

		ORIGINAL SAMPLE		QA/QC SAMPLE	
BLDG	SAMPLE DESCRIPTION	SAMPLE ID #	SAMPLE RESULT	SAMPLE ID #	SAMPLE RESULT
619	Red stamped pattern 12" x 12" floor tile	A1123-27	Tile - 2% Chrysotile Mastic - 1-2% Chrys.	A1123-27Q	ND
623	Green w/white streaks 9" x 9" floor tile	A1123-7	Tile - 15% Chrysotile Mastic - 8% Chrysotile	A1123-7Q	Tile - 3% Chrys. Mastic-2% Chrys.
623	Beige w/brown 12" x 12" floor tile	A1123-9	<1% Chrysotile	A1123-9Q	2% Chrysotile
643	Beige w/green 9" x 9" floor tile	A1123-22	Tile - 10% Chrysotile Mastic - 15% Chrys.	A1123-22Q	Tile - 2% Chrys. Mastic-5% Chrys.
S692	Roof Core	A1102-5	ND	A1102-5Q	ND
963	Off white w/green 9" x 9" floor tile	A1106-3	Tile - 8% Chrysotile Mastic - 1-2% Chrys.	A1106-3Q	Tile - 2% Chrys. Mastic-2% Chrys.
971	Beige w/orange and brown 12" x 12" floor tile	A1105-17	6% Chrysotile	A1105-17Q	ND
3	Light brown w/dark brown shades 9" x 9" floor tile	A1105-19	Tile - 2% Chrysotile Mastic - 1-2% Chrys.	A1105-19Q	Tile - ND Mastic-5% Chrys.
1123	Rock roof core	A1103-13	ND	A1103-13Q	ND
2402	Black tar paper inside wall	A1104-12	ND	A1104-12Q	ND
2402	Black w/green and white 9" x 9" floor tile	A1104-11	Tile - 9% Chrysotile Mastic - 4% Chrysotile	A1104-11Q	Tile - 5% Chrys. Mastic-3% Chrys.
2403	Black w/white and green 9" x 9" floor tile	A1119-13	15% Chrysotile	A1119-13Q	Tile - 3% Chrys. Mastic-5% Chrys.
2403	Beige w/brown 9" x 9" floor tile	A1119-18	Tile - 10% Chrysotile Mastic - 5% Chrysotile	A1119-18Q	Tile - 3% Chrys. Mastic-5% Chrys.
2404	Green w/white and green 9" x 9" floor tile	A1117-22	Tile - ND Mastic - 2% Chrysotile	A1117-22Q	2% Chrysotile
4140	Green w/beige and blue 9" x 9" floor tile	A1118-29	8% Chrysotile	A1118-29Q	2% Chrysotile
4204	Black w/white streaks 9" x 9" floor tile	A1118-12	15% Chrysotile	A1118-12Q	ND
04	Pipe lagging	A1118-13	ND	A1118-13Q	ND
3	Black w/beige and green 9" x 9" floor tile	A1113-15	Tile - 8% Chrysotile Mastic - 7% Chrysotile	A1113-15Q	10% Chrysotile

NAF MIDWAY
ASBESTOS QC SAMPLES

		ORIGINAL SAMPLE		QA/QC SAMPLE	
BLDG	SAMPLE DESCRIPTION	SAMPLE ID #	SAMPLE RESULT	SAMPLE ID #	SAMPLE RESULT
4206	Turquoise w/white streaks 12" x 12" floor tile	A1113-14	Tile - 2% Chrysotile Mastic-30% Chrysotile	A1113-14Q	Tile - 2% Chrys. Mastic-2% Chrys.
4206	Light green w/dark green and white 9" x 9" floor tile	A1113-22	Tile - 8% Chrysotile Mastic - 6% Chrysotile	A1113-22Q	Tile - 2% Chrys. Mastic-5% Chrys.
4207	Beige w/brown and white 12" x 12" floor tile	A1127-11	<1% Chrysotile	A1127-11Q	ND
4207	Beige stucco	A1127-8	<1% Chrysotile	A1127-8Q	2% Chrysotile
4213	Black w/green and white streaks floor tile	A1027-20	Tile - 4% Chrysotile Mastic - 5% Chrysotile	A1027-20Q	Tile - 5% Chrys. Mastic-5% Chrys.
5306	Light brown w/dark brown and white floor tile	A1025-3	Tile - 8% Chrysotile Mastic-15% Chrysotile	A1025-3Q	ND
5306	Brown/red w/white floor tile	A1025-11	7% Chrysotile	A1025-11Q	3% Chrysotile
[illegible]06	Black w/green and off-white floor tile	A1025-36	8% Chrysotile	A1025-36Q	Tile - 5% Chrys. Mastic-5% Chrys.
5309	Black 9" x 9" floor tile	A1105-1	Tile - 1-2% Chrysotile Mastic-ND	A1105-1Q	ND
5340	Multi-layer roof core	A1105-10	1. 65% Chrysotile 2. 60% Chrysotile	A1105-10Q	35% Chrysotile
5342	Rolled roofing	A1118-26	ND	A1118-26Q	ND
5392	Gray shingle	A1109-10	ND	A1109-10Q	ND
6174	Red floor tile	A1108-2	Tile - 10% Mastic-ND	A1108-2Q	20% Chrysotile
6309	Stucco	A1124-15	ND	A1124-15Q	5% Chrysotile
6330	Black w/white 9" x 9" floor tile	A1124-32	Tile - 5% Chrysotile Mastic - 15% Chrys.	A1124-32Q	Tile - 3% Chrys. Mastic-7% Chrys.
6333	Gray and white stairtred	A1111-11	Tile - 20% Chrysotile Mastic - 1-2% Chrys.	A1111-11Q	ND
6334	Beige w/orange and brown 12" x 12" beige floor tile	A1111-22	Tile - ND Mastic - 3% Chrys.	A1111-22Q	Tile - ND Mastic-5% Chrys.
[illegible]8	Black w/white 9" x 9" floor tile	A1108-18	Tile - 12% Chrysotile Mastic - <1% Chrys.	A1108-18Q	Tile - 3% Chrys. Mastic-5% Chrys.

NAF MIDWAY
ASBESTOS QC SAMPLES

		ORIGINAL SAMPLE		QA/QC SAMPLE	
BLDG	SAMPLE DESCRIPTION	SAMPLE ID #	SAMPLE RESULT	SAMPLE ID #	SAMPLE RESULT
6348	Green 9" x 9" floor tile	A1108-23	Tile - 4% Chrysotile Mastic - 5% Chrysotile	A1108-23Q	Tile - 2% Chrys. Mastic-2% Chrys.
S7122	Concrete wall	A1102-23	ND	A1102-23Q	ND
7135	White fireboard ceiling	A1028-26	ND	A1028-26Q	ND
8103	Off-white 12" x 12" floor tile	A1109-3	Tile - 3% Chrysotile Mastic - 4% Chrysotile	A1109-3Q	Tile - 1% Chrys. Mastic-2% Chrys.
8108	Green transite	A1102-12	25 % Chrysotile	A1102-12Q	45% Chrysotile
9146	White pipe lagging	A1117-35	10% Chrysotile 30% Amosite 15% Crocidolite	A1117-35Q	10% Chrysotile 30% Amosite 15% Crocidolite

ND = None detected

NAF MIDWAY
LEAD BASED PAINT QC SAMPLES

		ORIGINAL SAMPLE		QA/QC SAMPLE	
BLDG.	SAMPLE DESCRIPTION	SAMPLE ID #	SAMPLE RESULT (ppm)	SAMPLE ID #	SAMPLE RESULT (ppm)
S-21	Yellow paint	L1029-48	230,400.0	L1029-48Q	169,772.7
140	Brown paint	L1103-17	25,993.9	L1103-17Q	26,146.9
144	Dark gray paint	L1104-9	3,498.8	L1103-9Q	2,571.0
151	Peach with blue paint	L1104-36	ND	L1104-36Q	1,143.1
151	Blue paint	L1104-32	11.9	L1104-32Q	208.9
174	Peach paint	L1103-27	4,906.3	L1103-27Q	4,113.6
259	White paint	L1122-1	76,175.0	L1122-1Q	124,026.3
259	White paint	L1122-11	393,010.7	L1122-11Q	471,717.2
259	Off-white paint	L1112-60	107.8	L1112-60Q	186.8
259	Red paint	L1115-35	ND	L1115-35Q	75.2
259	Yellow paint	L1122-7	8,175.0	L1122-7Q	8,355.3
259	Beige paint	L1115-37	ND	L1115-37Q	93.5
309	Green paint	L1117-3	24,700.0	L1117-3Q	27,670.4
330	Off-white paint	L1115-53	1,786.9	L1115-53Q	1,990.0
330	Off-white paint	L1115-51	828.3	L1115-51Q	746.4
342	Orange paint	L1116-26	20,568.2	L1116-26Q	39,661.4
342	Beige paint	L1116-22	1194.0	L1116-22Q	1,345.2
343	Light gray paint	L1116-18	89,804.7	L1116-18Q	46,344.1
348	Off-white paint	L1116-8	1,037.2	L1116-8Q	1,264.2
349	White paint	L1118-38	111,377.5	L1118-38Q	87,292.9
354	Green paint	L1115-16	47,032.9	L1115-16Q	25,344.8
360	Off-white paint	L1118-30	2330.8	L1118-30Q	13.0
365	Peach paint	L1117-41	281,318.7	L1117-41Q	353,823.5
365	Light gray paint	L1117-42	13,916.7	L1117-42Q	9281.9
400	Gray paint	L1102-16	471.5	L1102-16Q	1,608.0

NAF MIDWAY
LEAD BASED PAINT QC SAMPLES

		ORIGINAL SAMPLE		QA/QC SAMPLE	
BLDG.	SAMPLE DESCRIPTION	SAMPLE ID #	SAMPLE RESULT (ppm)	SAMPLE ID #	SAMPLE RESULT (ppm)
414	Blue paint	L1127-4	8,555.0	L1127-4Q	16,744.8
414	White paint	L1127-3	17,069.9	L1127-3Q	36,804.1
416	White paint	L1126-5	1766.0	L1126-5Q	1977.4
416	White paint	L1126-6	27,175.0	L1126-6Q	24,974.5
423	Beige paint	L1126-19	116,450.0	L1126-19Q	156,328.1
521	Green paint	L1112-4	17,335.6	L1112-4Q	150,360.8
521	Light green paint	L1112-7	2,991.6	L1112-7Q	9260.2
578	Yellow paint	L1110-29	81.4	L1110-29Q	96.4
623	White paint	L1123-21	161,155.9	L1123-21Q	144, 171.2
631	Off-white paint	L1123-14	80,043.1	L1123-14Q	107,333.3
643	White paint	L1123-32	12,556.8	L1123-32Q	12,556.8
S692	Off-white paint	L1102-20	27,954.5	L1102-20Q	18,170.1
970	White paint	L1105-54	5,188.2	L1105-54Q	3,266.7
971	Off-white paint	L1105-30	1,273.9	L1105-30Q	1,731.6
973	Dark green paint	L1105-39	808.3	L1105-39Q	1,921.4
2127	Off-white	L1029-10	5,268.8	L1029-10Q	346.8
2403	White paint	L1119-35	2,707.5	L1119-35Q	2,541.0
2404	Gold paint	L1117-30	1,830.6	L1117-30Q	1,793.1
2404	Off-white paint	L1117-28	4,436.8	L1117-28Q	3,254.1
2412	Black paint	L1028-30	59,944.4	L1028-30Q	110,578.9
2412	Brown paint	L1029-28	447.9	L1029-28Q	301.2
2414	Off-white paint	L1104-15	241.6	L1104-15Q	511.6
3501	Medium green paint	L1115-4	7,600.0	L1115-4Q	1,143.9
3502	Off-white paint	L1122-43	1,303.9	L1122-43Q	1,443.9
3502	Brown paint	L1122-46	68.7	L1122-46Q	87.9
3505	Off-white paint	L1119-15	833.8	L1119-15Q	860.8
3505	Off-white paint	L1119-9	5,371.4	L1119-9Q	794.3

NAF MIDWAY
LEAD BASED PAINT QC SAMPLES

		ORIGINAL SAMPLE		QA/QC SAMPLE	
BLDG.	SAMPLE DESCRIPTION	SAMPLE ID #	SAMPLE RESULT (ppm)	SAMPLE ID #	SAMPLE RESULT (ppm)
3512	Green paint	L1114-19	31,032.6	L1114-19Q	24,222.2
3512	Gray and red paint	L1114-17	3,237.9	L1114-17Q	1,436.7
3513	Black paint	L1112-21	1,380.9	L1112-21Q	4,050.0
3514	Blue paint	L1112-33	485.7	L1112-33Q	939.5
S-3523	Blue paint	L1112-28	30,132.9	L1112-28Q	62,838.5
S4129	Brown paint	L1029-52	73.6	L1029-52Q	126.3
4140	Off-white paint	L1118-51	30.5	L1118-51Q	91.7
4140	White paint	L1118-58	11.5	L1118-58Q	30.2
4204	White paint	L1118-19	113.8	L1118-19Q	73.9
4213	Light green paint	L1027-29	146.5	L1027-29Q	279.5
4213	Off-white paint	L1027-30	1,617.4	L1027-30Q	1,354.5
5126	Off-white paint	L1103-18	13,578.9	L1103-18Q	15,076.5
5304	White paint	L1103-4	48,088.2	L1103-4Q	328,983.5
5306	White paint	L1025-31	476.5	L1025-31Q	574.0
5306	Yellow paint	L1025-14	68,021.9	L1025-14Q	78,818.7
5306	Dark brown paint	L1025-1	159.6	L1025-1Q	375.5
5307	Green paint	L1110-39	149.5	L1110-39Q	346.9
5307	Gray paint	L1110-49	3,675.0	L1110-49Q	4,201.6
5309	Beige paint	L1105-5	1,526.9	L1105-5Q	2,573.6
5309	Brownish green paint	L1105-8	14,706.6	L1105-8Q	5,961.2
5341	White paint	L1109-43	507.6	L1109-43Q	368.2
6302	White paint	L1124-14	919.8	L1124-14Q	46.1
6305	Blue paint	L1124-64	1980.6	L1124-64Q	2714.7
6309	White paint	L1124-18	890.7	L1124-18Q	645.4
6310	Green paint	L1124-24	5755.5	L1124-24Q	7689.4
6314	Green paint	L1124-36	21,728.7	L1124-36Q	2750.0
6333-D	White paint	L1111-20	1,873.2	L1111-20Q	1,765.3

NAF MIDWAY
LEAD BASED PAINT QC SAMPLES

		ORIGINAL SAMPLE		QA/QC SAMPLE	
BLDG.	SAMPLE DESCRIPTION	SAMPLE ID #	SAMPLE RESULT (ppm)	SAMPLE ID #	SAMPLE RESULT (ppm)
6333-A	Yellow paint	L1111-32	931.0	L1111-32Q	657.8
6336	White paint	L1124-71	57,925.2	L1124-71Q	60,167.5
6338	Green paint	L1111-61	4573.7	L1111-61Q	4,144.5
6339	Off-white and green paint	L1111-69	1,269.3	L1111-69Q	1,288.0
6339	Green, white and beige paint	L1111-77	10,189.6	L1111-77Q	1,795.3
6340	White paint	L1124-6	1,793.3	L1124-6Q	2600.0
6340	Yellow paint	L1124-7	1905.8	L1124-7Q	2123.5
6346	Yellow paint	L1027-1	34,619.6	L1027-1Q	38,657.9
6348	Blue	L1108-14	19,770.4	L1108-14Q	22,912.4
6395	Off-white paint	L1123-8	267.1	L1123-8Q	1,014.6
S7113	Green paint	L1102-41	21,443.3	L1102-41Q	22,362.6
8103	Eggshell and gray paint	L1109-19	1,145.0	L1109-19Q	935.3
8103	Eggshell paint	L1109-18	781.9	L1109-18Q	355.5
8109	White paint	L1102-29	2,056.0	L1102-29Q	3,074.5
9101	Yellow paint	L1028-32	15,098.3	L1028-32Q	9,029.2
9102	Light blue paint	L1028-27	3,724.1	L1027-27Q	2,653.2
9123	Green paint	L1026-2	14,058.8	L1026-2Q	13,000.0
9145	Brown paint	L1109-34	403.1	L1109-34Q	203.0
9149	Pump house	L1115-20	5,300.0	L1115-20Q	5,743.0
9201	Lead wire	L1026-7	89,226.8	L1026-7Q	245,675.0

Asbestos Bulk Sampling Log
NAF Midway

THE SZARAS COMPANIES

 DATE SAMPLES COLLECTED: November 1, 1993

Building Number	Building Name	Building Description
110	Abandoned Electrical Room	1 Story
TSC Project Number	**TSC Inspector**	**TSC Laboratory ID No.**
865	J. Kain and B. Kain	110893N

Sample ID No	Sample Location / Description	Analytical Results	Friable	Condition	Amount
No sample collected	Corrugated roof Transite panels Same as sample A1027-27, building 5182	45% Chrysotile	No	Good	250 sq. ft.
A1101-5	Exterior Concrete foundation	None detected	No	Fair	250 sq. ft.

is assumed that anywhere the above identified asbestos containing building materials are found in the building, that those erials also contain asbestos and should be treated as such.

LEAD BASED PAINT SAMPLING LOG
NAF MIDWAY

THE SZARAS COMPANIES

 DATE SAMPLES COLLECTED: November 1, 1993

BUILDING NUMBER	BUILDING NAME	BUILDING DESCRIPTION
110	Abandoned Electrical Room	1 Story
TSC PROJECT NUMBER	**TSC INSPECTOR**	**TSC LABORATORY ID NO.**
865	J. Kain and B. Kain	110893M

SAMPLE ID NO	SAMPLE LOCATION / DESCRIPTION	ANALYTICAL RESULTS (PPM)	CONDITION	AMOUNT
L1101-8	Interior northeast Green paint on door	22,575.1	Poor	75 sq. ft.
L1101-9	Exterior northeast Brown paint on door	2,622.1	Poor	75 sq. ft.
L1101-10	Exterior northeast Off-white paint walls	5,296.8	Fair	800 sq. ft.
L1101-11	Interior Gray paint on voltage box	2,962.5	Good	180 sq. ft. (paint is on multiple voltage boxes)

. is assumed that anywhere the above identified lead based paint materials are found in the building, that those materials) contain lead and should be treated as such.

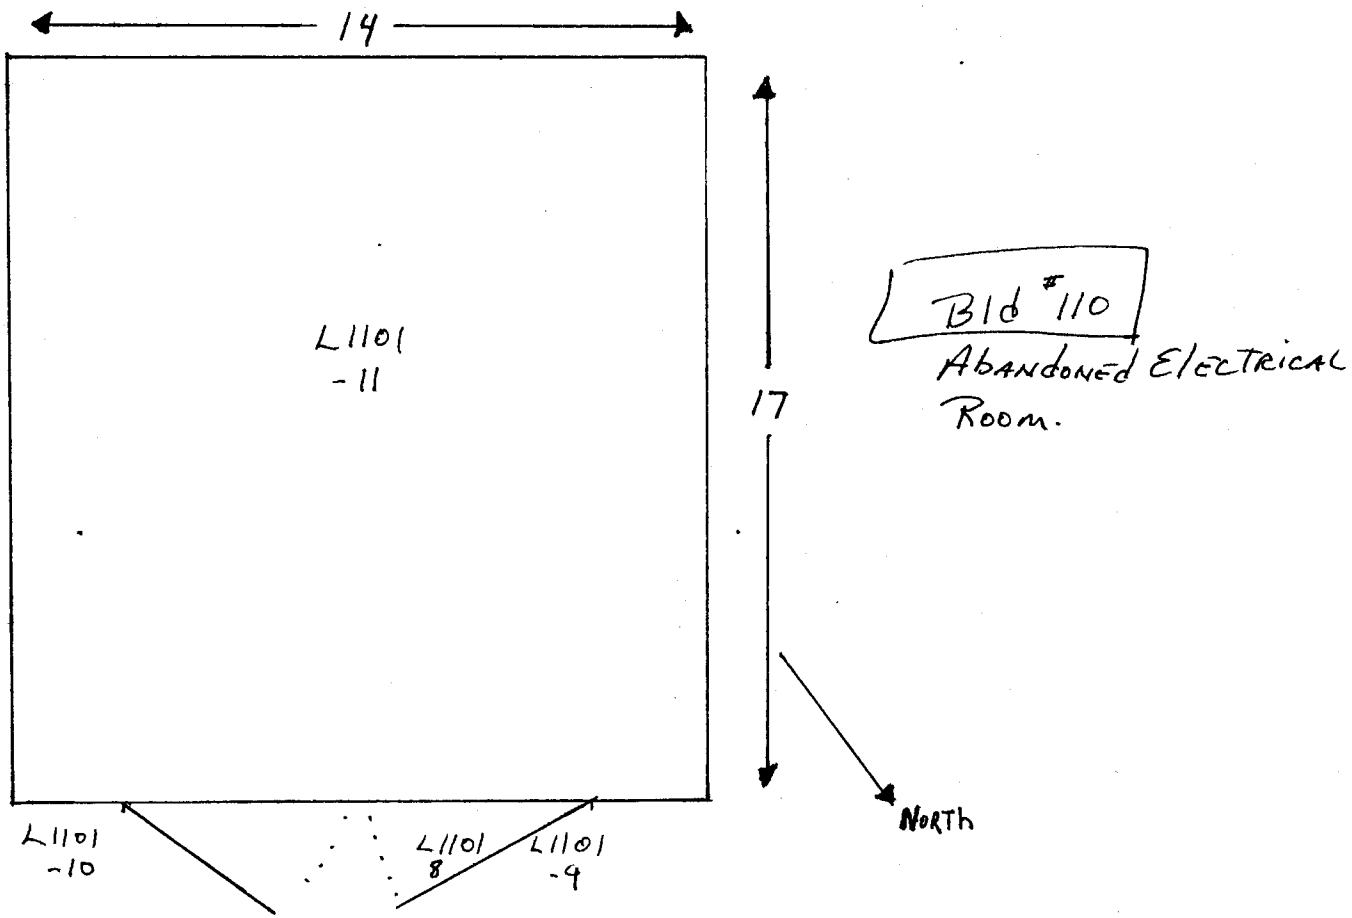
14
17
L1101
-11
L1101
-10
L1101
8
L1101
-9
NORTH
Bld #110
Abandoned Electrical
Room.

Asbestos Bulk Sampling Log
NAF Midway

THE SZARAS COMPANIES

 DATE SAMPLES COLLECTED: November 3, 1993

BUILDING NUMBER	BUILDING NAME	BUILDING DESCRIPTION
117	Concrete Pad	Concrete Pad
TSC PROJECT NUMBER	**TSC INSPECTOR**	**TSC LABORATORY ID NO.**
865	J. Kain and B. Kain	111693A

SAMPLE ID NO	SAMPLE LOCATION / DESCRIPTION	ANALYTICAL RESULTS	FRIABLE	CONDITION	AMOUNT
A1103-4	Exterior concrete pad Red 9" x 9" red floor tile and Green 9" x 9" floor tile	Red tile - 6% Chrysotile Mastic - 4% Chrysotile Green tile - 10% Chrysotile	No	Poor	70 sq. ft.

It is assumed that anywhere the above identified asbestos containing building materials are found in the building, that those materials also contain asbestos and should be treated as such.

Lead Based Paint Sampling Log
NAF Midway

THE SZARAS COMPANIES

DATE SAMPLES COLLECTED: November 3, 1993

BUILDING NUMBER	BUILDING NAME	BUILDING DESCRIPTION
117	Concrete Pad	Concrete Pad
TSC PROJECT NUMBER	**TSC INSPECTOR**	**TSC LABORATORY ID NO.**
865	J. Kain and B. Kain	N/A

SAMPLE ID NO	SAMPLE LOCATION / DESCRIPTION	ANALYTICAL RESULTS (PPM)	CONDITION	AMOUNT
No sample collected	Not painted	N/A		

is assumed that anywhere the above identified lead based paint materials are found in the building, that those materials o contain lead and should be treated as such.

Asbestos Bulk Sampling Log
NAF Midway

THE SZARAS COMPANIES

 DATE SAMPLES COLLECTED: November 3, 1993

BUILDING NUMBER	BUILDING NAME	BUILDING DESCRIPTION
140	Electrical Sub-station	1 Story
TSC PROJECT NUMBER	**TSC INSPECTOR**	**TSC LABORATORY ID NO.**
865	J. Kain and B. Kain	111693A

SAMPLE ID NO	SAMPLE LOCATION / DESCRIPTION	ANALYTICAL RESULTS	FRIABLE	CONDITION	AMOUNT
A1103-3	Roof Multi-layer roof core	1. None detected 2. 20% Chrysotile	No	Good	275 sq. ft.

It is assumed that anywhere the above identified asbestos containing building materials are found in the building, that those aterials also contain asbestos and should be treated as such.

Lead Based Paint Sampling Log
NAF Midway

THE SZARAS COMPANIES

 DATE SAMPLES COLLECTED: November 3, 1993

BUILDING NUMBER	BUILDING NAME	BUILDING DESCRIPTION
140	Electrical Sub-Station	1 Story
TSC PROJECT NUMBER	**TSC INSPECTOR**	**TSC LABORATORY ID NO.**
865	J. Kain and B. Kain	111593K

SAMPLE ID NO	SAMPLE LOCATION / DESCRIPTION	ANALYTICAL RESULTS (PPM)	CONDITION	AMOUNT
L1103-15	Interior northwest side Red paint on deck	160.1	Poor	250 sq. ft.
L1103-16	Interior center of room Gray paint on voltage box	8,470.9	Good	100 sq. ft.
L1103-17	Exterior north side Brown paint on door	25,993.9	Poor	125 sq. ft.
No sample collected	White paint on wall inside and outside Same as sample L1103-3, building 5360	575.8	Good	1,600 sq. ft.

is assumed that anywhere the above identified lead based paint materials are found in the building, that those materials) contain lead and should be treated as such.

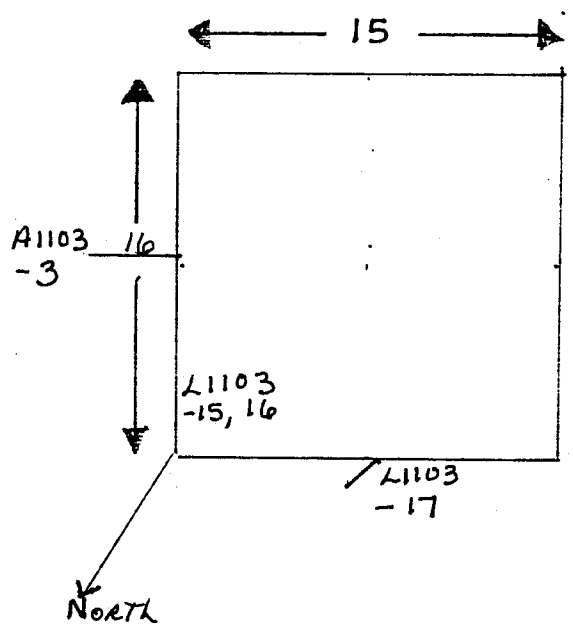

Bld # 140

ELECTRICAL
Sub STA.

ASBESTOS BULK SAMPLING LOG
NAF MIDWAY

THE SZARAS COMPANIES

 DATE SAMPLES COLLECTED: November 4, 1993

BUILDING NUMBER	BUILDING NAME	BUILDING DESCRIPTION
144	Power Plant	1 Story
TSC PROJECT NUMBER	**TSC INSPECTOR**	**TSC LABORATORY ID NO.**
865	J. Kain and B. Kain	111693H

SAMPLE ID NO	SAMPLE LOCATION / DESCRIPTION	ANALYTICAL RESULTS	FRIABLE	CONDITION	AMOUNT
A1104-4	Interior northwest side of exhaust stack Pipe lagging and wrap	60% Chrysotile 20% Amosite	Yes	Good	100 sq. ft.
A1104-5	Exterior northwest side Concrete on side of building	None detected	No	Poor	2,000 sq. ft.
A1104-6	Exterior west side Tar on concrete short roof	None detected	No	Fair	2,100 sq. ft.
A1104-7	Interior northeast wall New gaskets hanging on wall	Rectangle - 90% Chrysotile	Yes	Good	30 sq. ft. total for A1104-7 & 8
A1104-8	Interior northeast wall New gasket	Round - 92% Chrysotile	Yes	Good	See A1104-7
	No roof access to tall roof and building in poor shape due to fire damage.				
	All gaskets in system are suspect ACM due to excessive corrosion. No excess material was accessed. Samples L1104-7 and 8 remain from fire damage.				

It is assumed that anywhere the above identified asbestos containing building materials are found in the building, that those materials also contain asbestos and should be treated as such.

LEAD BASED PAINT SAMPLING LOG
NAF MIDWAY

THE SZARAS COMPANIES

DATE SAMPLES COLLECTED: November 4 1993

BUILDING NUMBER	BUILDING NAME	BUILDING DESCRIPTION
144	Power Plant	1 Story
TSC PROJECT NUMBER	**TSC INSPECTOR**	**TSC LABORATORY ID NO.**
865	J. Kain and B. Kain	111693B

SAMPLE ID NO	SAMPLE LOCATION / DESCRIPTION	ANALYTICAL RESULTS (PPM)	CONDITION	AMOUNT
L1104-9	Interior west wall Dark gray paint on wall	3,498.8	Poor	3,500 sq. ft.
L1104-10	Interior west wall Red/orange paint on sprinkler	132,236.8	Poor	150 lin. ft
L1104-11	Interior west engine Light gray paint on diesel engine generator	4,111.3	Poor	1,400 sq. ft..
L1104-12	Exterior west wall Light gray paint on wall	4,765.1	Poor	1,000 sq. ft.
L1004-13	Exterior northwest wall White and blue paint on pipes	3,441.6	Poor	100 sq. ft.
L1004-14	Exterior west end chiller Silver paint on chiller	1,010.0	Fair	300 sq. ft.

is assumed that anywhere the above identified lead based paint materials are found in the building, that those materials o contain lead and should be treated as such.

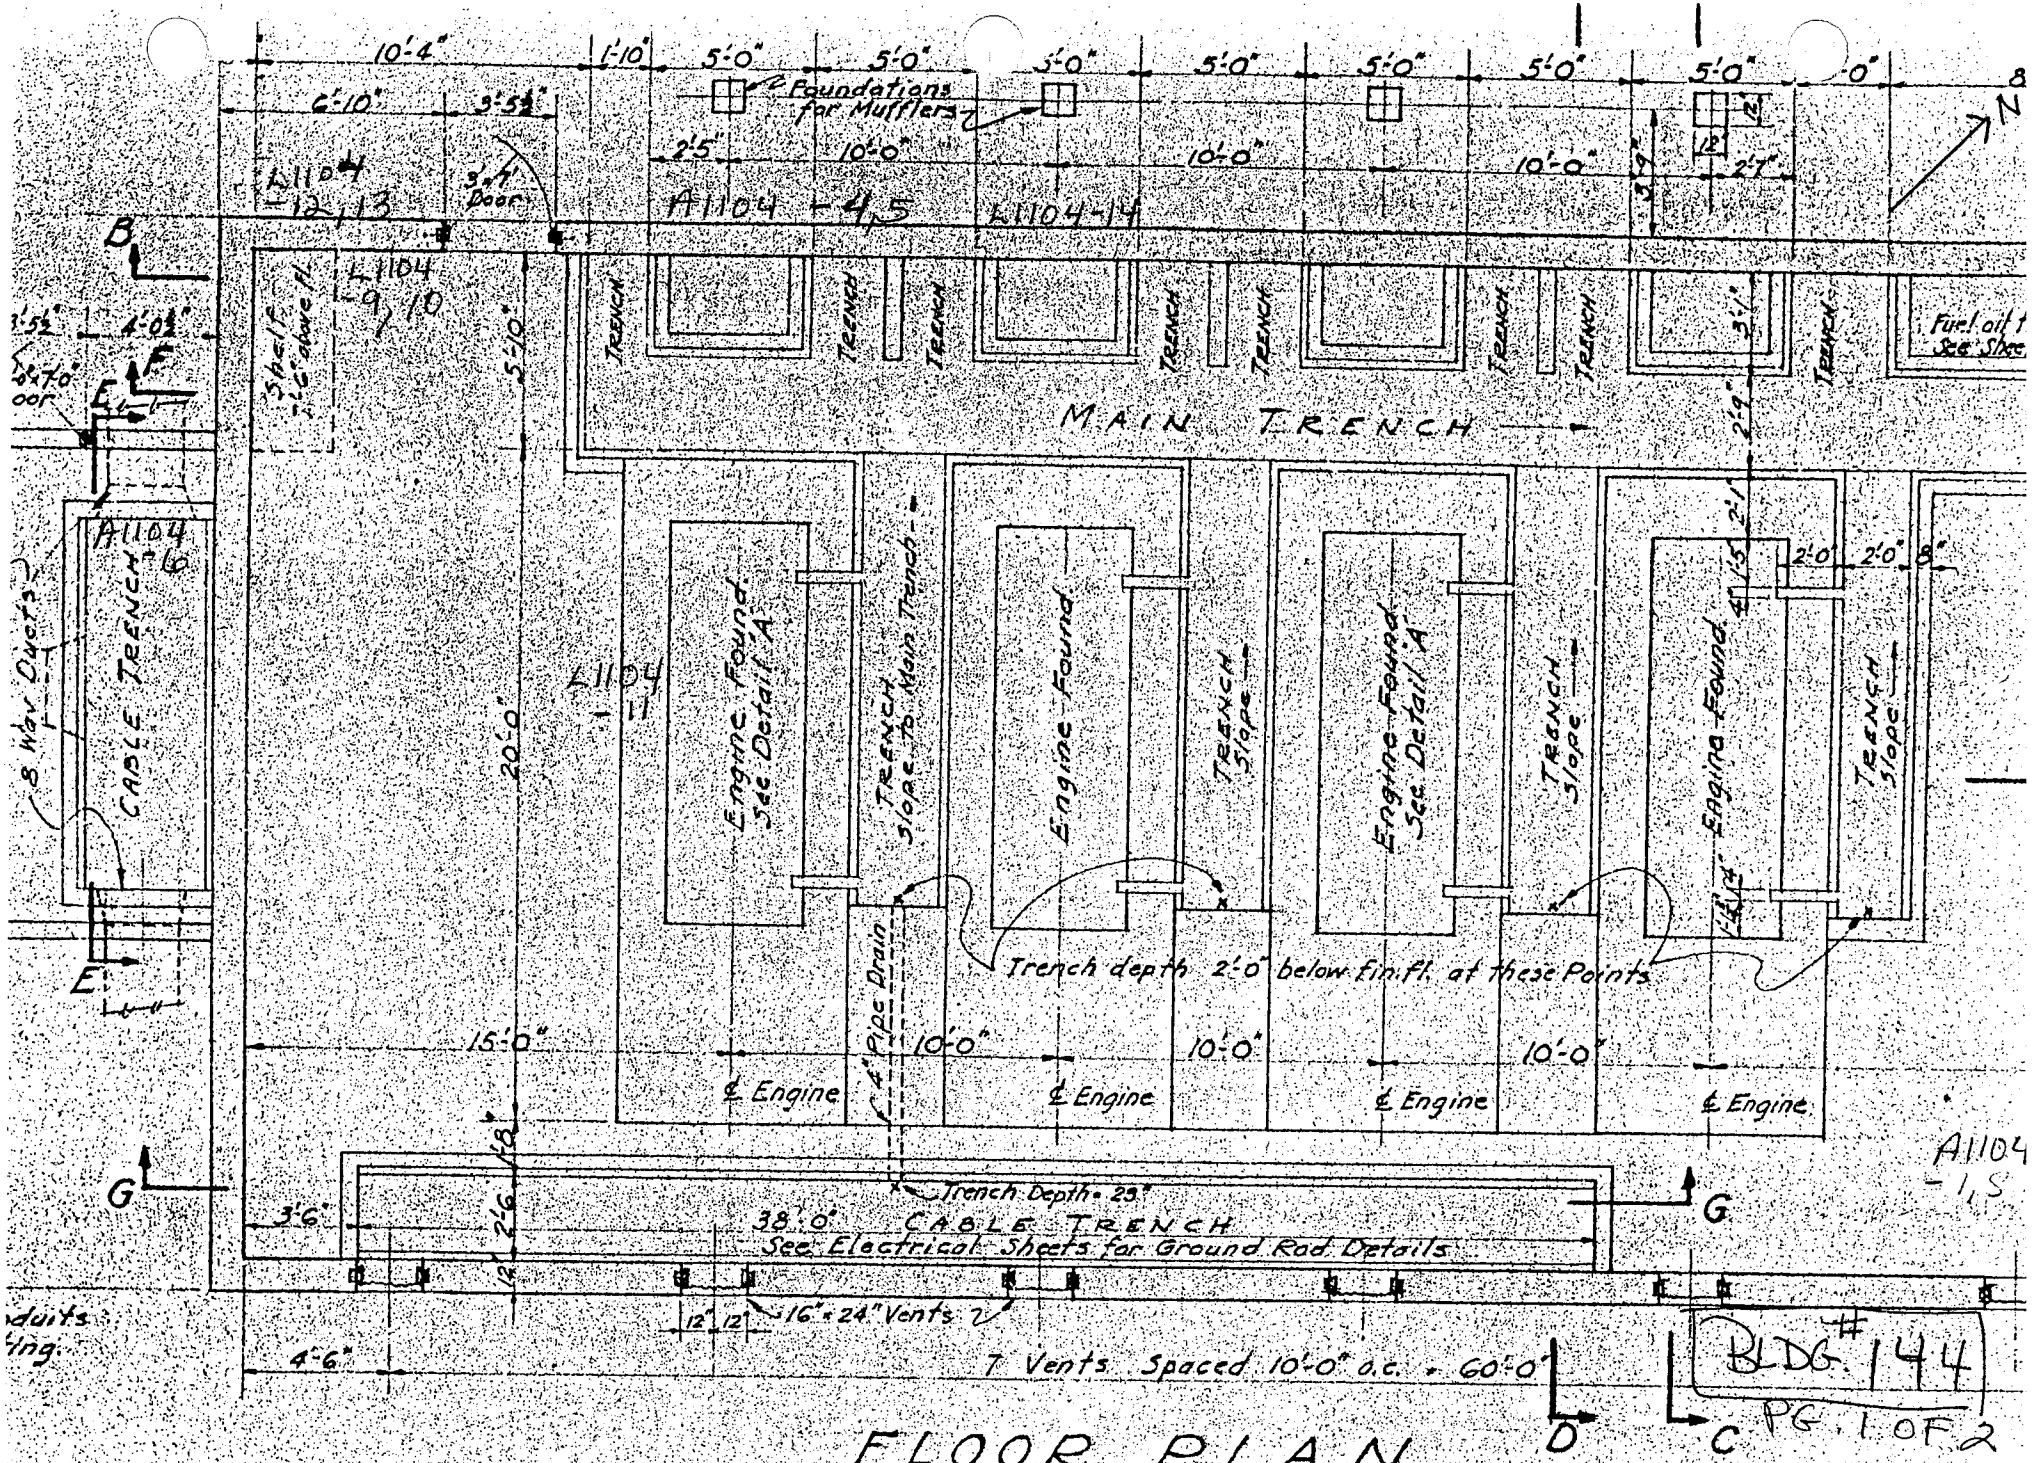

FLOOR PLAN

Scale: 1/4" = 1'-0"

1600 KW Power Plant

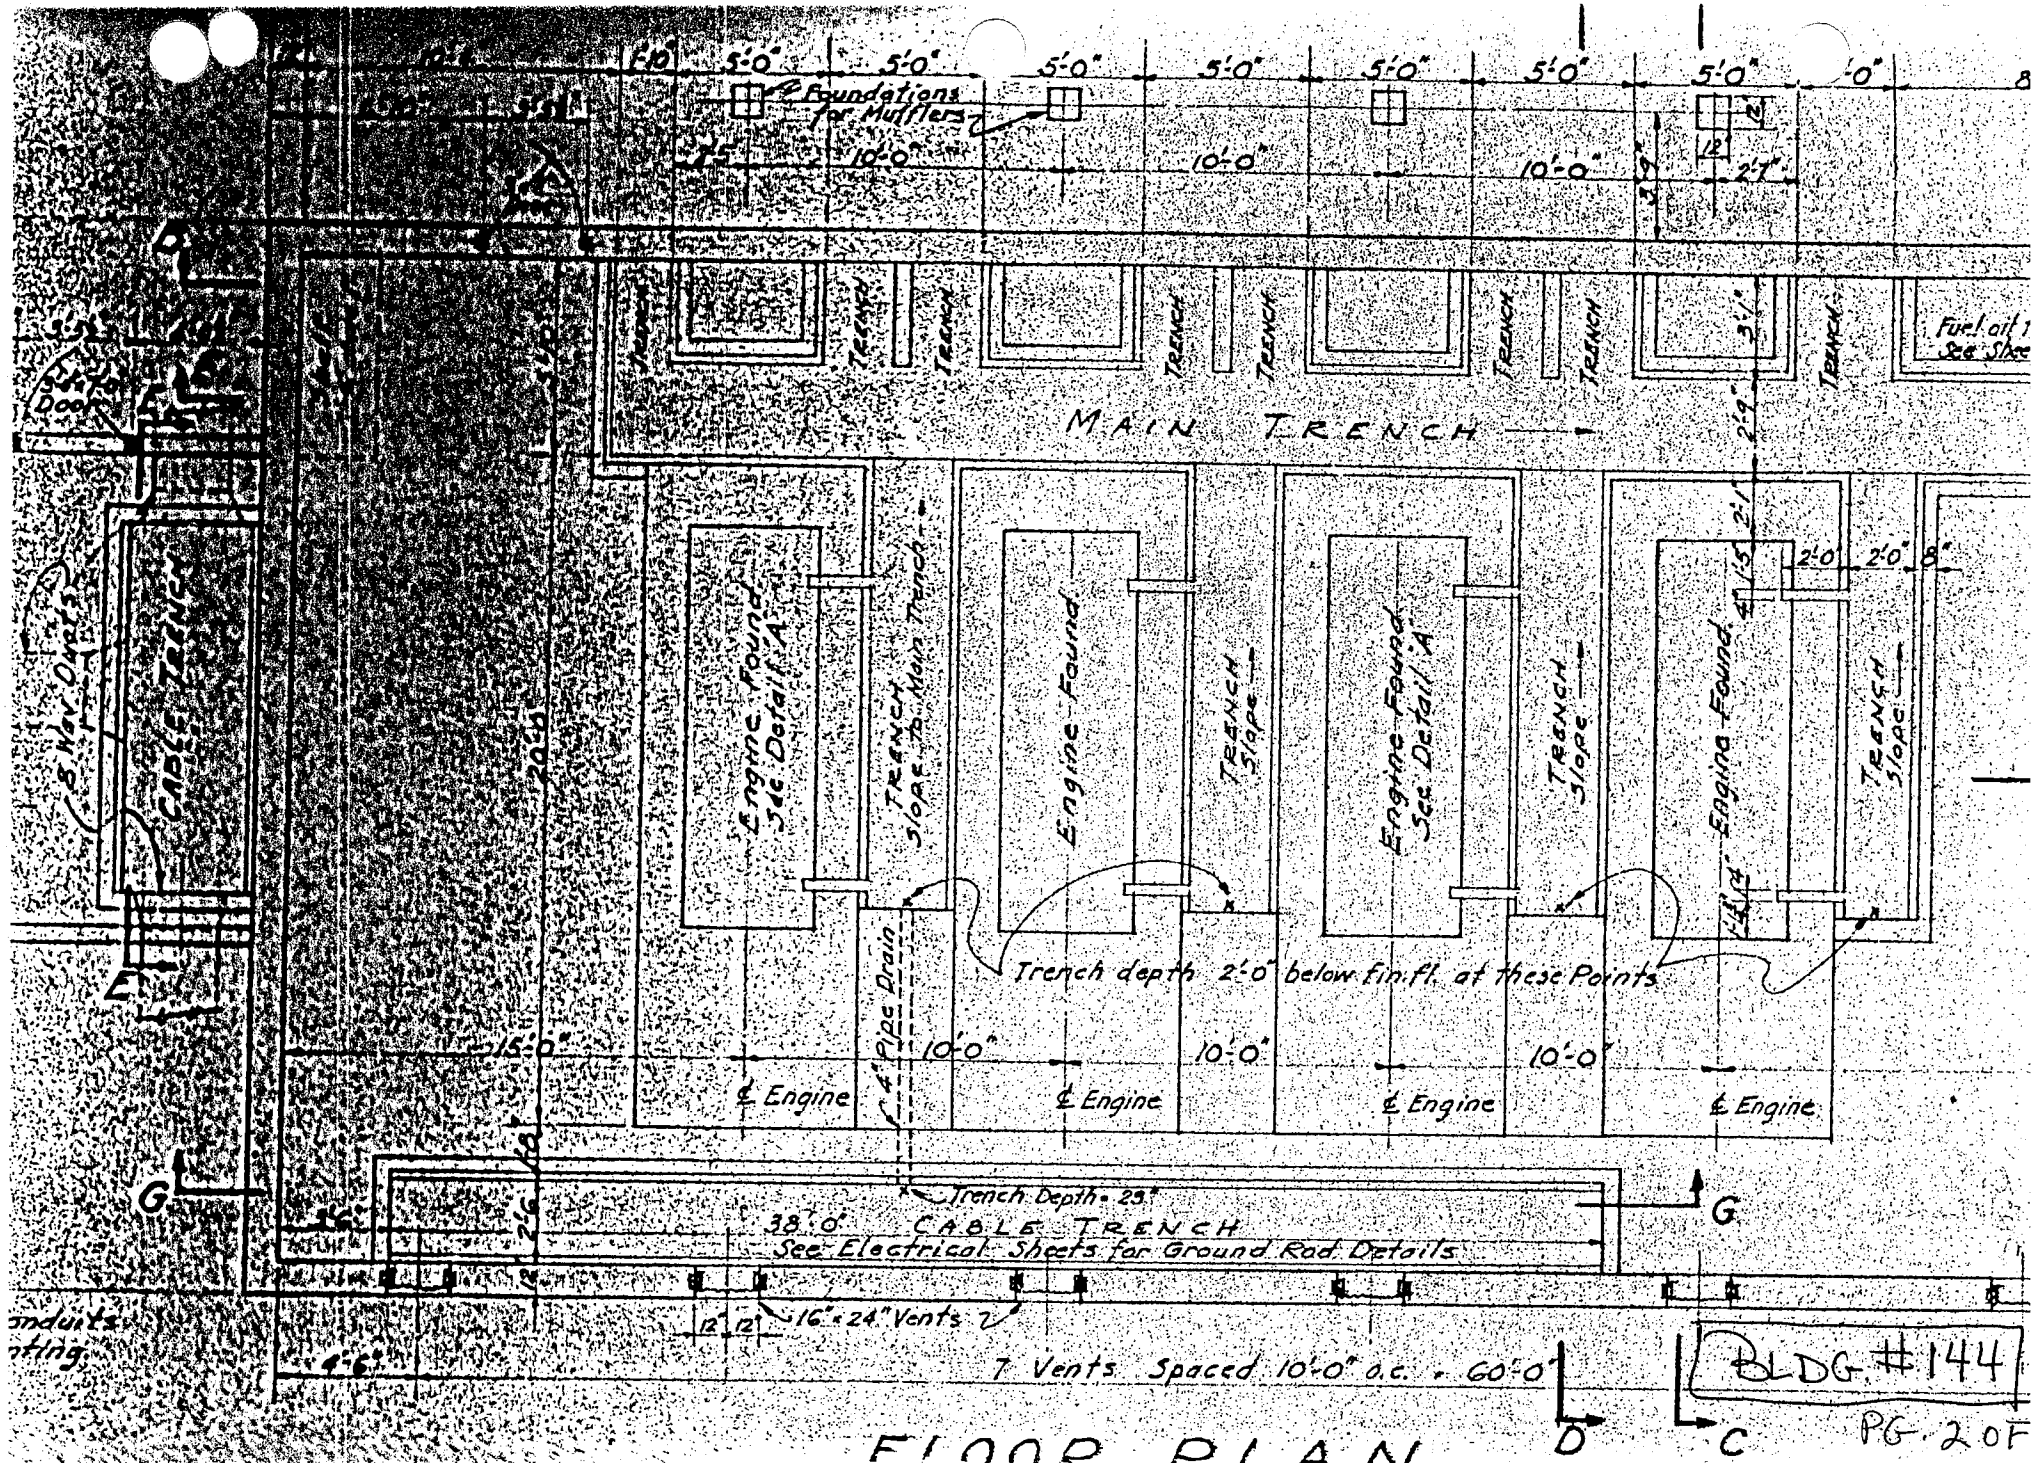

FLOOR PLAN

Scale: 1/4" = 1'-0"

ASBESTOS BULK SAMPLING LOG
NAF MIDWAY

THE SZARAS COMPANIES

 DATE SAMPLES COLLECTED: November 4, 1993

BUILDING NUMBER	BUILDING NAME	BUILDING DESCRIPTION
151	SeaBee Hangar	Hangar
TSC PROJECT NUMBER	**TSC INSPECTOR**	**TSC LABORATORY ID NO.**
865	J. Kain and B. Kain	111693H

SAMPLE ID NO	SAMPLE LOCATION / DESCRIPTION	ANALYTICAL RESULTS	FRIABLE	CONDITION	AMOUNT
A1104-19	Interior Drywall on wall	None detected	Yes	Fair	Unknown
No sample collected	Interior ceiling Same as sample A1102-11, building 8108	None detected	Yes	Fair	55,000 sq. ft.
A1104-20	Interior office Off-white with beige 12" x 12" floor tile	Tite - 1-2% Chrysotile Mastic - 6% Chrysotile	No	Good	1,300 sq. ft.
A1104-21	Interior southeast side Drywall	None detected	Yes	Fair	Unknown
A1104-22	Interior northwest side 6 new rolls of tar paper	None detected	No	Good	6 rolls
A1104-23	Interior on west side of hangar on floor Cloth on exhaust system	70% Chrysotile	Yes	Fair	30 sq. ft.
A1104-24	Interior east side Stucco on lower 4 feet of wall	None detected	No	Good	1,000 sq. ft.
A1104-25	Roof west side Roof core tar and tar paper	None detected	No	Good	55,000 sq. ft.

is assumed that anywhere the above identified asbestos containing building materials are found in the building, that those aterials also contain asbestos and should be treated as such.

LEAD BASED PAINT SAMPLING LOG
NAF MIDWAY

THE SZARAS COMPANIES DATE SAMPLES COLLECTED: November 4, 1993

BUILDING NUMBER	BUILDING NAME	BUILDING DESCRIPTION
151	SeaBee Hangar	Hangar
TSC PROJECT NUMBER	**TSC INSPECTOR**	**TSC LABORATORY ID NO.**
865	J. Kain and B. Kain	111693B

SAMPLE ID NO	SAMPLE LOCATION / DESCRIPTION	ANALYTICAL RESULTS (PPM)	CONDITION	AMOUNT
L1104-29	Exterior south side Dark gray paint on door frame	1,168.3	Good	5,000 sq. ft.
L1104-30	Interior northeast wall Light gray paint on steel beam	4,105.3	Fair	18,600 sq. ft.
L1104-31	Interior northeast wall Gray and white paint on corrugated metal	3,117.6	Fair	8,000 sq. ft.
L1104-32	Interior southeast side Blue paint on ceiling	11.9	Fair	400 sq. ft.
L1104-33	Interior southeast sliding door Blue paint on door	None detected	Poor	150 sq. ft.
L1104-34	Interior southeast White paint on wall	None detected	Fair	3,000 sq. ft.
L1104-35	Interior southeast Peach paint on wall	767.8	Fair	900 sq. ft.
L1104-36	Interior southeast side Peach with blue paint	None detected	Fair	700 sq. ft.
L1104-37	Interior northeast side Beige paint on wall	None detected	Fair	2,300 sq. ft.
L1104-38	Interior northeast side Dark green paint on fence	None detected	Poor	100 sq. ft.
L1104-39	Interior northeast side Black paint on wall	11,420.4	Good	300 sq. ft.
L1104-40	Interior northeast side Red paint on door	None detected	Good	300 sq. ft.
No sample collected	Fire hydrant northeast side Yellow paint on trim - same as sample L1103-37, building 175	21,416.7	Good	400 sq. ft.

It is assumed that anywhere the above identified lead based paint materials are found in the building, that those materials also contain lead and should be treated as such.

LEAD BASED PAINT SAMPLING LOG
NAF MIDWAY

THE SZARAS COMPANIES

 DATE SAMPLES COLLECTED: November 4, 1993

UILDING NUMBER	BUILDING NAME	BUILDING DESCRIPTION
151	SeaBee Hangar	Hangar
TSC PROJECT NUMBER	**TSC INSPECTOR**	**TSC LABORATORY ID NO.**
865	J. Kain and B. Kain	111693B

SAMPLE ID NO	SAMPLE LOCATION / DESCRIPTION	ANALYTICAL RESULTS (PPM)	CONDITION	AMOUNT
L1104-41	Interior northwest side Green paint on wall	2,344.0	Poor	5,000 sq. ft.
L1104-42	Exterior east side Yellow paint on corrugated metal	67,865.8	Poor	20,000 sq. ft.
	2nd floor and roof were unsafe for entry. Therefore, no survey was conducted in these areas.			

It is assumed that anywhere the above identified lead based paint materials are found in the building, that those materials also contain lead and should be treated as such.

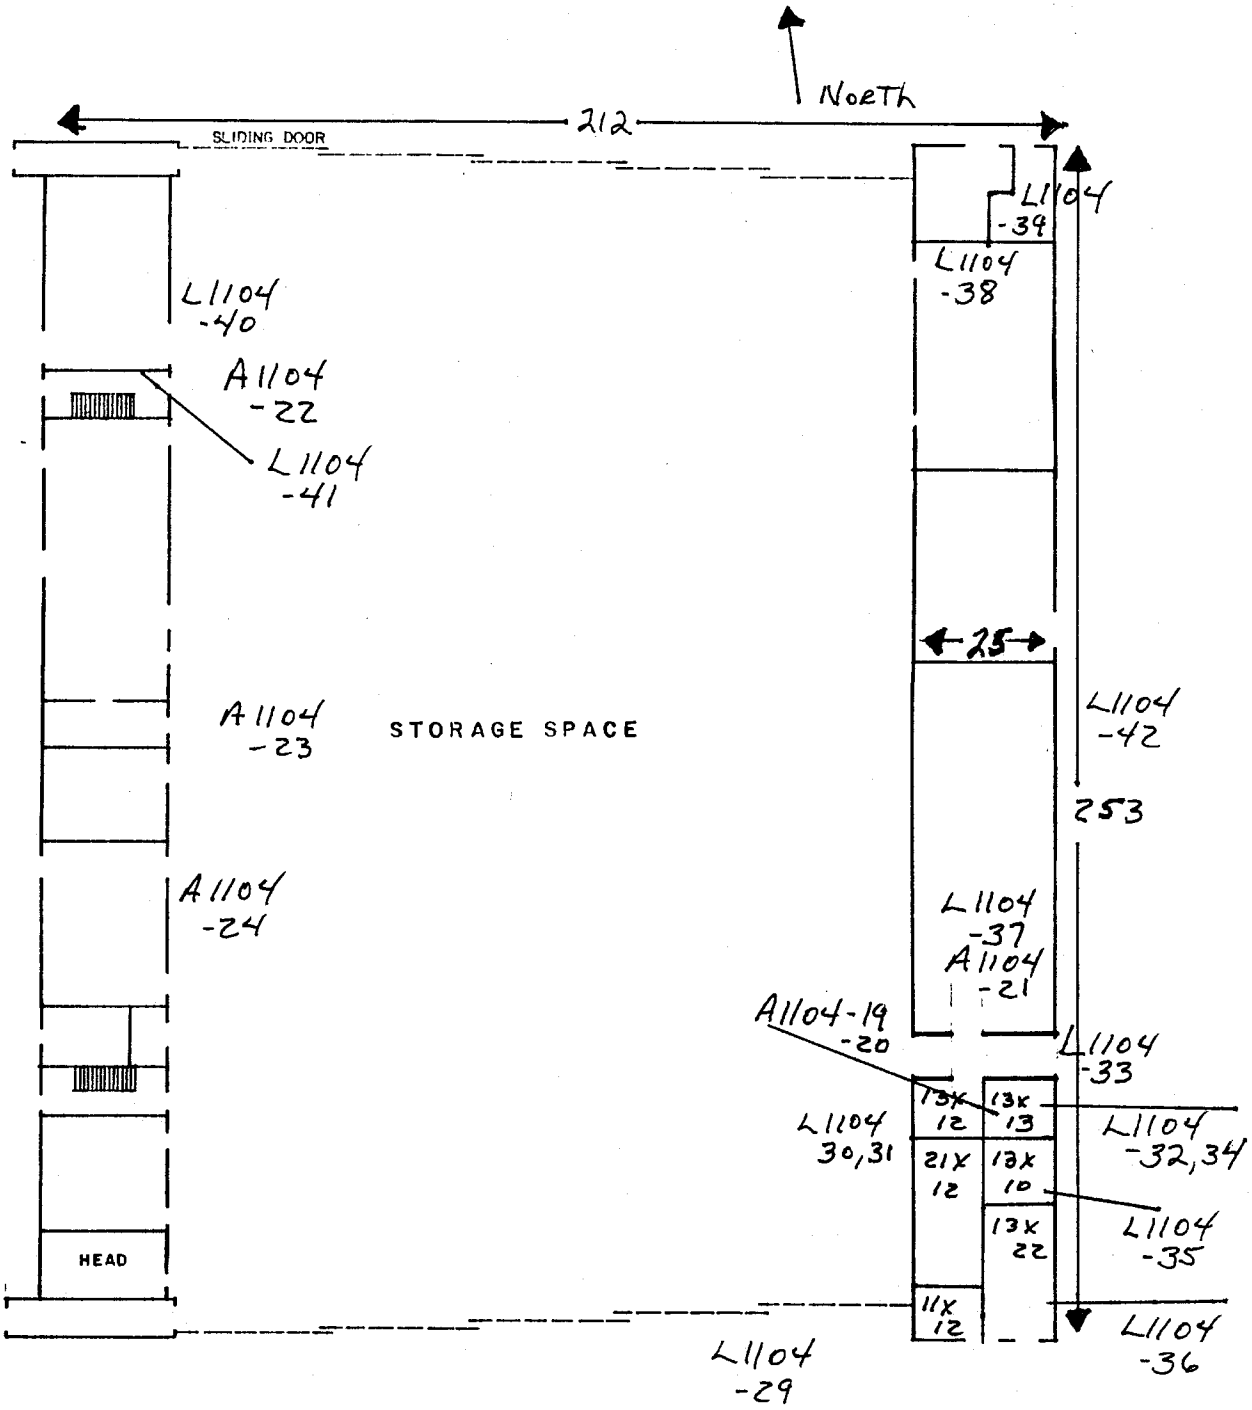

FLOOR PLAN
N T S

PIOUNIQ MANAGEMENT CORPORATION
NAVAL AIR FACILITY- MIDWAY ISLAND

SEA BEE HANGAR, BLDG. NO. 151

HISTORIMOCTOR

PG. 1

Asbestos Bulk Sampling Log
NAF Midway

The Szaras Companies **Page** 1 of 1 **Date Samples Collected:** November 1, 1993

Building Number	Building Name	Building Description
170	Electrical Room	1 Story
TSC Project Number	**TSC Inspector**	**TSC Laboratory ID No.**
865	J. Kain and B. Kain	N/A

Sample ID No	Sample Location / Description	Analytical Results	Friable	Condition	Amount
No sample collected	Roof corrugated Transite paels - same as sample A1027-27, building 5182	45% Chrysotile	No	Good	150 sq. ft.

" is assumed that anywhere the above identified asbestos containing building materials are found in the building, that those aterials also contain asbestos and should be treated as such.

LEAD BASED PAINT SAMPLING LOG
NAF MIDWAY

THE SZARAS COMPANIES

 DATE SAMPLES COLLECTED: November 1, 1993

BUILDING NUMBER	BUILDING NAME	BUILDING DESCRIPTION
170	Electrical Room	1 Story
TSC PROJECT NUMBER	**TSC INSPECTOR**	**TSC LABORATORY ID NO.**
865	J. Kain and B. Kain	110893M

SAMPLE ID NO	SAMPLE LOCATION / DESCRIPTION	ANALYTICAL RESULTS (PPM)	CONDITION	AMOUNT
L1101-12	Exterior north side Beige paint on block wall	187.2	Fair	450 sq. ft.
L1101-13	Exterior north side Brown with green (below) paint on door	15,119.1	Fair	150 sq. ft.
L1101-14	Interior center of room Gray paint on voltage box	37,372.4	Good	25 sq. ft.

assumed that anywhere the above identified lead based paint materials are found in the building, that those materials also contain lead and should be treated as such.

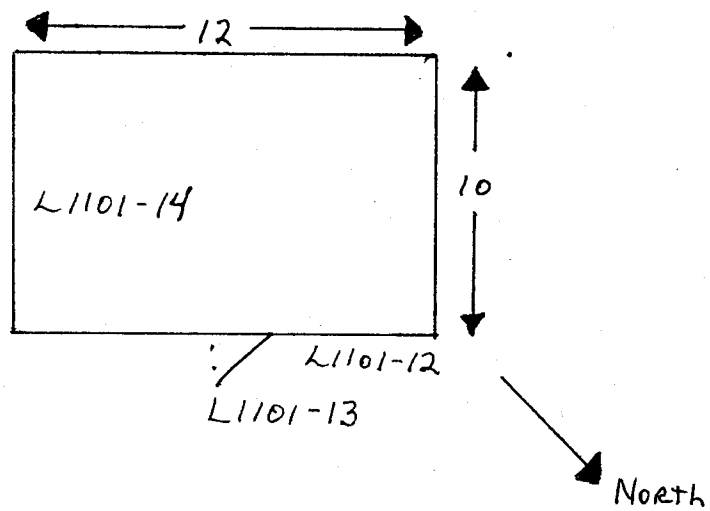

Bld. # 170

Electrical Room

ASBESTOS BULK SAMPLING LOG
NAF MIDWAY

THE SZARAS COMPANIES

 DATE SAMPLES COLLECTED: November 1, 1993

BUILDING NUMBER	BUILDING NAME	BUILDING DESCRIPTION
173	Concrete Slab	Concrete Slab
TSC PROJECT NUMBER	**TSC INSPECTOR**	**TSC LABORATORY ID NO.**
865	J. Kain and B. Kain	110893N

SAMPLE ID NO	SAMPLE LOCATION / DESCRIPTION	ANALYTICAL RESULTS	FRIABLE	CONDITION	AMOUNT
A1101-9	Exterior south side Green 3 layer thick 9" x 9" floor tile	Black tile: Tile - 5% Chrysotile Mastic- 6% Chrysotile Red tile: Tile - 4% Chrysotile Mastic-None detected Green tile: Tile - 8% Chrysotile Mastic-None detected			

" is assumed that anywhere the above identified asbestos containing building materials are found in the building, that those .aterials also contain asbestos and should be treated as such.

LEAD BASED PAINT SAMPLING LOG
NAF MIDWAY

THE SZARAS COMPANIES

DATE SAMPLES COLLECTED: November 1, 1993

BUILDING NUMBER	BUILDING NAME	BUILDING DESCRIPTION
173	Concrete Slab	Concrete Slab
TSC PROJECT NUMBER	**TSC INSPECTOR**	**TSC LABORATORY ID NO.**
865	J. Kain and B. Kain	110893M

SAMPLE ID NO	SAMPLE LOCATION / DESCRIPTION	ANALYTICAL RESULTS (PPM)	CONDITION	AMOUNT
L1101-15	Exterior south side Red paint on concrete	1,872.7	Poor	2,640 sq. ft.

is assumed that anywhere the above identified lead based paint materials are found in the building, that those materials ɔ contain lead and should be treated as such.

Asbestos Bulk Sampling Log
NAF Midway

THE SZARAS COMPANIES PAGE 1 of 1 **DATE SAMPLES COLLECTED:** November 3, 1993

Building Number	Building Name	Building Description
174	Harbor Storage	Quonset Hut
TSC Project Number	**TSC Inspector**	**TSC Laboratory ID No.**
865	J. Kain and B. Kain	111693A

Sample ID No	Sample Location / Description	Analytical Results	Friable	Condition	Amount
A1103-9	Interior southwest room Green with white 12" x 12" floor tile	None detected	No	Poor	160 sq. ft.
A1103-10	Interior southwest room 12" x 12" ceiling tile and mastic	None detected	Yes	Poor	160 sq. ft.
A1103-11	Interior southwest room Drywall	None detected	Yes	Poor	600 sq. ft.
A1103-12	Interior northeast side Green 9" x 9" floor tile	Tile - 1-2% Chrysotile Mastic - 8% Chrysotile	No	Good	250 sq. ft.

is assumed that anywhere the above identified asbestos containing building materials are found in the building, that those erials also contain asbestos and should be treated as such.

LEAD BASED PAINT SAMPLING LOG
NAF MIDWAY

THE SZARAS COMPANIES

 DATE SAMPLES COLLECTED: November 3, 1993

BUILDING NUMBER	BUILDING NAME	BUILDING DESCRIPTION
174	Harbor Storage	Quonset Hut
TSC PROJECT NUMBER	**TSC INSPECTOR**	**TSC LABORATORY ID NO.**
865	J. Kain and B. Kain	111593K

SAMPLE ID NO	SAMPLE LOCATION / DESCRIPTION	ANALYTICAL RESULTS (PPM)	CONDITION	AMOUNT
L1103-23	Interior west wall in office White paint	2,13537	Poor	800 sq. ft.
L1103-24	Interior south side Gray over red deck paint	2,661.0	Poor	4,100 sq. ft.
L1103-25	Interior on outside wall White Paint	3,928.1	Poor	3,000 sq. ft.
L1103-26	Interior west side Gray paint on tool cabinet	1,167.7	Fair	250 sq. ft.
No sample collected	Exterior Brown paint on door - same as sample L1103-19, building 189	33,125.0	Poor	150 sq. ft.
1103-27	Exterior northeast side Peach paint on metal	4,906.3	Poor	3,000 sq. ft.

's assumed that anywhere the above identified lead based paint materials are found in the building, that those materials) contain lead and should be treated as such.

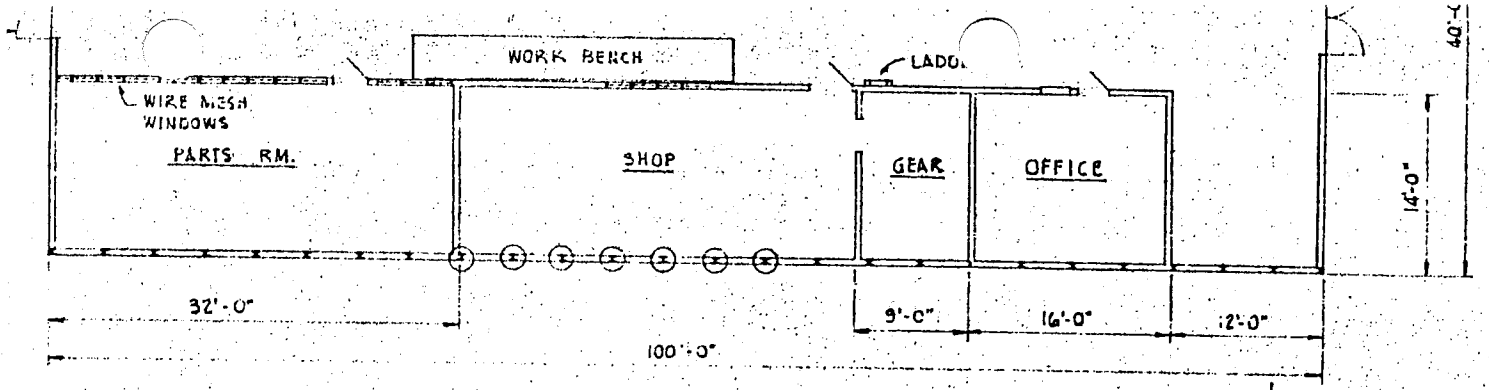

FLOOR PLAN - BLDG. 173
SCALE: 1/8" = 1'-0"

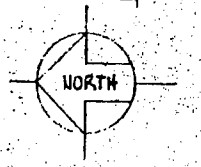

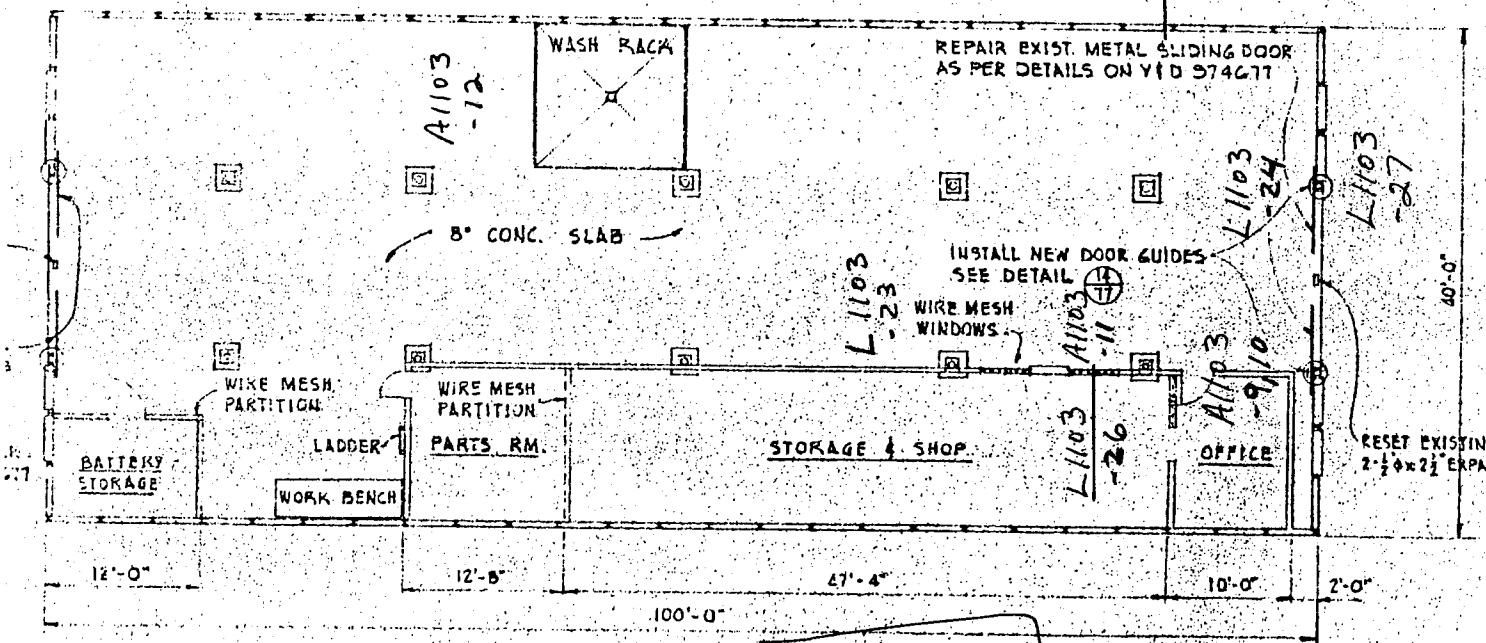

FLOOR PLAN - BLDG. 174
SCALE: 1/8" = 1'-0"

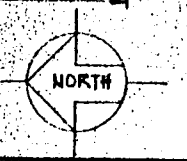

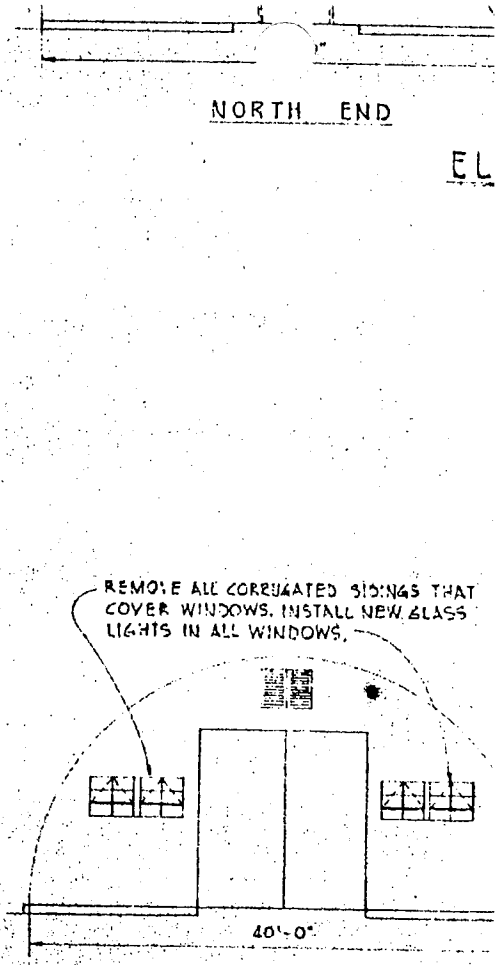

NOTE: PI

SYMBOL

1/77 — DETAIL OR SECTION DESIGNATION
LAST TWO DIGITS OF Y&D DWG. NO. ON WHICH DETAIL OR SECTION IS DRAWN

(I) BASE OF RIB OR STUD TO BE REPLACED.

Asbestos Bulk Sampling Log
NAF Midway

THE SZARAS COMPANIES

DATE SAMPLES COLLECTED: November 3,1993

Building Number	Building Name	Building Description
175	Paint Locker	1 Story
TSC Project Number	**TSC Inspector**	**TSC Laboratory ID No.**
865	J. Kain and B. Kain	111693A

Sample ID No	Sample Location / Description	Analytical Results	Friable	Condition	Amount
A1103-17	Roof Corrugated tar paper	None detected	No	Good	100 sq. ft.

It is assumed that anywhere the above identified asbestos containing building materials are found in the building, that those aterials also contain asbestos and should be treated as such.

LEAD BASED PAINT SAMPLING LOG
NAF MIDWAY

THE SZARAS COMPANIES

 DATE SAMPLES COLLECTED: November 3, 1993

BUILDING NUMBER	BUILDING NAME	BUILDING DESCRIPTION
175	Paint Locker	1 Story
TSC PROJECT NUMBER	**TSC INSPECTOR**	**TSC LABORATORY ID NO.**
865	J. Kain and B. Kain	111593K

SAMPLE ID NO	SAMPLE LOCATION / DESCRIPTION	ANALYTICAL RESULTS (PPM)	CONDITION	AMOUNT
L1103-37	Exterior east side Yellow paint on wall	21,416.7	Poor	150 sq. ft.

is assumed that anywhere the above identified lead based paint materials are found in the building, that those materials contain lead and should be treated as such.

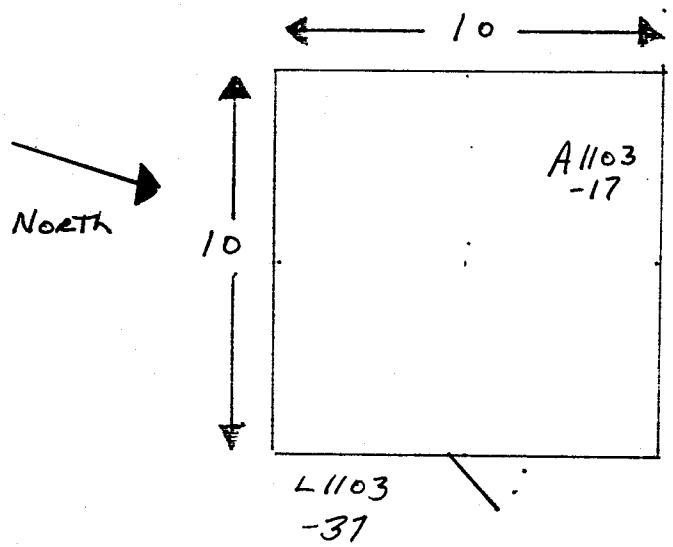

Bld #175

PAINT LOCKER

Asbestos Bulk Sampling Log
NAF Midway

THE SZARAS COMPANIES

 DATE SAMPLES COLLECTED: November 3, 1993

Building Number	Building Name	Building Description
180	Electrical Sub-Station	1 Story
TSC Project Number	**TSC Inspector**	**TSC Laboratory ID No.**
865	J. Kain and B. Kain	N/A

Sample ID No	Sample Location / Description	Analytical Results	Friable	Condition	Amount
No sample collected	Roof Corrugated transite panels Same as sample A1029-3, building S225	60% Chrysotile	No	Good	450 sq. ft.

is assumed that anywhere the above identified asbestos containing building materials are found in the building, that those erials also contain asbestos and should be treated as such.

Lead Based Paint Sampling Log
NAF Midway

THE SZARAS COMPANIES

DATE SAMPLES COLLECTED: November 3, 1993

BUILDING NUMBER	BUILDING NAME	BUILDING DESCRIPTION
180	Electrical Sub-Station	1 Story
TSC PROJECT NUMBER	**TSC INSPECTOR**	**TSC LABORATORY ID NO.**
865	J. Kain and B. Kain	111593K

SAMPLE ID NO	SAMPLE LOCATION / DESCRIPTION	ANALYTICAL RESULTS (PPM)	CONDITION	AMOUNT
No sample collected	No paint on interior walls or ceiling	N/A		
No sample collected	Interior beam Green paint, 6 beams - same as sample L1103-2, building 5361	4,445.2	Fair	150 lin. ft. of beams
No sample collected	Interior voltage box Gray paint - same as sample L1102-16, building 400	471.5	Good	100 sq. ft.
No sample collected	Exterior block Peach paint - same as sample L1103-27, building 174	4,906.3	Fair	900 sq. ft.

is assumed that anywhere the above identified lead based paint materials are found in the building, that those materials contain lead and should be treated as such.

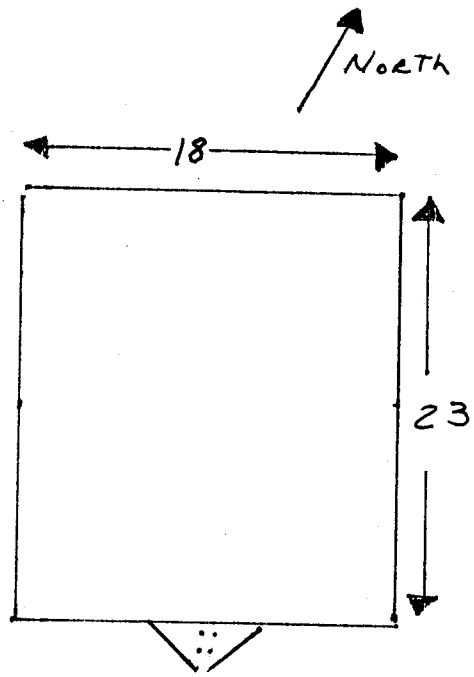

Bld # 180

Electrical
Sub Sta.

Asbestos Bulk Sampling Log
NAF Midway

THE SZARAS COMPANIES

 DATE SAMPLES COLLECTED: November 14, 1993

UILDING NUMBER	BUILDING NAME	BUILDING DESCRIPTION
181	Public Toilet	1 Story
TSC PROJECT NUMBER	**TSC INSPECTOR**	**TSC LABORATORY ID NO.**
865	J. Kain and B. Kain	N/A

SAMPLE ID NO	SAMPLE LOCATION / DESCRIPTION	ANALYTICAL RESULTS	FRIABLE	CONDITION	AMOUNT
No sample collected	Fiberglass roof No suspect ACM	N/A			

" is assumed that anywhere the above identified asbestos containing building materials are found in the building, that those .aterials also contain asbestos and should be treated as such.

LEAD BASED PAINT SAMPLING LOG
NAF MIDWAY

THE SZARAS COMPANIES

 DATE SAMPLES COLLECTED: November 14, 1993

BUILDING NUMBER	BUILDING NAME	BUILDING DESCRIPTION
181	Public Toilet	1 Story
TSC PROJECT NUMBER	**TSC INSPECTOR**	**TSC LABORATORY ID NO.**
865	J. Kain and B. Kain	112393F

SAMPLE ID NO	SAMPLE LOCATION / DESCRIPTION	ANALYTICAL RESULTS (PPM)	CONDITION	AMOUNT
	EXTERIOR:			
L1114-9	Men's restroom north side Red paint on floor	200.0	Fair	350 sq. ft.
L1114-10	East wall Off-white paint	476.0	Good	1,400 sq. ft. Inside and outside
L1114-11	East side of men's restroom Brown paint on door	90.1	Fair	125 sq. ft.
L1114-12	East side of pipe chase room Blue paint on door	7,368.7	Poor	75 sq. ft.

is assumed that anywhere the above identified lead based paint materials are found in the building, that those materials) contain lead and should be treated as such.

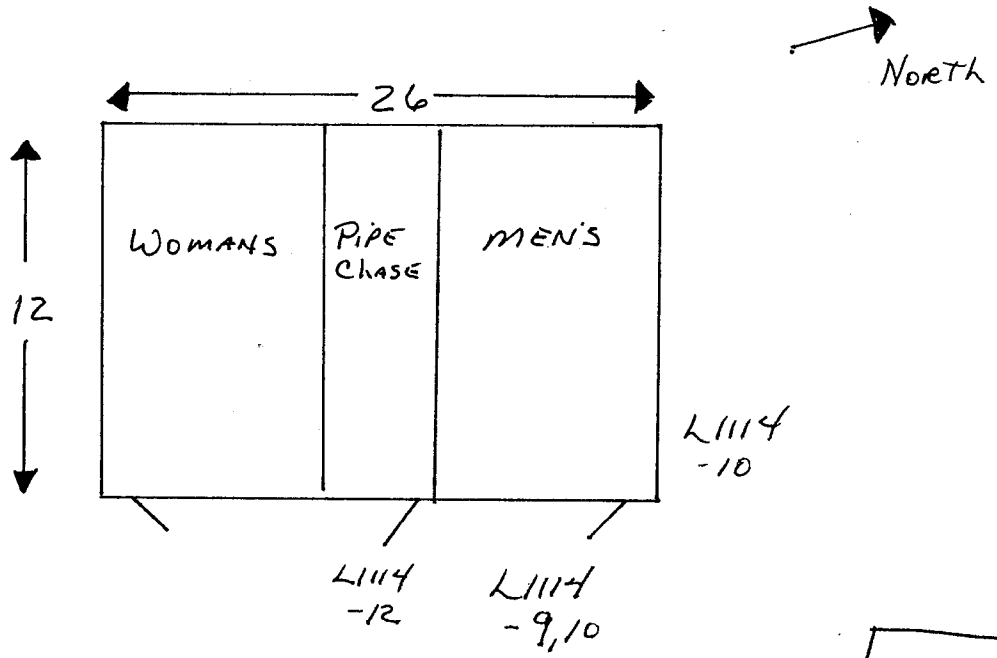

Bld # 181

Public Toilet

Asbestos Bulk Sampling Log
NAF Midway

THE SZARAS COMPANIES

 DATE SAMPLES COLLECTED: November 3, 1993

Building Number	Building Name	Building Description
189	Public Toilet	1 Story
TSC Project Number	**TSC Inspector**	**TSC Laboratory ID No.**
865	J. Kain and B. Kain	111693A

Sample ID No	Sample Location / Description	Analytical Results	Friable	Condition	Amount
A1103-8	Roof south corner Roof core	Chrysotile: None detected Amosite: None detected 45% Tremolite	No	Poor	225 sq. ft.

assumed that anywhere the above identified asbestos containing building materials are found in the building, that those erials also contain asbestos and should be treated as such.

LEAD BASED PAINT SAMPLING LOG
NAF MIDWAY

THE SZARAS COMPANIES

 DATE SAMPLES COLLECTED: November 3, 1993

BUILDING NUMBER	BUILDING NAME	BUILDING DESCRIPTION
189	Public Toilet	1 Story
TSC PROJECT NUMBER	**TSC INSPECTOR**	**TSC LABORATORY ID NO.**
865	J. Kain and B. Kain	111593K

SAMPLE ID NO	SAMPLE LOCATION / DESCRIPTION	ANALYTICAL RESULTS (PPM)	CONDITION	AMOUNT
L1103-18	Exterior south side Off-white paint on wood wall	13,578.9	Poor	700 sq. ft.
L1103-19	Exterior south side Brown paint on door and trim	33,125.0	Poor	150 sq. ft.
L1103-20	Exterior south side Red deck paint on sidewalk	31,875.0	Poor	100 sq. ft.
L1103-21	Interior south side Gray deck paint	4,822.6	Poor	225 sq. ft.
L1103-22	Interior west wall White paint on wall	21,760.2	Poor	800 sq. ft.

. is assumed that anywhere the above identified lead based paint materials are found in the building, that those materials ɔ contain lead and should be treated as such.

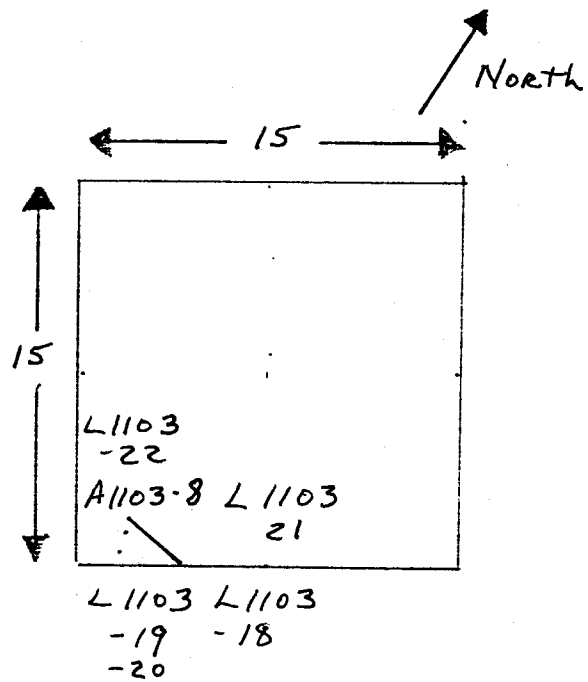

Bld #189

HEAD

ASBESTOS BULK SAMPLING LOG
NAF MIDWAY

THE SZARAS COMPANIES

DATE SAMPLES COLLECTED: November 3, 1993

BUILDING NUMBER	BUILDING NAME	BUILDING DESCRIPTION
200	Electrical Sub-Station	1 Story
TSC PROJECT NUMBER	**TSC INSPECTOR**	**TSC LABORATORY ID NO.**
865	J. Kain and B. Kain	N/A

SAMPLE ID NO	SAMPLE LOCATION / DESCRIPTION	ANALYTICAL RESULTS	FRIABLE	CONDITION	AMOUNT
No sample collected	Roof Transite panel Same as sample A1029-3, building S225	60% Chrysotile	No	Fair	375 sq. ft.

is assumed that anywhere the above identified asbestos containing building materials are found in the building, that those terials also contain asbestos and should be treated as such.

LEAD BASED PAINT SAMPLING LOG
NAF MIDWAY

THE SZARAS COMPANIES

DATE SAMPLES COLLECTED: November 3, 1993

BUILDING NUMBER	BUILDING NAME	BUILDING DESCRIPTION
200	Electrical Sub-Station	1 Story
TSC PROJECT NUMBER	**TSC INSPECTOR**	**TSC LABORATORY ID NO.**
865	J. Kain and B. Kain	111593K

SAMPLE ID NO	SAMPLE LOCATION / DESCRIPTION	ANALYTICAL RESULTS (PPM)	CONDITION	AMOUNT
No sample collected	No paint on interior walls or ceiling	N/A		
L1103-11	Exterior west side Brown paint on door	11,898.7	Good	125 sq. ft.
No sample collected	Interior voltage boxes Gray paint - same as sample L1102-16, building 400	471.5	Good	200 sq. ft.
L1103-12	Exterior north corner White paint on block wall	105.5	Good	800 sq. ft.

. is assumed that anywhere the above identified lead based paint materials are found in the building, that those materials o contain lead and should be treated as such.

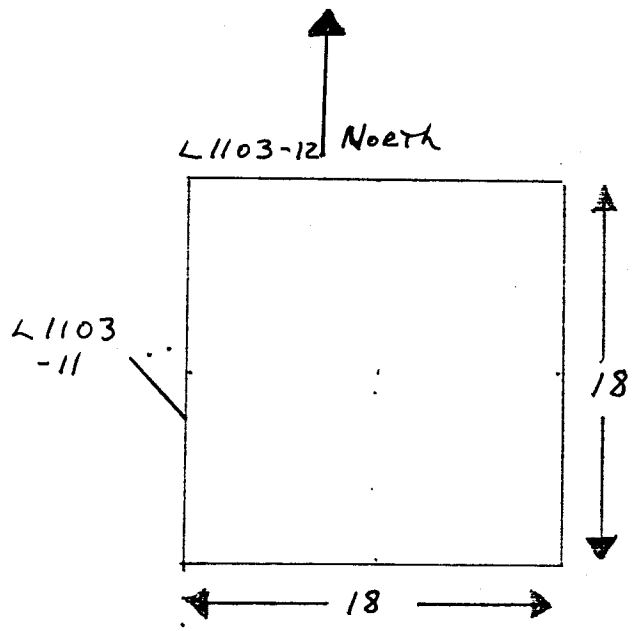

Bld 200
Electrical
Sub STA

ASBESTOS BULK SAMPLING LOG
NAF MIDWAY

THE SZARAS COMPANIES | PAGE 1 of 1 | DATE SAMPLES COLLECTED: October 29, 1993

BUILDING NUMBER	BUILDING NAME	BUILDING DESCRIPTION
232	Fuel Storage Tin Shed	1 Story
TSC PROJECT NUMBER	**TSC INSPECTOR**	**TSC LABORATORY ID NO.**
865	J. Kain and B. Kain	N/A

SAMPLE ID NO	SAMPLE LOCATION / DESCRIPTION	ANALYTICAL RESULTS	FRIABLE	CONDITION	AMOUNT
No sample collected	No suspect ACM	N/A			

" is assumed that anywhere the above identified asbestos containing building materials are found in the building, that those aterials also contain asbestos and should be treated as such.

Lead Based Paint Sampling Log
NAF Midway

The Szaras Companies **Page** 1 of 1 **Date Samples Collected:** October 29, 1993

Building Number	Building Name	Building Description
232	Fuel Storage Tin Shed	1 Story
TSC Project Number	**TSC Inspector**	**TSC Laboratory ID No.**
865	J. Kain and B. Kain	110893M

Sample ID No	Sample Location / Description	Analytical Results (ppm)	Condition	Amount
L1029-16	Exterior north end Yellow paint on tin	16,542.5	Poor	3,000 sq. ft.
L1029-17	Interior east side White paint on tin	1,291.7	Poor	3,000 sq. ft.
L1029-18	Exterior roof Green paint	1,583.7	Poor	2,000 sq. ft.

is assumed that anywhere the above identified lead based paint materials are found in the building, that those materials o contain lead and should be treated as such.

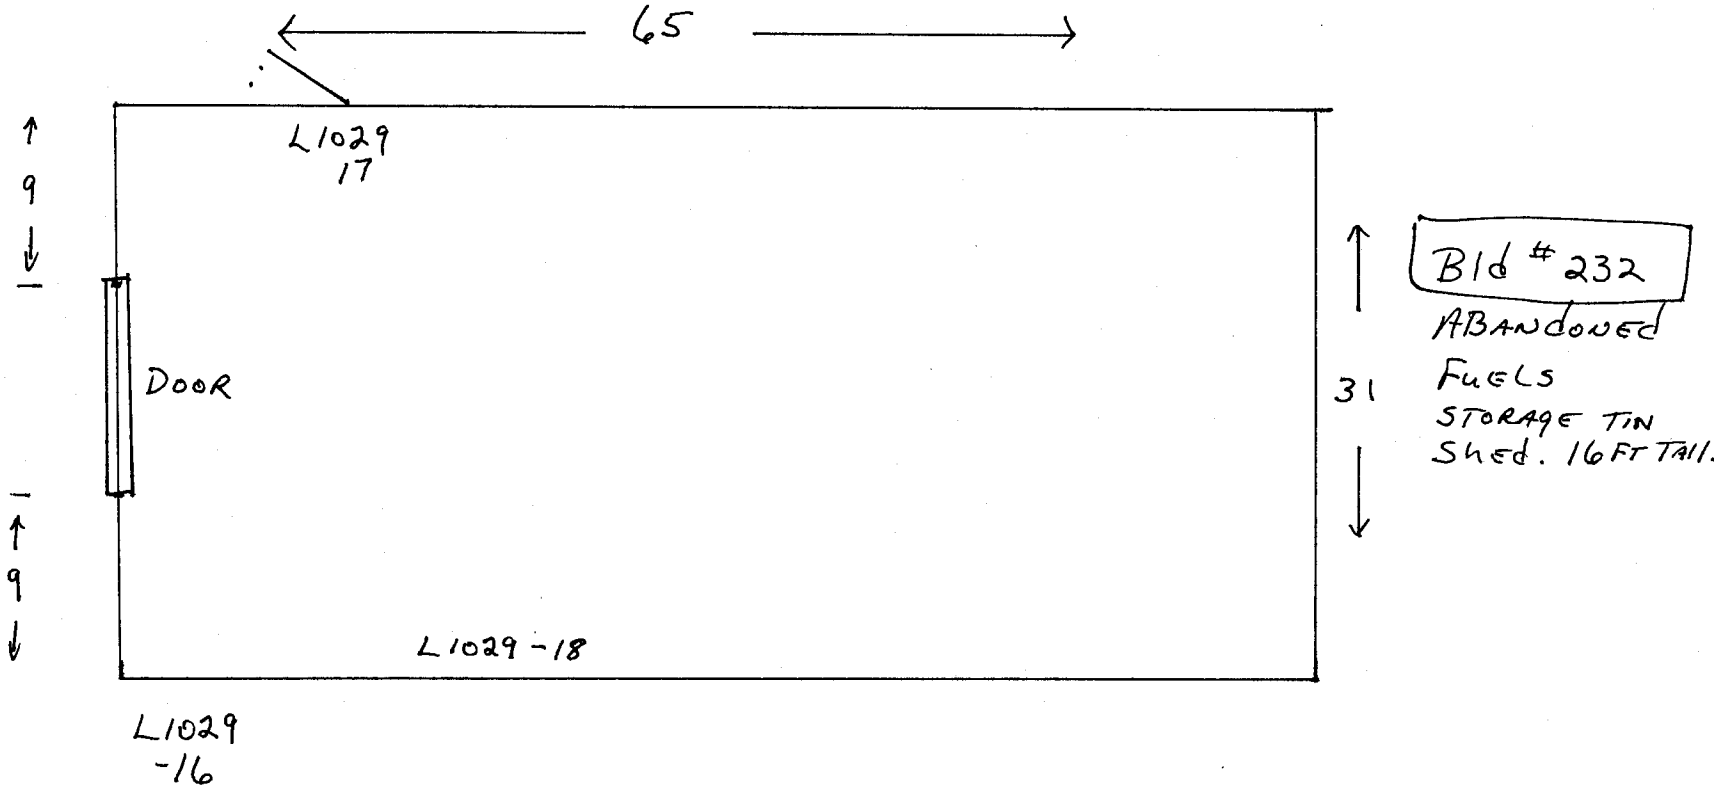
65
L1029
17
9
DOOR
9
31
L1029 -18
L1029
-16
Bld # 232
ABANDONED
FUELS
STORAGE TIN
Shed. 16 FT TALL.

N ←

Asbestos Bulk Sampling Log
NAF Midway

THE SZARAS COMPANIES

DATE SAMPLES COLLECTED: October 29, 1993

UILDING NUMBER	BUILDING NAME	BUILDING DESCRIPTION
233	Fuel Storage Tin Shed	1 Story
TSC PROJECT NUMBER	**TSC INSPECTOR**	**TSC LABORATORY ID NO.**
865	J. Kain and B. Kain	110893N

SAMPLE ID NO	SAMPLE LOCATION / DESCRIPTION	ANALYTICAL RESULTS	FRIABLE	CONDITION	AMOUNT
A1029-7	Interior and exterior roof Black tar on joints of roof for sealing	5% Chrysotile	No	Good	500 sq. ft.

" is assumed that anywhere the above identified asbestos containing building materials are found in the building, that those aterials also contain asbestos and should be treated as such.

LEAD BASED PAINT SAMPLING LOG
NAF MIDWAY

THE SZARAS COMPANIES | PAGE 1 of 1 | DATE SAMPLES COLLECTED: October 29, 1993

BUILDING NUMBER	BUILDING NAME	BUILDING DESCRIPTION
233	Fuel Storage Tin Shed	1 Story
TSC PROJECT NUMBER	**TSC INSPECTOR**	**TSC LABORATORY ID NO.**
865	J. Kain and B. Kain	N/A

SAMPLE ID NO	SAMPLE LOCATION / DESCRIPTION	ANALYTICAL RESULTS (PPM)	CONDITION	AMOUNT
No sample collected	Shed not painted	N/A		

is assumed that anywhere the above identified lead based paint materials are found in the building, that those materials contain lead and should be treated as such.

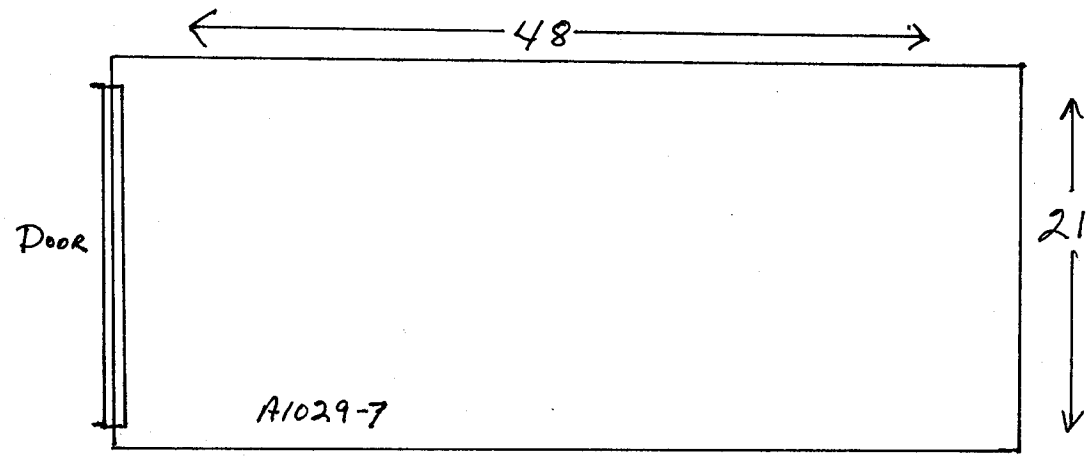

Bld 233

Fuels Storage Tin Shed

12 Ft High Corrogated Tin

ASBESTOS BULK SAMPLING LOG
NAF MIDWAY

THE SZARAS COMPANIES DATE SAMPLES COLLECTED: November 12 & 15,, 1993

BUILDING NUMBER	BUILDING NAME	BUILDING DESCRIPTION
259	Midway Mall	2 Story
TSC PROJECT NUMBER	**TSC INSPECTOR**	**TSC LABORATORY ID NO.**
865	J. Kain and B. Kain	112293J and 112393M

SAMPLE ID NO	SAMPLE LOCATION / DESCRIPTION	ANALYTICAL RESULTS	FRIABLE	CONDITION	AMOUNT
	INTERIOR OF BUILDING SPACES **THEATER:**				
A1112-27	Stage northeast side Black soft tar	None detected	No	Fair	300 sq. ft.
A1112-28	Projection room west wall Transite panels, 4" x 8"	45% Chrysotile	No	Fair	250 sq. ft.
A1112-29	Projection room west side White with gray streaks 9" x 9" floor tile	None detected	No	Fair	250 sq. ft. mixed with A1112-30
A1112-30	Projection room west side Green with white streaks 9" x 9" floor tile	Tile - 4% Chrysotile Mastic - None detected	No	Fair	Mixed with A1112-29
A1112-31	Projection room north wall Drywall and compound	None detected	No	Fair	600 sq. ft.
A1112-32	Lobby, top layer Brown with orange and white streaks 9" x 9" floor tile	Tile - 1-2% Chrysotile Mastic - 10% Chrysotile	No	Fair	1,100 sq. ft. mixed with A1112-33 and 34
A1112-33	Lobby, 2nd layer Green with white streaks 9" x 9" floor tile	Tile - 12% Chrysotile Mastic - 6% Chrysotile	No	Fair	Mixed with A1112-32 and 34
A1112-34	Lobby, 2rd layer Burnt orange floor tile	Tile - 8% Chrysotile Mastic - 1% Chrysotile	No	Fair	Mixed with A1112-32 and 33
A1112-35	Storage room near men's restroom Black tar paper, new rolls	None detected	No	Good	4 new rolls
	BARBER SHOP:				
A1112-36	Dark brown with white and brown flecks 12" x 12" floor tile	Tile - 8% Chrysotile Mastic - 6% Chrysotile	No	Good	200 sq. ft.
A1112-37	Beige with gray flecks 12" x 12" floor tile	Tile - 4% Chrysotile Mastic - 3% Chrysotile	No	Good	450 sq. ft.

is assumed that anywhere the above identified asbestos containing building materials are found in the building, that those erials also contain asbestos and should be treated as such.

ASBESTOS BULK SAMPLING LOG
NAF MIDWAY

THE SZARAS COMPANIES DATE SAMPLES COLLECTED: November 12 & 15, 1993

BUILDING NUMBER	BUILDING NAME	BUILDING DESCRIPTION
259	Midway Mall	2 Story
TSC PROJECT NUMBER	**TSC INSPECTOR**	**TSC LABORATORY ID NO.**
865	J. Kain and B. Kain	112293J and 112393M

SAMPLE ID NO	SAMPLE LOCATION / DESCRIPTION	ANALYTICAL RESULTS	FRIABLE	CONDITION	AMOUNT
	BOWLING ALLEY:				
A1112-38	Brown shades of flecks 12" x 12" floor tile	Tile - 1% Chrysotile Mastic - 4% Chrysotile	No	Fair	3,000 sq. ft.
A1112-39	Dry wall	None detected	Yes	Fair	6,500 sq. ft.
	TAILOR SHOP:				
A1112-40	Red with black flecks 9" x 9" floor tile	Tile - 8% Chrysotile Mastic - 1% Chrysotile	No	Fair	50 sq. ft.
A1112-41	Off-white with gray flecks 12" x 12" floor tile	Tile - 10% Chrysotile Mastic - 15% Chrysotile	No	Good	250 sq. ft.
	FISH AND WILD LIFE MUSEUM:				
A1115-18	West side Off-white with gray dents - 2 top layers 12" x 12" floor tile	Tile - None detected Mastic - 4% Chrysotile	No	Good	800 sq. ft.
A1115-19	Storage room by door Gray with white streaks 9" x 9" floor tile	5% Chrysotile	No	Good	50 sq. ft. mixed with A1115-20 and 21
A1115-20	Storage room by door Red with black and off-white streaks 9" x 9" floor tile	6% Chrysotile	No	Good	Mixed with A1115-19 and 21
A1115-21	Storage room by door Burnt orange with yellow and black streaks: 9" x 9" floor tile	Tile - 2% Chrysotile Msatic - 4% Chrysotile	No	Good	Mixed with A1115-19 and 20
A1115-22	Restroom south side Green with white and green streaks 9" x 9" floor tile	8% Chrysotile	No	Fair	100 sq. ft.

assumed that anywhere the above identified asbestos containing building materials are found in the building, that those erials also contain asbestos and should be treated as such.

ASBESTOS BULK SAMPLING LOG
NAF MIDWAY

THE SZARAS COMPANIES DATE SAMPLES COLLECTED: November 12 & 15, 1993

BUILDING NUMBER	BUILDING NAME	BUILDING DESCRIPTION
259	Midway Mall	2 Story
TSC PROJECT NUMBER	**TSC INSPECTOR**	**TSC LABORATORY ID NO.**
865	J. Kain and B. Kain	112293J and 112393M

SAMPLE ID NO	SAMPLE LOCATION / DESCRIPTION	ANALYTICAL RESULTS	FRIABLE	CONDITION	AMOUNT
	SHIPS STORE:				
A1115-23	North side Mustard color with brown flecks 12" x 12" floor tile	None detected	No	Fair	6,500 sq. ft. mixed with A1115-24 and 25
A1115-24	North side Yellow with white and gold flecks 12" x 12" floor tile	Yellow tile - 1% Chrysotile Mastic - None detected Gray tile - None detected	No	Fair	Mixed with A1115-23 and 25
A1115-25	Beer and soda room west side White with gold flecks 12" x 12" floor tile	8% Chrysotile	No	Fair	Mixed with A1115-23 and 24
A1115-26	Office west side Light brown with dark brown and beige flecks: 9" x 9" floor tile	Tile - 10% Chrysotile Mastic - 1-2% Chrysotile	No	Fair	400 sq. ft.
A1115-29	Storage room north side of air handler 6" pipe elbow insulation (pipes behind walls)	3% Chrysotile	Yes	Good	36 elbows
A1115-30	Storage room White 12" x 12" ceiling tile and glue	None detected	Yes	Good	8,100 sq. ft. mixed with A1115-31
A1115-31	Storage room White 12" x 12" ceiling tile	None detected	Yes	Good	Mixed with A1115-30
	ROOF:				
A1115-32	Northeast side over storage Roof core	None detected	No	??	56,000 sq. ft.
A1115-33	Northeast side of south side of theater Roof cap seal on parapet wall	None detected	No	??	3,000 sq. ft.
A1115-34	Retail store northeast side Green with white 9" x 9" floor tile	Tile - 8% Chrysotile Mastic - 15% Chrysotile	No	Poor	25 sq. ft.
No sample collected	Transite siding Same as sample A1110-13, building 579	N/A	No	Poor	2,000 sq. ft.

It is assumed that anywhere the above identified asbestos containing building materials are found in the building, that those materials also contain asbestos and should be treated as such.

Asbestos Bulk Sampling Log
NAF Midway

THE SZARAS COMPANIES

 DATE SAMPLES COLLECTED: November 22, 1993

BUILDING NUMBER	BUILDING NAME	BUILDING DESCRIPTION
259	Midway Mall	2 Story
TSC PROJECT NUMBER	**TSC INSPECTOR**	**TSC LABORATORY ID NO.**
865	J. Kain and B. Kain	113093I

SAMPLE ID NO	SAMPLE LOCATION / DESCRIPTION	ANALYTICAL RESULTS	FRIABLE	CONDITION	AMOUNT
	INTERIOR 1ST FLOOR:				
A1122-1	Women's restroom east side Black with beige steaks 9" x 9" floor tile	8% Chrysotile	No	Fair	1,400 sq. ft.
A1122-2	Entrance way southwest of stairs Drywall	None detected	Yes	Fair	Unknown
A1122-3	Heater room White pipe lagging runs through the walls	45% Chrysotile	Yes	Fair	Unknown
	INTERIOR 2ND FLOOR:				
A1122-4	South end Green with beige 9" x 9" floor tile	Tile - 12% Chrysotile Mastic - 10% Chrysotile	No	Good	250 sq. ft.
A1122-5	South end Green with blue sheet vinyl	None detected	Yes	Good	500 sq. ft.
A1122-6	South end Red with white streaks 9" x 9" floor tile	Tile - 20% Chrysotile Mastic - 15% Chrysotile	No	Poor	1,900 sq. ft.
A1122-7	Library north side Off-white with gray dents 12" x 12" floor tile	Tile - 4% Chrysotile	Yes	Fair	300 sq. ft.
A1122-8	Library north side 2' x 4' ceiling tiles	None detected	Yes	Fair	300 sq. ft.
A1122-9	Library south side Red with beige and gray streaks 9" x 9" floor tile	Tile - 20% Chrysotile Mastic - 8% Chrysotile	No	Fair	400 sq. ft.
A1122-10	Hall north end Beige with gray streaks 9" x 9" floor tile	Tile - 2% Chrysotile Mastic - 5% Chrysotile	No	Fair	60 sq. ft.

It is assumed that anywhere the above identified asbestos containing building materials are found in the building, that those materials also contain asbestos and should be treated as such.

ASBESTOS BULK SAMPLING LOG
NAF MIDWAY

THE SZARAS COMPANIES

 DATE SAMPLES COLLECTED: November 22, 1993

BUILDING NUMBER	BUILDING NAME	BUILDING DESCRIPTION
259	Midway Mall	2 Story
TSC PROJECT NUMBER	**TSC INSPECTOR**	**TSC LABORATORY ID NO.**
865	J. Kain and B. Kain	1130931

SAMPLE ID NO	SAMPLE LOCATION / DESCRIPTION	ANALYTICAL RESULTS	FRIABLE	CONDITION	AMOUNT
A1122-11	Hall north end Black with white steaks 9" x 9" floor tile	Tile - 4% Chrysotile Mastic - 8% Chrysotile	No	Fair	60 sq. ft.
A1122-12	Library southeast side Black tar paper under floor tile in sample A1122-13	None detected	No	Good	3,000 sq. ft.
	EXTERIOR:				
No sample collected	8" x 8' transite siding Same as sample A1110-13, building 579	30% Chrysotile	No	Good	8,000 sq. ft.
A1122-13	North side outside boiler room 4' x 8' transite panels	35% Chrysotile	No	Good	2,800 sq. ft.
	ROOF:				
A1122-14	Air handler room north side White rolled roof	None detected	No	Poor	800 sq. ft.

It is assumed that anywhere the above identified asbestos containing building materials are found in the building, that those materials also contain asbestos and should be treated as such.

LEAD BASED PAINT SAMPLING LOG
NAF MIDWAY

THE SZARAS COMPANIES

 DATE SAMPLES COLLECTED: November 12, 1993

BUILDING NUMBER	BUILDING NAME	BUILDING DESCRIPTION
259	Midway Mall	2 Story
TSC PROJECT NUMBER	**TSC INSPECTOR**	**TSC LABORATORY ID NO.**
865	J. Kain and B. Kain	112393A

SAMPLE ID NO	SAMPLE LOCATION / DESCRIPTION	ANALYTICAL RESULTS (PPM)	CONDITION	AMOUNT
	Interior of Building Spaces **THEATER:**			
L1112-51	South wall Turquoise paint	28,697.9	Good	1,000 sq. ft.
L1112-52	South wall Beige paint on door	605.5	Good	900 sq. ft.
L1112-53	South wall Brown stain	506.6	Fair	2,000 sq. ft.
L1112-54	Lobby by water fountain White paint on wall	204.6	Good	600 sq. ft.
L1112-55	Men's restroom Beige paint on wall	430.0	Good	200 sq. ft.
	BARBER SHOP:			
L1112-56	South wall Blue paint	214,313.2	Good	150 sq. ft.
L1112-57	South wall White paint	4,074.4	Good	150 sq. ft.
L1112-58	South wall Olive green paint on window sill	113,333.3	Good	50 sq. ft.

is assumed that anywhere the above identified lead based paint materials are found in the building, that those materials contain lead and should be treated as such.

LEAD BASED PAINT SAMPLING LOG
NAF MIDWAY

THE SZARAS COMPANIES DATE SAMPLES COLLECTED: November 12 & 15, 1993

BUILDING NUMBER	BUILDING NAME	BUILDING DESCRIPTION
259	Midway Mall	2 Story
TSC PROJECT NUMBER	**TSC INSPECTOR**	**TSC LABORATORY ID NO.**
865	J. Kain and B. Kain	112393A & 112393D

SAMPLE ID NO	SAMPLE LOCATION / DESCRIPTION	ANALYTICAL RESULTS (PPM)	CONDITION	AMOUNT
	BOWLING ALLEY:			
L1112-59	North side Orange paint on wall	129.0	Fair	200 sq. ft.
L1112-60	South side Off-white paint on wall	107.8	Fair	3,200 sq. ft.
L1112-61	South side - wall trim Brown paint	9,775.3	Fair	200 sq. ft.
L1112-62	North side Purple paint on wall	104.2	??	200 sq. ft.
L1112-63	Passageway Red paint on floor	25,631.6	Poor	1,100 sq. ft.
L1112-64	Passageway Green paint on wall	57,342.1	Fair	4,400 sq. ft.
L1112-65	Passageway Yellow paint on floor	71,397.8	Fair	200 sq. ft.
	FISH AND WILDLIFE/MUSEUM:			
L1115-27	Off-white paint on wall	None detected	Good	1,200 sq. ft.
L1115-28	Restroom Blue paint on wall	226.9	Good	350 sq. ft.
L1115-29	Storage room Light green paint on wall	23,431.0	Good	250 sq. ft.

is assumed that anywhere the above identified lead based paint materials are found in the building, that those materials o contain lead and should be treated as such.

LEAD BASED PAINT SAMPLING LOG
NAF MIDWAY

THE SZARAS COMPANIES

 DATE SAMPLES COLLECTED: November 15, 1993

BUILDING NUMBER	BUILDING NAME	BUILDING DESCRIPTION
259	Midway Mall	2 Story
TSC PROJECT NUMBER	**TSC INSPECTOR**	**TSC LABORATORY ID NO.**
865	J. Kain and B. Kain	112393A & 112393D

SAMPLE ID NO	SAMPLE LOCATION / DESCRIPTION	ANALYTICAL RESULTS (PPM)	CONDITION	AMOUNT
	SHIPS STORE:			
L1115-30	South wall Bright yellow paint	None detected	Good	8,400 sq. ft.
L1115-31	Office north wall Peach paint	13,878.9	Fair	475 sq. ft.
L1115-32	Bear/soda storage room south wall Light yellow paint	None detected	Good	8,400 sq. ft.
L1115-33	Storage north end Orange paint on deck	617,857.1	Poor	800 sq. ft.
	EXTERIOR OF BUILDING:			
L1115-34	East wall Red paint	1,576.0	Good	400 sq. ft.
L1115-35	East side Red deck paint by seats	None detected	Good	200 sq. ft.
L1115-36	East wall of bowling alley	25.0	Good	300 sq. ft.
L1115-37	East wall outside storage Beige paint	None detected	Fair	25,000 sq. ft.

is assumed that anywhere the above identified lead based paint materials are found in the building, that those materials o contain lead and should be treated as such.

LEAD BASED PAINT SAMPLING LOG
NAF MIDWAY

THE SZARAS COMPANIES

 DATE SAMPLES COLLECTED: November 22, 1993

BUILDING NUMBER	BUILDING NAME	BUILDING DESCRIPTION
259	Midway Mall	2 Story
TSC PROJECT NUMBER	**TSC INSPECTOR**	**TSC LABORATORY ID NO.**
865	J. Kain and B. Kain	113093H

SAMPLE ID NO	SAMPLE LOCATION / DESCRIPTION	ANALYTICAL RESULTS (PPM)	CONDITION	AMOUNT
	Fish and wild life storage **INTERIOR 1ST FLOOR:**			
L1122-1	West side White paint on ceiling	76,175.0	Poor	2,600 sq. ft.
L1122-2	West side Yellow paint on wall	319.0	Fair	1,200 sq. ft.
L1122-3	Corridor Green paint on wall	151,000.0	Fair	5,000 sq. ft.
L1122-4	Restroom White paint on wall	22,043.0	Fair	2,500
L1122-5	Storage under stairwell Dark green paint on wall	267,045.4	Good	1,000 sq. ft.
L1122-6	Tailor room Brown paint on window trim	40,723.7	Good	1,000 sq. ft.
	INTERIOR 2ND FLOOR:			
L1122-7	Southwest side Yellow paint on door	8,175.0	Poor	1,000 sq. ft.
L1122-8	Southwest side Yellow and dark blue paint on window sill	54,947.9	Good	200 sq. ft.
L1122-9	Southwest side Light blue paint on wall	255.1	Fair	1,400 sq. ft.
L1122-10	Southwest side Medium blue paint on door trim	144.8	Good	300 sq. ft.

is assumed that anywhere the above identified lead based paint materials are found in the building, that those materials o contain lead and should be treated as such.

Lead Based Paint Sampling Log
NAF Midway

THE SZARAS COMPANIES

 DATE SAMPLES COLLECTED: November 22, 1993

Building Number	Building Name	Building Description
259	Midway Mall	2 Story
TSC Project Number	**TSC Inspector**	**TSC Laboratory ID No.**
865	J. Kain and B. Kain	113093H

Sample ID No	Sample Location / Description	Analytical Results (ppm)	Condition	Amount
L1122-11	Game room nortwest side White paint on ceiling	393,012.7	Poor	2,600 sq. ft.
L1122-12	Game room northwest wall Yellow paint	383,125.0	Fair	1,300 sq. ft.
L1122-13	Men's restroom north wall Gray paint on baseboard	9,375.0	Poor	50 sq. ft.
No sample collected	Electrical room Gray paint on transformer Same as sample L1117-65, building 350	281,887.7	Good	200 sq. ft.

is assumed that anywhere the above identified lead based paint materials are found in the building, that those materials contain lead and should be treated as such.

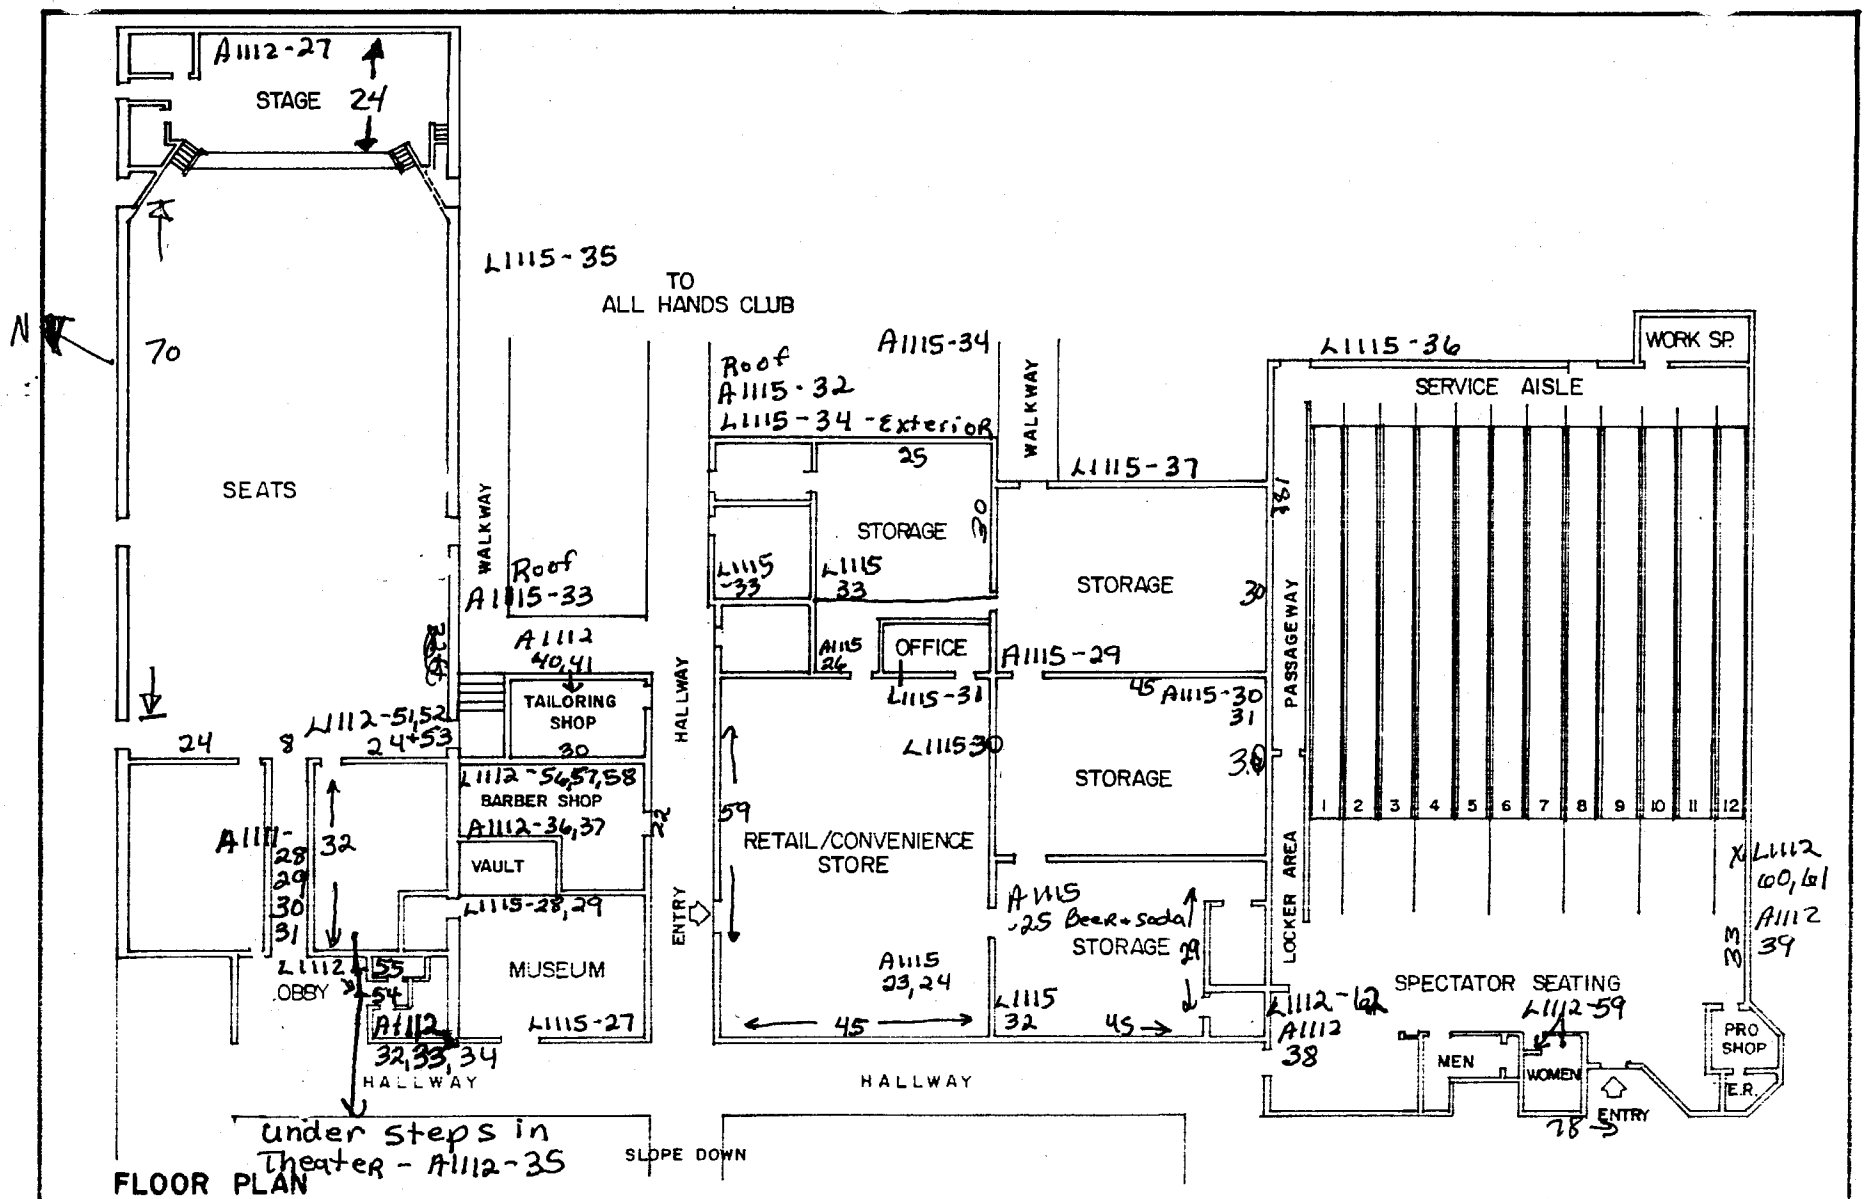

PIQUNIQ MANAGEMENT CORPORATION
NAVAL AIR FACILITY - MIDWAY ISLAND

BLDG. 259 MIDWAY MALL

28 SEPT. 92 NESTORENA

ASBESTOS BULK SAMPLING LOG
NAF MIDWAY

THE SZARAS COMPANIES

 DATE SAMPLES COLLECTED: November 2, 1993

BUILDING NUMBER	BUILDING NAME	BUILDING DESCRIPTION
300	Electrical Sub-Station	1 Story
TSC PROJECT NUMBER	**TSC INSPECTOR**	**TSC LABORATORY ID NO.**
865	J. Kain and B. Kain	N/A

SAMPLE ID NO	SAMPLE LOCATION / DESCRIPTION	ANALYTICAL RESULTS	FRIABLE	CONDITION	AMOUNT
No sample collected	Roof Transite corrugated panels Same as sample A1029-3, building S225	60% Chrysotile	No	Good	400 sq. ft.

is assumed that anywhere the above identified asbestos containing building materials are found in the building, that those erials also contain asbestos and should be treated as such.

LEAD BASED PAINT SAMPLING LOG
NAF MIDWAY

THE SZARAS COMPANIES | PAGE 1 of 1 | DATE SAMPLES COLLECTED: November 2, 1993

BUILDING NUMBER	BUILDING NAME	BUILDING DESCRIPTION
300	Electrical Sub-Station	1 Story
TSC PROJECT NUMBER	**TSC INSPECTOR**	**TSC LABORATORY ID NO.**
865	J. Kain and B. Kain	111593I

SAMPLE ID NO	SAMPLE LOCATION / DESCRIPTION	ANALYTICAL RESULTS (PPM)	CONDITION	AMOUNT
L1102-1	Interior east wall Off-white paint on wall	57.8	Good	1,600 sq. ft.
L1102-2	Interior Gray paint on electrical switch	7,835.0	Good	50 sq. ft.
L1102-3	Roof west side Green paint on transite roof	15,051.5	Poor	400 sq. ft.

is assumed that anywhere the above identified lead based paint materials are found in the building, that those materials o contain lead and should be treated as such.

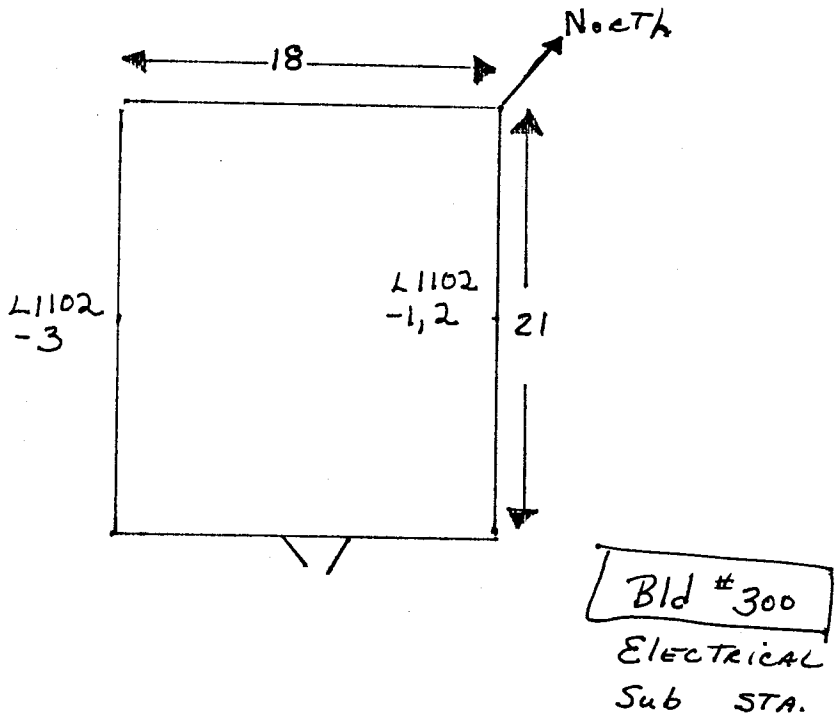
North
18
21
L1102
-3
L1102
-1, 2
Bld #300
Electrical
Sub STA.

ASBESTOS BULK SAMPLING LOG
NAF MIDWAY

THE SZARAS COMPANIES

 DATE SAMPLES COLLECTED: November 17, 1993

BUILDING NUMBER	BUILDING NAME	BUILDING DESCRIPTION
309	Power Plant	2 Story
TSC PROJECT NUMBER	**TSC INSPECTOR**	**TSC LABORATORY ID NO.**
865	J. Kain and B. Kain	113093D

SAMPLE ID NO	SAMPLE LOCATION / DESCRIPTION	ANALYTICAL RESULTS	FRIABLE	CONDITION	AMOUNT
	INTERIOR 2ND FLOOR:				
A1117-1	Control room Black with white streaks 9" x 9" floor tile	5% Chrysotile	No	Poor	500 sq. ft.
A1117-2	Machine room south side White pipe lagging	None detected	Yes	Fair	180 ft.
A1117-3	Office Light brown with dark brown and white streaks: 12" x 12" floor tile	None detected	No	Good	100 sq. ft.
	INTERIOR 1ST FLOOR:				
A1117-4	Compressor Pipe cloth wrap	80% Chrysotile	Yes	Fair	50 lin. ft.
	EXTERIOR:				
A1117-5	Tar seal on corrugated metal	2% Chrysotile	No	Good	8,000 sq. ft.

It is assumed that anywhere the above identified asbestos containing building materials are found in the building, that those materials also contain asbestos and should be treated as such.

LEAD BASED PAINT SAMPLING LOG
NAF MIDWAY

THE SZARAS COMPANIES

 DATE SAMPLES COLLECTED: November 17, 1993

BUILDING NUMBER	BUILDING NAME	BUILDING DESCRIPTION
309	Power Plant	2 Story
TSC PROJECT NUMBER	**TSC INSPECTOR**	**TSC LABORATORY ID NO.**
865	J. Kain and B. Kain	113093C

SAMPLE ID NO	SAMPLE LOCATION / DESCRIPTION	ANALYTICAL RESULTS (PPM)	CONDITION	AMOUNT
	INTERIOR 2ND FLOOR:			
L1117-1	Control room southeast side White paint on wall	1,429.5	Good	15,000 sq. ft.
L1117-2	Control room southeast side Light gray paint on wall	47,075.0	Good	200 sq. ft.
L1117-3	Control room southeast side Green paint on door jamb	24,700.0	Poor	1,000 sq. ft.
L1117-4	Control room southeast side Blue paint on door	45,028.4	Fair	250 sq. ft.
L1117-5	Battery storage southeast side Black paint on wall	5,268.7	Good	1,000 sq. ft.
L1117-6	Battery storage southeast side Red paint on floor	140,672.0	Fair	16,000 sq. ft.
L1117-7	Machine room northwest side Gray paint on engines	4,373.7	Good	14,000 sq. ft.
L1117-8	Machine room northwest side Yellow paint on pipes	998,764.8	Good	2,000 sq. ft.
L1117-9	Machine room west side White paint on pipe	5,350.5	Good	9,150 sq. ft.
L1117-10	Machine room north side Blue paint on handrail	231,855.7	Good	1,000 sq. ft.
L1117-11	Machine room center Red paint on handrail	587,228.3	Good	1,000 sq. ft.

is assumed that anywhere the above identified lead based paint materials are found in the building, that those materials o contain lead and should be treated as such.

LEAD BASED PAINT SAMPLING LOG
NAF MIDWAY

THE SZARAS COMPANIES

 DATE SAMPLES COLLECTED: November 17, 1993

BUILDING NUMBER	BUILDING NAME	BUILDING DESCRIPTION
309	Power Plant	2 Story
TSC PROJECT NUMBER	**TSC INSPECTOR**	**TSC LABORATORY ID NO.**
865	J. Kain and B. Kain	113093C

SAMPLE ID NO	SAMPLE LOCATION / DESCRIPTION	ANALYTICAL RESULTS (PPM)	CONDITION	AMOUNT
L1117-12	Catwalk southwest side Orange paint on handrail	658,611.1	Good	3,000 sq. ft.
L1117-13	Machine room northwest side Silver paint on exhaust pipes of engine	12,417.6	Good	10,000 sq. ft.
	1ST FLOOR:			
L1117-14	Interior southside by valve Red paint on fire system	90,079.4	Good	500 sq. ft.
L1117-15	Exterior southwest side by catwalk White paint on wall	18,097.8	Fair	15,000 sq. ft.

is assumed that anywhere the above identified lead based paint materials are found in the building, that those materials contain lead and should be treated as such.

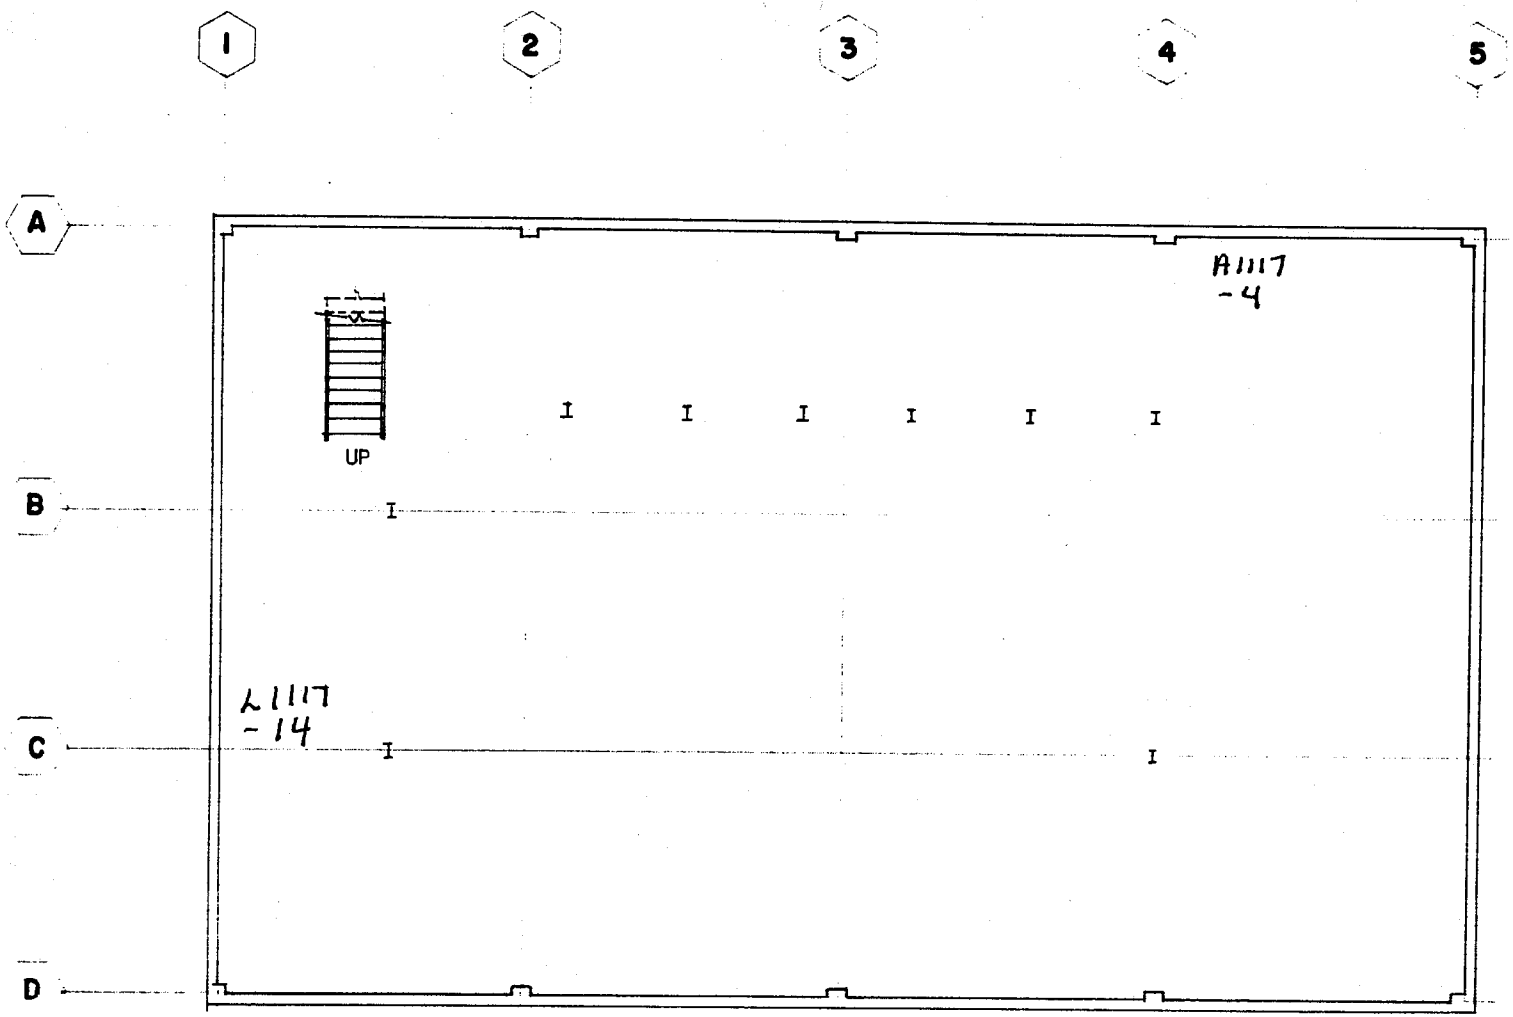

First FLOOR PLAN

PIQUNIQ MANAGEMENT CORPORATION
NAVAL AIR FACILITY–MIDWAY ISLAND

POWER PLANT, BLDG. 309

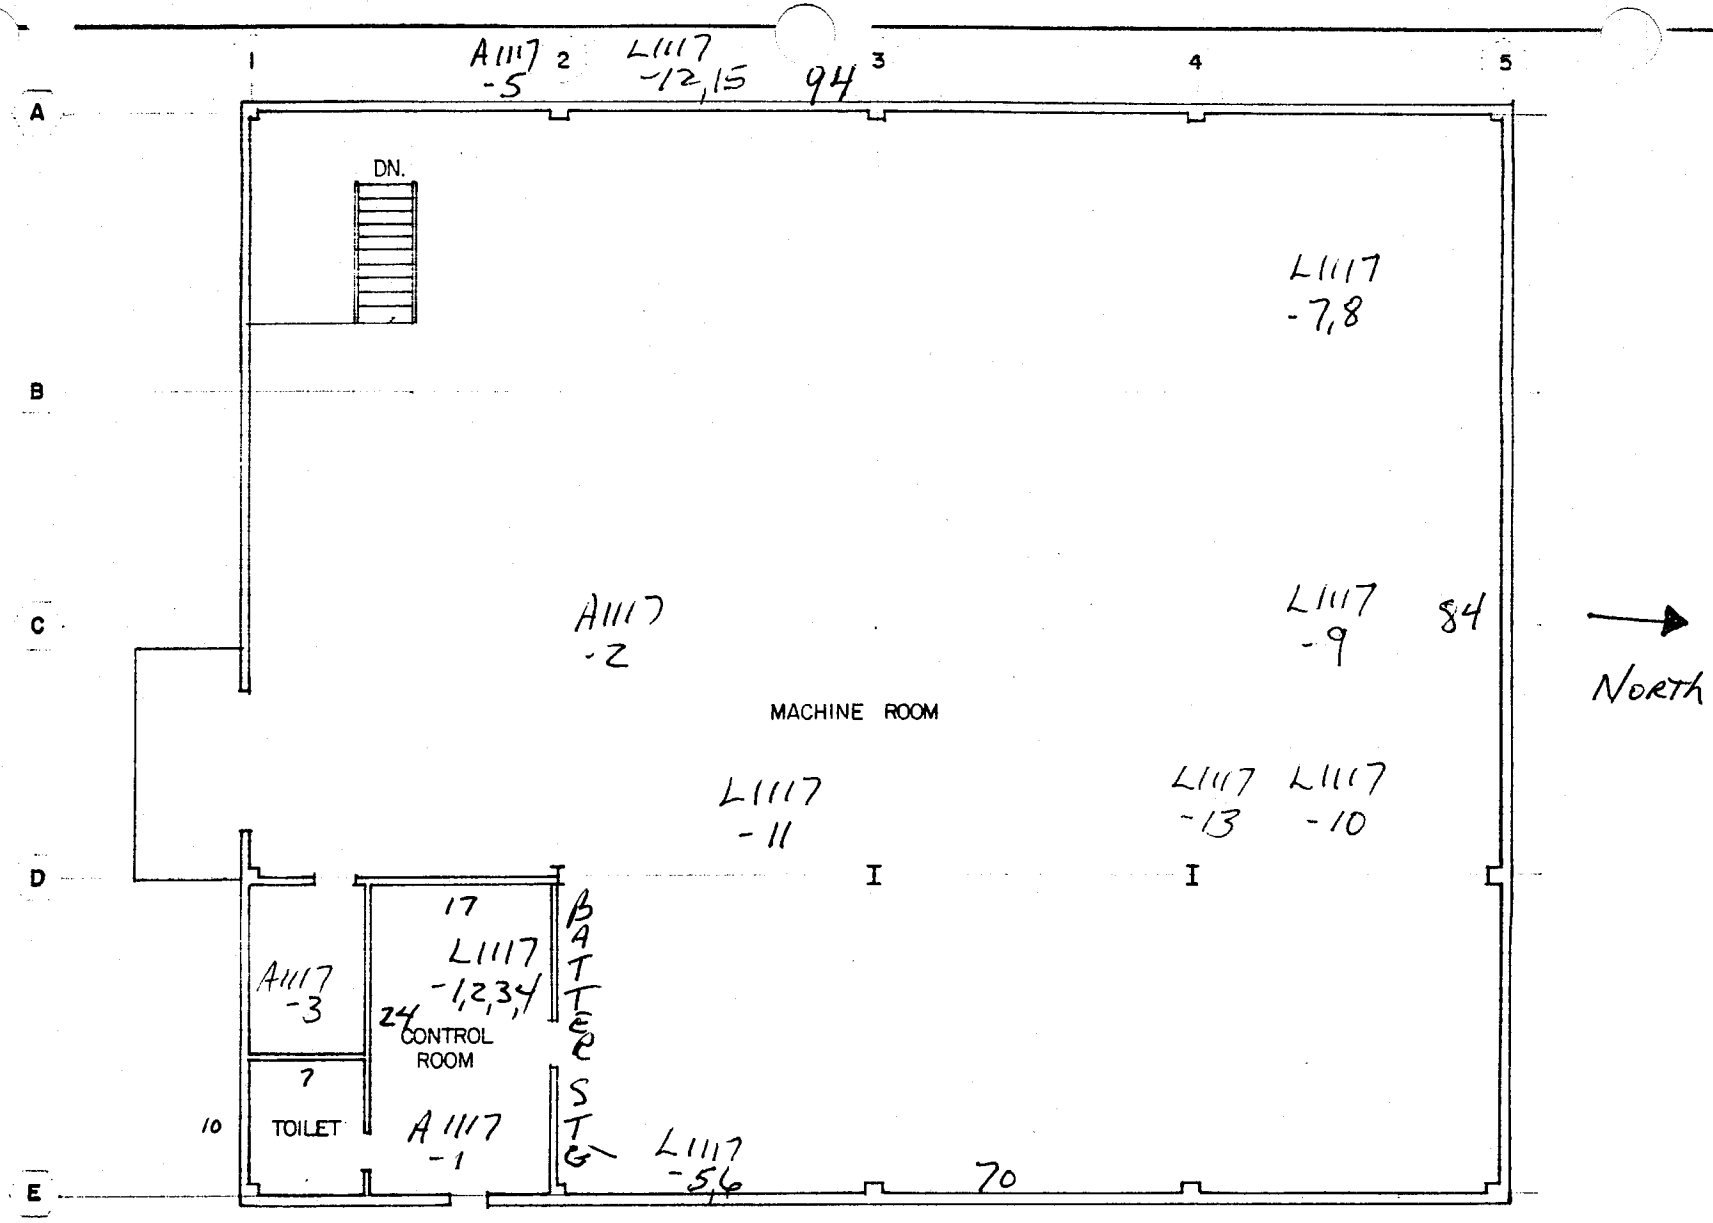

2nd FLOOR PLAN

PIQUNIQ MANAGEMENT CORPORATION
NAVAL AIR FACILITY - MIDWAY ISLAND
POWER PLANT, BLDG. 309

ASBESTOS BULK SAMPLING LOG
NAF MIDWAY

THE SZARAS COMPANIES

 DATE SAMPLES COLLECTED: November 18, 1993

BUILDING NUMBER	BUILDING NAME	BUILDING DESCRIPTION
331	Branch Medical and Dental Clinic	1 Story
TSC PROJECT NUMBER	**TSC INSPECTOR**	**TSC LABORATORY ID NO.**
865	J. Kain and B. Kain	113093F

SAMPLE ID NO	SAMPLE LOCATION / DESCRIPTION	ANALYTICAL RESULTS	FRIABLE	CONDITION	AMOUNT
A1118-35	Roof west side Core and rock	None detected	No	Good	7,600 sq. ft.
A1118-36	Room 125 interior of closet Yellow, brown and gray (little squares) sheet vinyl	30% Chrysotile	Yes	Good	6,000 sq. ft.
A1118-37	Room 108 interior Off-white with shades of brown flecks 12" x 12" floor tile	Tile - 1-2% Chrysotile Mastic-12% Chrysotile	No	Good	1,600 sq. ft.

It is assumed that anywhere the above identified asbestos containing building materials are found in the building, that those materials also contain asbestos and should be treated as such.

LEAD BASED PAINT SAMPLING LOG
NAF MIDWAY

THE SZARAS COMPANIES

 DATE SAMPLES COLLECTED: November 18, 1993

BUILDING NUMBER	BUILDING NAME	BUILDING DESCRIPTION
331	Branch Medical and Dental Clinic	1 Story
TSC PROJECT NUMBER	**TSC INSPECTOR**	**TSC LABORATORY ID NO.**
865	J. Kain and B. Kain	113093E

SAMPLE ID NO	SAMPLE LOCATION / DESCRIPTION	ANALYTICAL RESULTS (PPM)	CONDITION	AMOUNT
	INTERIOR:			
L1118-60	Hallway outside Room 125 Off-white paint on wall	113.4	Good	28,000 sq. ft.
L1118-61	Room 108 Brown paint on door frame	6,450.0	Good	1,500 sq. ft.
L1118-62	Restroom outside Blue paint on wall	214.0	Fair	500 sq. ft.
L1118-63	Storage room south side White paint on ceiling	54.0	Fair	7,600 sq. ft.
	EXTERIOR:			
L1118-64	Air handler east side Silver paint	131.2	Good	150 sq. ft.
L1118-65	Exit door east side and trim Gray paint	6,149.5	Good	1,000 sq. ft.
L1118-66	Room 121 interior west wall Mustard paint	59.7	Good	1,000 sq. ft.
L1118-67	Room 114 north wall Blue/green paint	904.6	Good	900 sq. ft.

is assumed that anywhere the above identified lead based paint materials are found in the building, that those materials contain lead and should be treated as such.

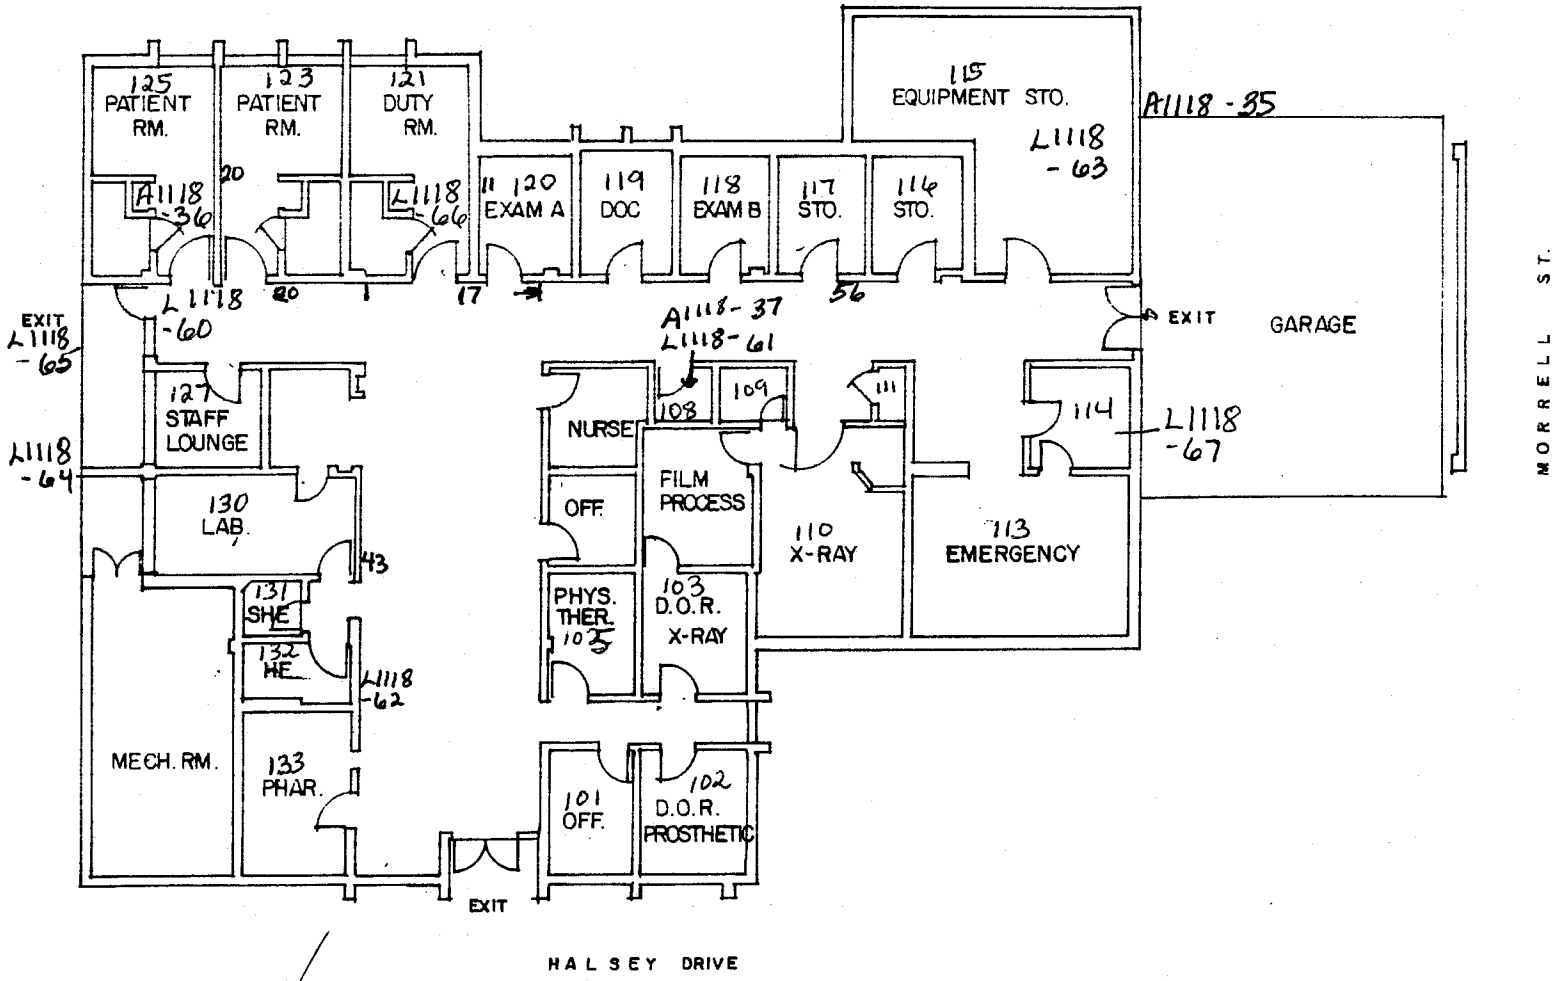

FLOOR PLAN

PIQUNIQ MANAGEMENT CORPORATION
NAVAL AIR FACILITY - MIDWAY ISLAND

BRANCH MEDICAL/DENTAL CLINIC
BLDG. 331

PG. 1 OF 7

26SEPT92 NECTORAM

331
MED
DENVER

DWG # 331
PG. 2 OF 9

REVISIONS				
LTR	DESCRIPTION	PREP BY	DATE	APPROVED
(A) 15	1. RELOCATE DES. 23, 44, 46, EXIT SIGN & PADDLES			
	2 REPLACE NOISE CONSTANT STA. WRECKERANGE SIGN			
	3 CHANGED ADDION BASE 11-0340 TO ONE WAY			
	4-10 DELETED ELE TRANS, SUPPS INTELITS, LAN			
	11. CHANGE CONC. PAD TO 6" THK BASE SURV			
	12 INDICATED D9200 LOCATION			
	13 RELOCATED ELEC/TEL. & INTG SAN START			
	15,16. INDICATED WALL MTR EVERS LIGHTS	AL/KK	8/23/79	
(B) 3	1 ADDED SIGN A			
	2 REORIENTED SIGN 27			
	3 CHANGED SIGN 53 TO 305-YES	AL	2-12-80	
(C) 1	ADD UTILITY JUNCTION BOX D7090	D P	3-11-80	
	AS BUILT CONDITION SHOWN	MEB	3-22-82	

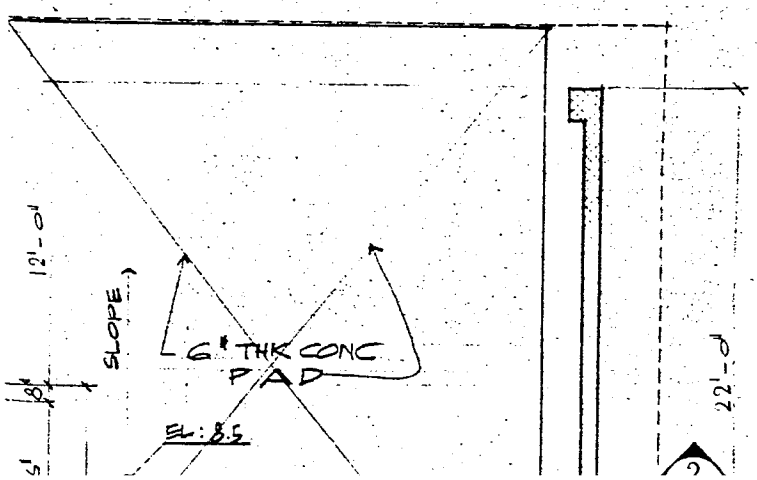

34"
22"
17"
11"
8.5"

PG. 3 OF 7

BLDG. # 331

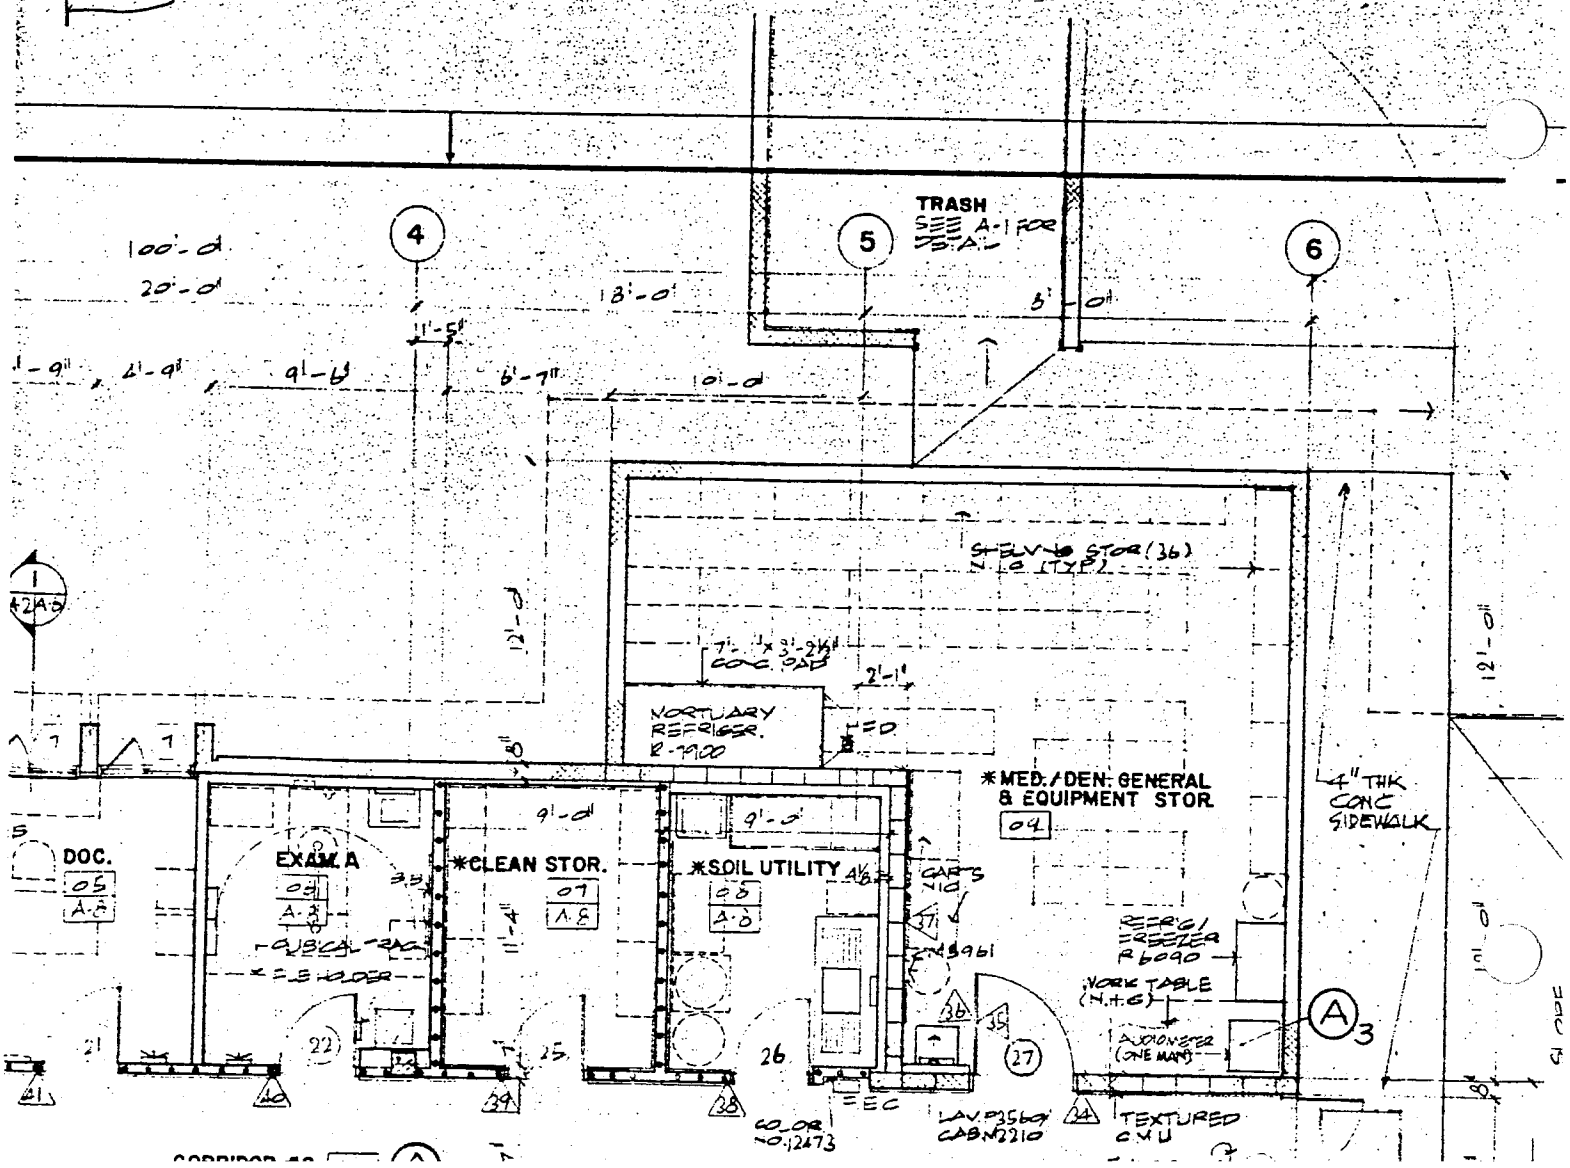

PG. 4 OF 7

BLDG. # 331

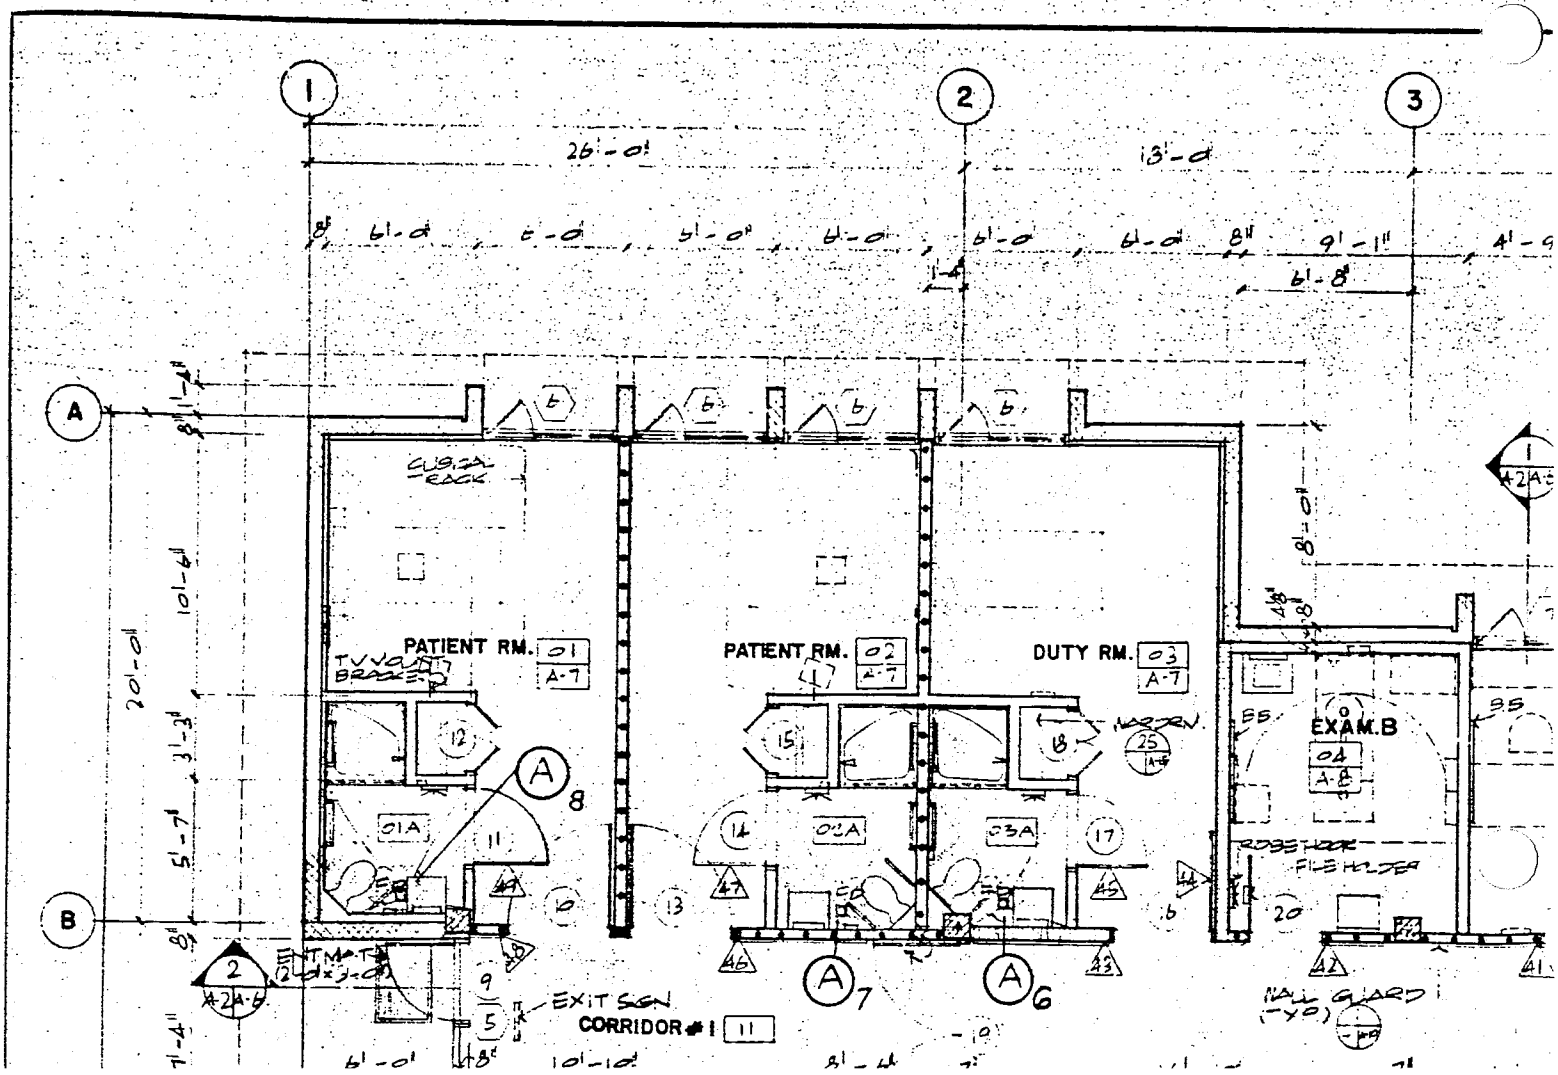

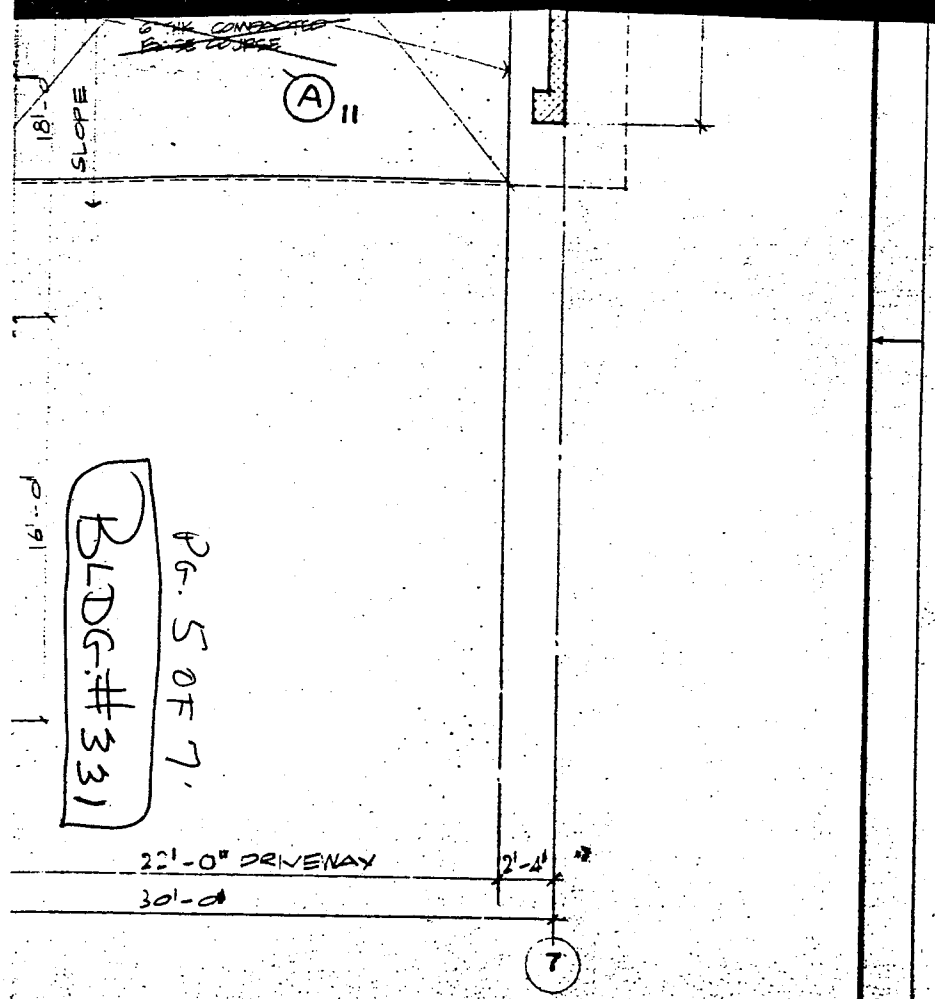

AREA
M.U. SOLID GROUTED
M.U. SOLID GROUTED 2 HR. U.O.N
PARTITION
TN.
TN.
TN.
RN./VISUAL
ELEC. DWG.

The Contractor will be responsible for coordinating the work among the various trades as necessary to avoid conflicts and to insure the installation of all work within the available space.

RECORD DRAWING
SHEET 7 OF 47
DATE 3-19-82

IF SHEET IS LESS THAN 28" x 40" IT IS A REDUCED PRINT — SCALE REDUCED ACCORDINGLY

SAM CHANG ARCHITECT & ASSOCIATES, INC.
HONOLULU HAWAII

DEPARTMENT OF THE NAVY NAVAL FACILITIES ENGINEERING COMMAND
PACIFIC DIVISION
MAKALAPA, HAWAII

NAVAL AIR FACILITY, MIDWAY ISLAND
MEDICAL/DENTAL CLINIC BRANCH
FLOOR PLAN

SUBMITTED BY SAM CHANG JULY 31, 1979
FIRM MEMBER (TITLE) PRINCIPAL
APPROVED 9 AUG 1979

CODE IDENT NO 80091
NAVFAC DRAWING NO 1,025,879
CONTR CONTR NO N62471-78-C-1500
SCALE 1/8"=1'-0" SPEC 14-78-1500 SHEET 7 OF 47

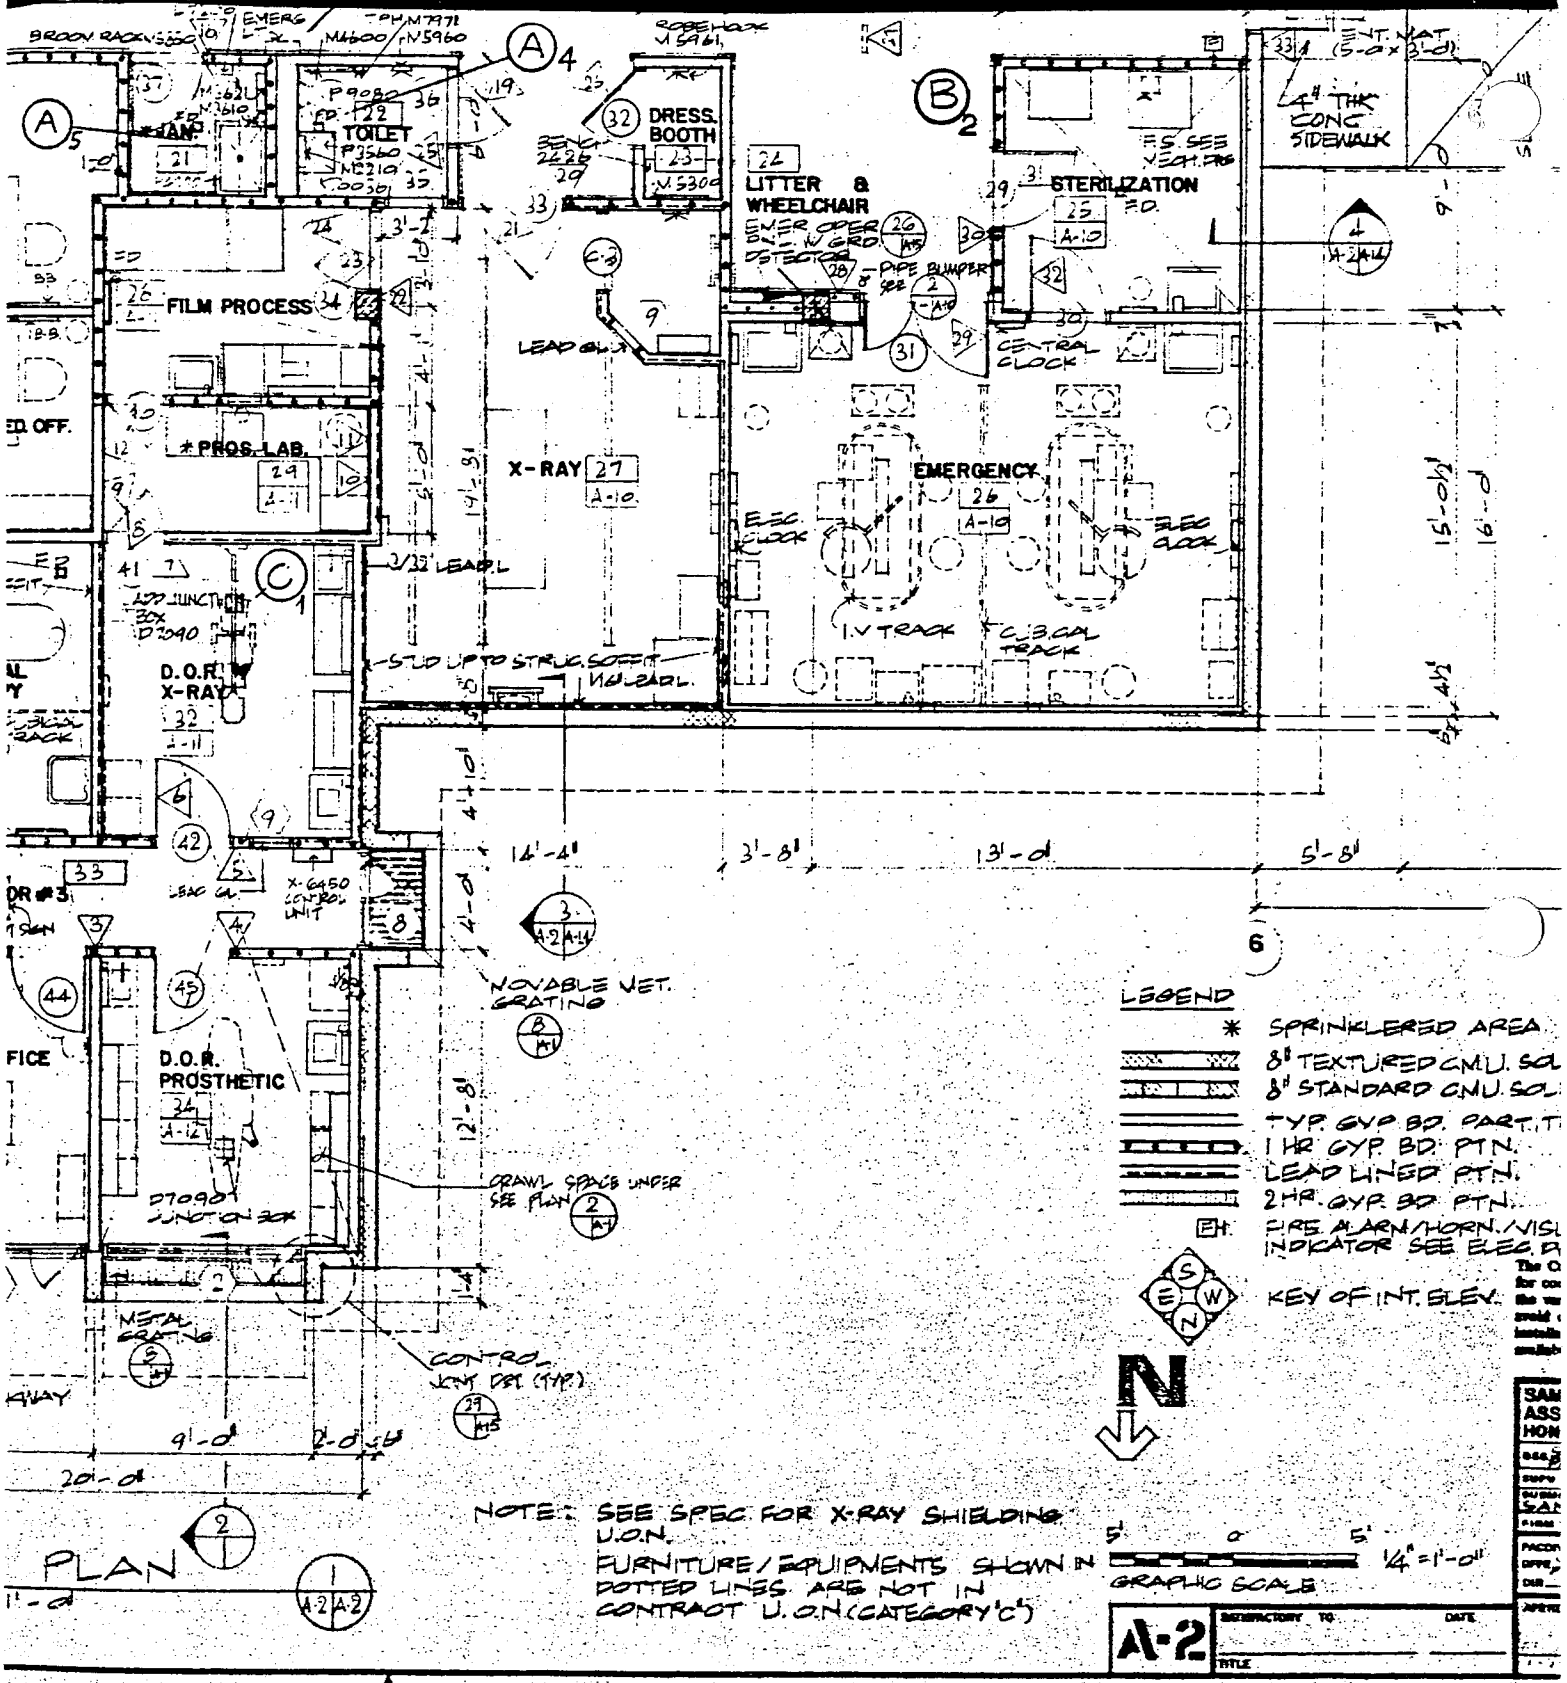
DRESS. BOOTH
LITTER & WHEELCHAIR
STERILIZATION
TOILET
FILM PROCESS
PROS. LAB.
X-RAY
EMERGENCY
D.O.R. X-RAY
D.O.R. PROSTHETIC
LEAD GL.
CENTRAL CLOCK
ELEC. CLOCK
I.V. TRACK
C.B.CAL TRACK
STUD UP TO STRUC. SOFFIT
NOVABLE VET. GRATING
CRAWL SPACE UNDER SEE PLAN
CONTROL JOINT DET. (TYP.)
METAL GRATING
4" THK CONC. SIDEWALK
LEGEND
SPRINKLERED AREA
8" TEXTURED C.M.U. SOL
8" STANDARD C.M.U. SOL
TYP. GYP. BD. PART. T
1 HR. GYP. BD. PTN.
LEAD LINED PTN.
2 HR. GYP. BD. PTN.
FIRE ALARM/HORN./VISU INDICATOR SEE ELEC. D
KEY OF INT. ELEV.
N
NOTE: SEE SPEC. FOR X-RAY SHIELDING U.O.N.
FURNITURE/EQUIPMENTS SHOWN IN DOTTED LINES ARE NOT IN CONTRACT U.O.N (CATEGORY 'C')
GRAPHIC SCALE
1/4" = 1'-0"
PLAN
A-2

PG. 6 OF 7

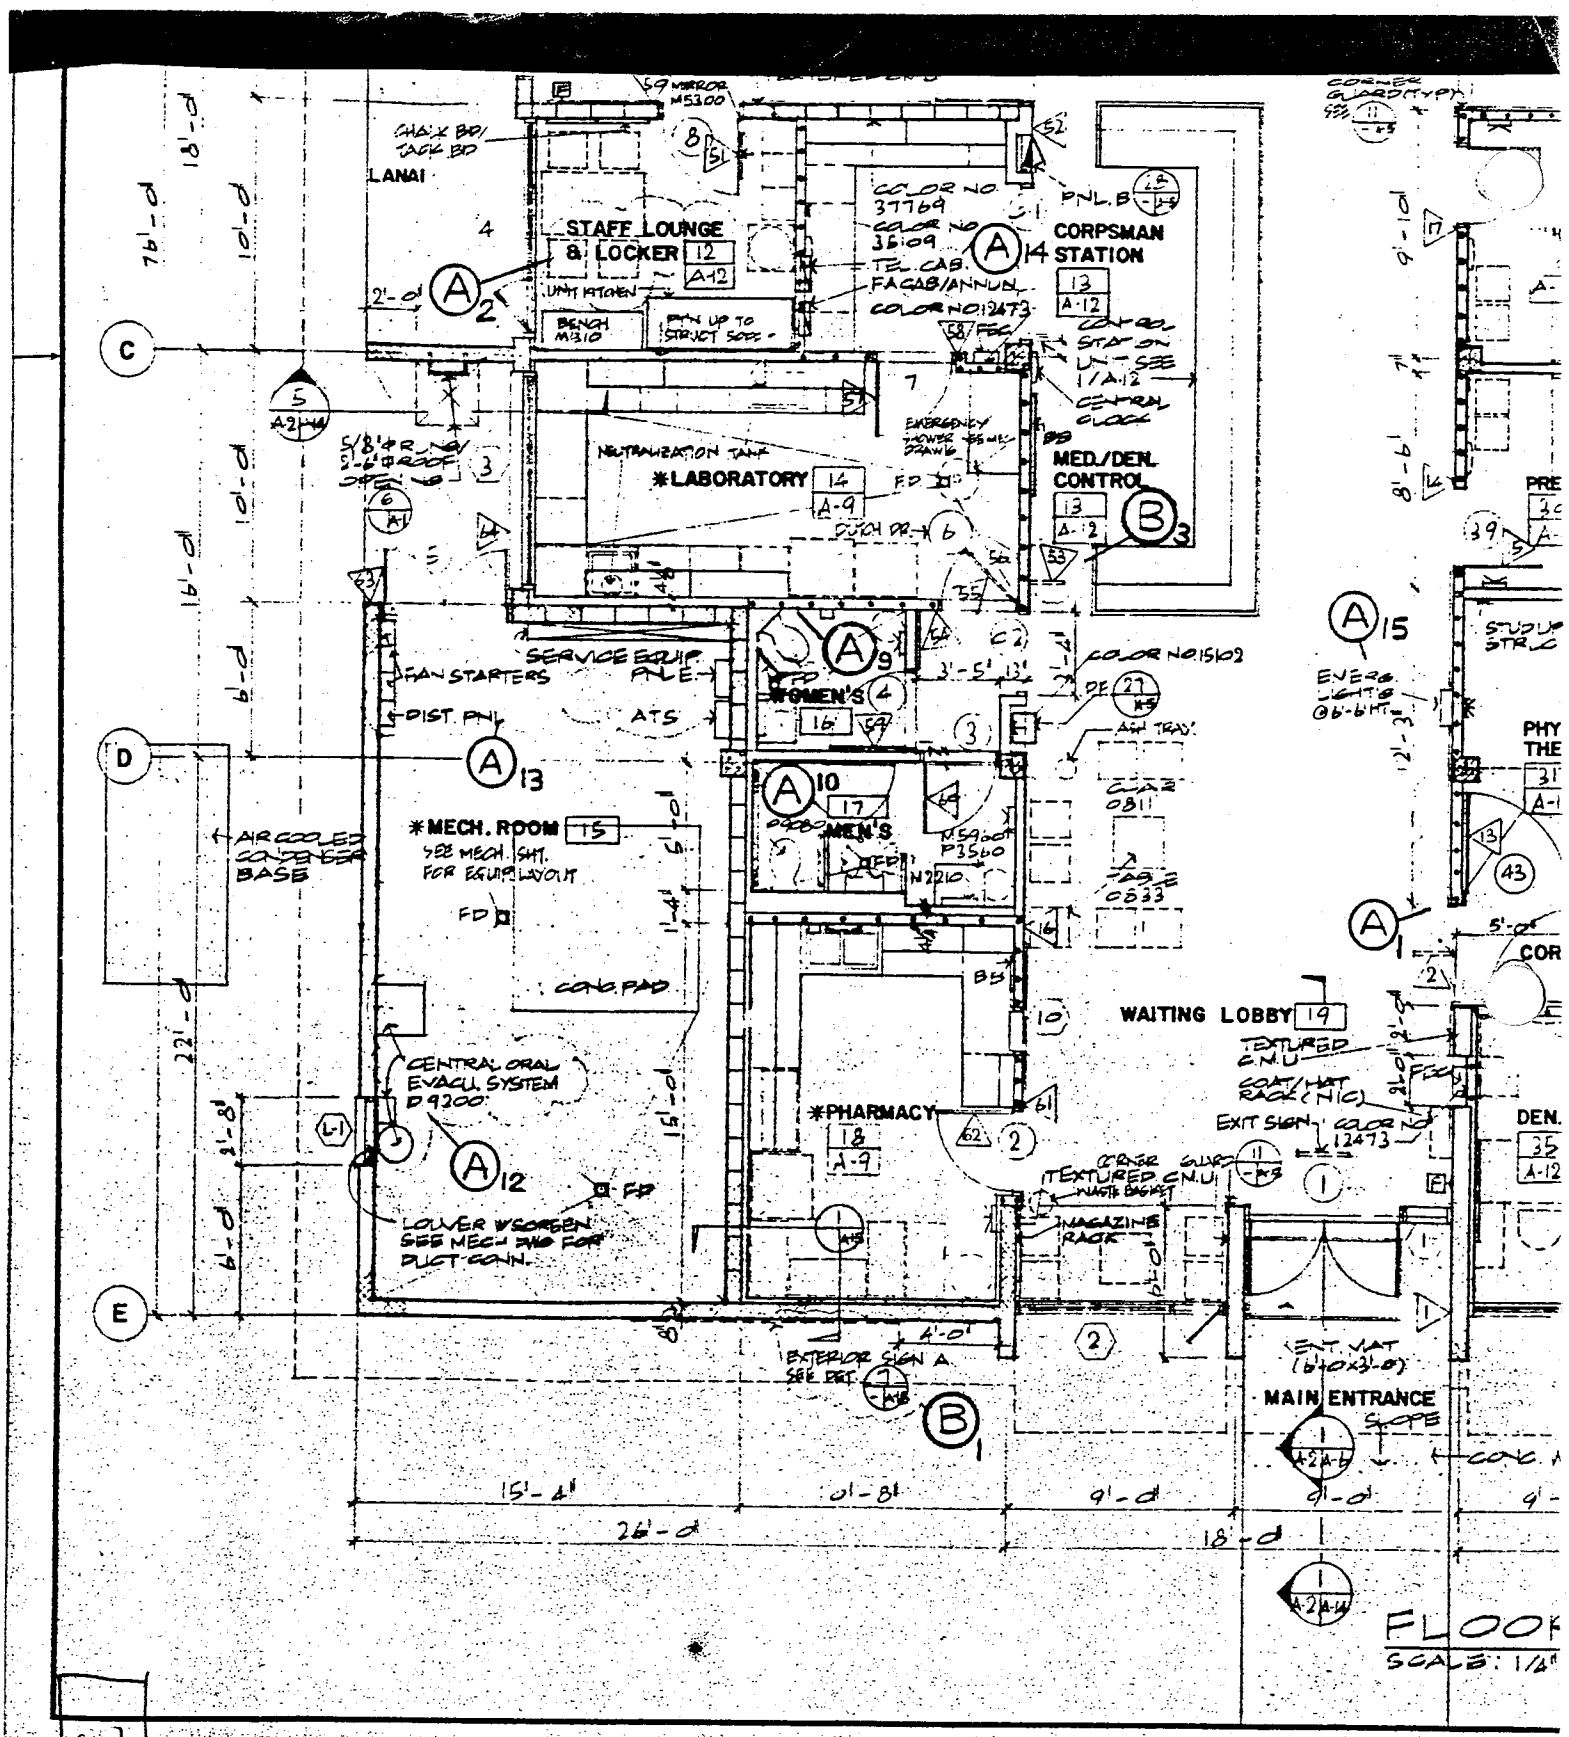

EXHIBIT #3
PAGE 1 OF 7

Asbestos Bulk Sampling Log
NAF Midway

THE SZARAS COMPANIES

DATE SAMPLES COLLECTED: October 29, 1993

Building Number	Building Name	Building Description
332	Generator Room	1 Story
TSC Project Number	**TSC Inspector**	**TSC Laboratory ID No.**
865	J. Kain and B. Kain	N/A

Sample ID No	Sample Location / Description	Analytical Results	Friable	Condition	Amount
No sample collected	No suspect ACM	N/A			

It is assumed that anywhere the above identified asbestos containing building materials are found in the building, that those aterials also contain asbestos and should be treated as such.

LEAD BASED PAINT SAMPLING LOG
NAF MIDWAY

THE SZARAS COMPANIES

DATE SAMPLES COLLECTED: October 29, 1993

BUILDING NUMBER	BUILDING NAME	BUILDING DESCRIPTION
332	Generator Room	1 Story
TSC PROJECT NUMBER	**TSC INSPECTOR**	**TSC LABORATORY ID NO.**
865	J. Kain and B. Kain	110893M

SAMPLE ID NO	SAMPLE LOCATION / DESCRIPTION	ANALYTICAL RESULTS (PPM)	CONDITION	AMOUNT
L1029-1	Exterior east side Off-white paint on block wall	395.7	Good	500 sq. ft.
L1029-2	Exterior east side Brown paint on bottom trim	137.0	Fair	50 sq. ft.
L1029-3	Interior center of room Green paint on generator	43,452.4	Good	25 sq. ft.

is assumed that anywhere the above identified lead based paint materials are found in the building, that those materials contain lead and should be treated as such.

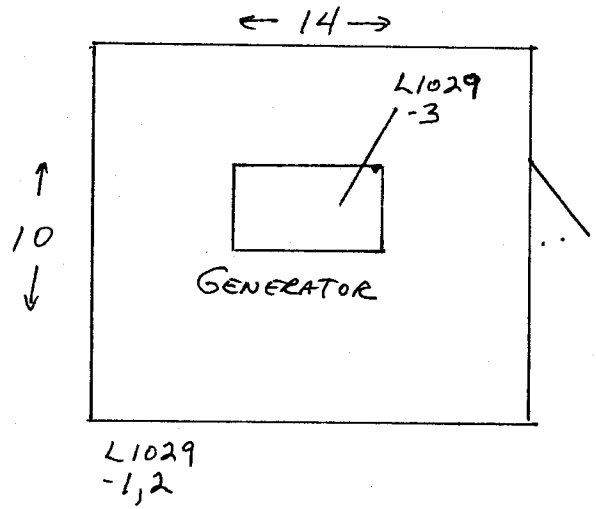

Bld#332

GENERATOR ROOM
FOR MEDICAL/DENTAL

ASBESTOS BULK SAMPLING LOG
NAF MIDWAY

THE SZARAS COMPANIES

 DATE SAMPLES COLLECTED: November 6, 1993

BUILDING NUMBER	BUILDING NAME	BUILDING DESCRIPTION
335	Barracks	2 Story
TSC PROJECT NUMBER	**TSC INSPECTOR**	**TSC LABORATORY ID NO.**
865	J. Kain and B. Kain	111693J

SAMPLE ID NO	SAMPLE LOCATION / DESCRIPTION	ANALYTICAL RESULTS	FRIABLE	CONDITION	AMOUNT
A1106-22	Interior west side of stairwell, 1st floor Brown with orange 9" x 9" floor tile	3% Chrysotile	No	Fair	17,000 sq. ft.
A1106-23	Interior boiler room Pipe lagging by valve	20% Chrysotile	Yes	Fair	Mixed with A1106-25
A1106-24	Interior boiler room White insulation on boiler	25% Chrysotile 35% Amosite	Yes	Good	200 sq. ft.
A1106-25	Interior boiler room Pipe lagging air cell	60% Chrysotile	Yes	Poor	300 lin. ft.
A1106-26	Interior roof access room, 2nd floor Expansion joint on air handler	None detected	Yes	Poor	30 sq. ft.
No sample collected	Roof Roof core Same as samples A1106-20 and 21, building 336	None detected	No	Good	8,400 sq. ft.
No sample collected	Exterior 8" horizontal transite siding Same as sample A1110-13, building 578	30% Chrysotile	No	Good	10,000 sq. ft.
	Note: Pipe lagging is mixed with fiberglass and some have been replaced. It is impossible to tell how much has been replaced.				
No sample collected	Electrical room interior 1st floor Transite paneling on wall	Tansite is know to be asbestos	No	Good	600 sq. ft.

assumed that anywhere the above identified asbestos containing building materials are found in the building, that those rials also contain asbestos and should be treated as such.

LEAD BASED PAINT SAMPLING LOG
NAF MIDWAY

THE SZARAS COMPANIES

DATE SAMPLES COLLECTED: November 6, 1993

BUILDING NUMBER	BUILDING NAME	BUILDING DESCRIPTION
335	Barracks	2 Story
TSC PROJECT NUMBER	**TSC INSPECTOR**	**TSC LABORATORY ID NO.**
865	J. Kain and B. Kain	111693K

SAMPLE ID NO	SAMPLE LOCATION / DESCRIPTION	ANALYTICAL RESULTS (PPM)	CONDITION	AMOUNT
L1106-28	Interior west wall by stairwell White paint on wall	None detected	Fair	22,000 sq. ft.
L1106-29	Interior west wall by stairwell Beige paint on trim	None detected	Fair	2,000 sq. ft.
L1106-30	Interior boiler room Brown paint on door	70,549.5	Fair	3,200 sq. ft.
L1106-31	Interior outside boiler room Blue paint on ceiling	12,013.1	Good	4,200 sq. ft.
L1106-32	Interior stairwell Gray deck paint	576.4	Poor	800 sq. ft.
L1106-33	Interior restroom Blue paint on shower stall	57.8	Good	200 sq. ft.
L1106-34	Interior hallway outside room 109 Red paint on electrical box	7,930.1	Good	100 sq. ft.
No sample collected	Exterior Beige paint on wood and transite Same as sample L1106-25, building 336	431.9	Good	11,000 sq. ft.
No sample collected	Exterior Red paint on deck Same as sample L1106-27, building 336	2,323.5	Fair	4,500 sq. ft.
No sample collected	Exterior Brown paint on door and trim Same as sample L1106-26, building 336	3,663.1	Fair	950 sq. ft.

is assumed that anywhere the above identified lead based paint materials are found in the building, that those materials o contain lead and should be treated as such.

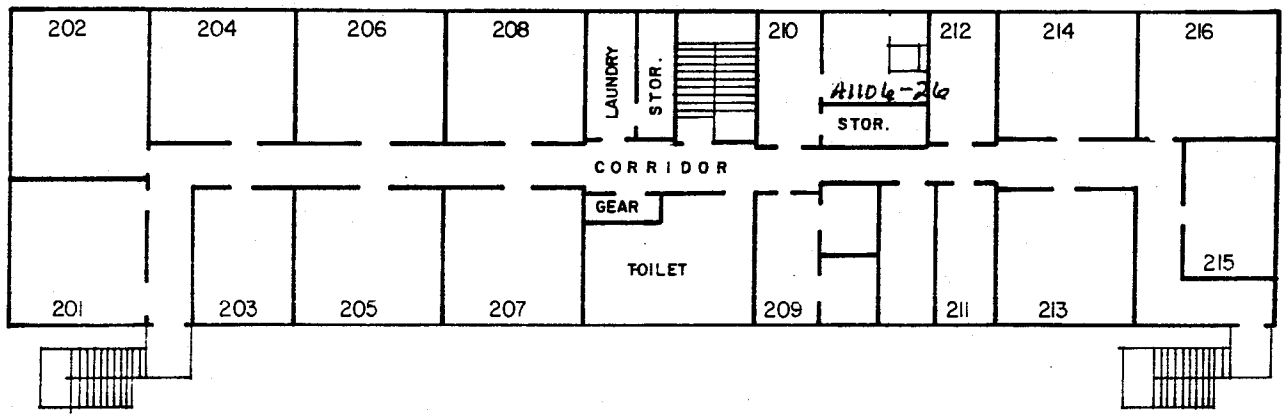

SECOND FLOOR PLAN

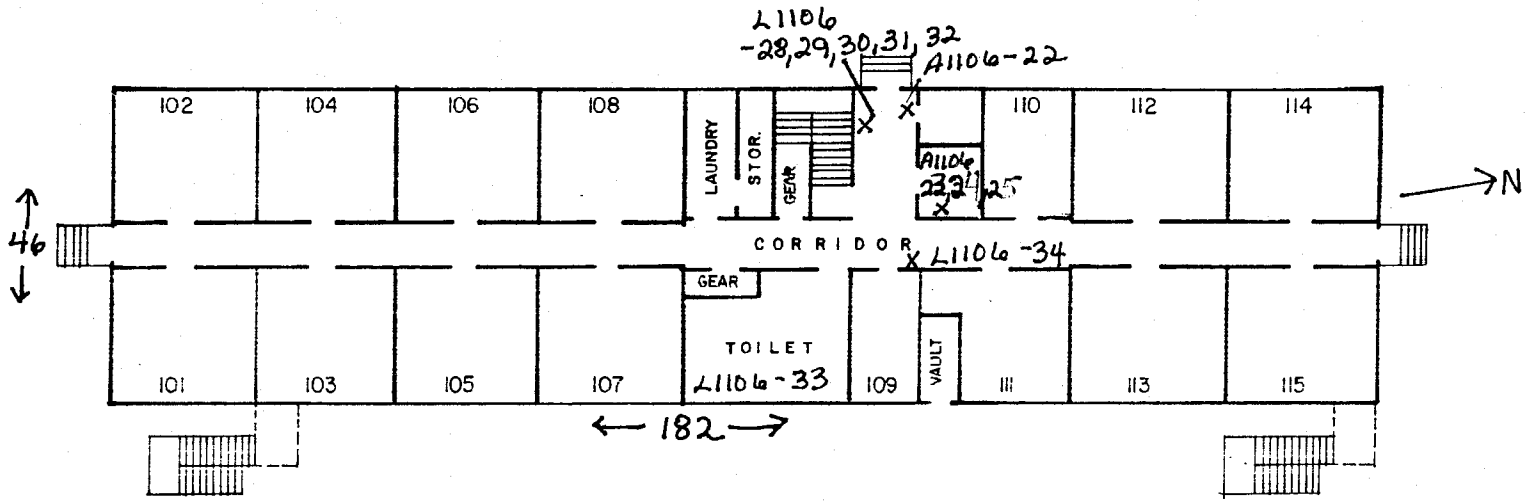

FIRST FLOOR PLAN

PIQUNIQ MANAGEMENT CORPORATION
NAVAL AIR FACILITY- MIDWAY ISLAND

BARRACKS BLDG. NO. 335

NESTCOM MODULT.

Asbestos Bulk Sampling Log
NAF Midway

THE SZARAS COMPANIES

 DATE SAMPLES COLLECTED: November 6, 1993

Building Number	Building Name	Building Description
336	Barracks	2 Story
TSC Project Number	**TSC Inspector**	**TSC Laboratory ID No.**
865	J. Kain and B. Kain	111693J

Sample ID No	Sample Location / Description	Analytical Results	Friable	Condition	Amount
A1106-12	Interior north end of lounge Brown with orange 9" x 9" floor tile	Tile - 6% Chrysotile Mastic - None detected	No	Poor	Mixed with A1106-12, 13 and 14
A1106-13	Interior northeast side of kitchen Black with white 9" x 9" floor tile	Tile - 8% Chrysotile Mastic - 4% Chrysotile	No	Poor	17,000 sq. ft.
A1106-15	Interior north end of lounge White suspended 2' x 4' ceiling tiles with dents and holes	None detected	Yes	Poor	8,400 sq. ft.
A1106-14	Interior east kitchen Red with white 9" x 9" floor tile	Tile - 10% Chrysotile Mastic - None detected	No	Fair	8,400 sq. ft.
A1106-16	Interior east wall of kitchen Drywall and tape	None detected	Yes	Fair	8,000 sq. ft.
A1106-17	Interior boiler room northwest side White boiler insulation	20% Chrysotile	Yes	Fair	200 sq. ft.
A1106-18	Interior boiler room Pipe lagging	60% Chrysotile	Yes	Poor	300 lin. ft.
A1106-19	Room 103 Sheet vinyl debris laying loose	None detected	Yes	Poor	20 sq. ft.
A1106-20	Roof south side Roof tar on vent pipes	None detected	No	Good	10 vents
A1106-21	Roof east side Roof core on rock roof	None detected	No	Good	8,400 sq. ft.
No sample collected	Interior 2nd floor, roof access room Expansion joint - same as sample A1106-26, building 335	None detected	Yes	Fair	30 sq. ft.
No sample collected	Interior boiler room Pipe lagging - same as sample A1106-25, building 335	60% Chrysotile	Yes	Fair	Mixed with A1106-18
No sample collected	Exterior 8" hoizontal transite siding Same as sample A1110-13, building 578	3% Chrysotile	No	Good	10,000 sq. ft.

" is assumed that anywhere the above identified asbestos containing building materials are found in the building, that those aterials also contain asbestos and should be treated as such.

Asbestos Bulk Sampling Log
NAF Midway

THE SZARAS COMPANIES

 DATE SAMPLES COLLECTED: November 6, 1993

Building Number	Building Name	Building Description
336	Barracks	2 Story
TSC Project Number	**TSC Inspector**	**TSC Laboratory ID No.**
865	J. Kain and B. Kain	111693J

Sample ID No	Sample Location / Description	Analytical Results	Friable	Condition	Amount
No sample collected	Exterior 8" horizontal transite siding Same as sample A1110-13, building 578	Transite is known to be asbestos	No	Good	10,000 sq. ft.
	Note: The brown tile is found under the black in different areas and patches of different tile; brown, black or red throughout.				

assumed that anywhere the above identified asbestos containing building materials are found in the building, that those erials also contain asbestos and should be treated as such.

LEAD BASED PAINT SAMPLING LOG
NAF MIDWAY

THE SZARAS COMPANIES

DATE SAMPLES COLLECTED: November 6, 1993

BUILDING NUMBER	BUILDING NAME	BUILDING DESCRIPTION
336	Barracks	2 Story
TSC PROJECT NUMBER	**TSC INSPECTOR**	**TSC LABORATORY ID NO.**
865	J. Kain and B. Kain	111693K

SAMPLE ID NO	SAMPLE LOCATION / DESCRIPTION	ANALYTICAL RESULTS (PPM)	CONDITION	AMOUNT
L1106-19	Interior kitchen 1st floor Beige paint on ceiling	49,057.4	Poor	8,500 sq. ft.
L1106-20	Interior kitchen area 1st floor White paint on south wall	62.5	Fair	**Mixed 20,000 sq. ft.
L1106-21	Interior west wall lounge Green paint on wall	21,435.2	Good	**Mixed 20,000 sq. ft.
L1106-22	Interior east door of kitchen Brown paint on doorjamb	339.4	Fair	3,200 sq. ft.
L1106-23	Interior corridor outside restroom Green paint in hall	123.4	Fair	**Mixed 20,000 sq. ft.
L1106-24	Interior west wall stairwell Green paint on wall	18,712.8	Poor	**Mixed 20,000 sq. ft.
L1106-25	Exterior north end Beige paint on wood trim	431.9	Fair	11,000 sq. ft.
L1106-26	Exterior north end Brown paint on handrail	3,663.1	Poor	950 sq. ft.
L1106-27	Exterior north end Red paint on deck	2,323.5	Poor	4,500 sq. ft.
	**Mixed: Samples L1106-20, L1106-21, L1106-23 and L1106-24 are intermingled throughout building			

s assumed that anywhere the above identified lead based paint materials are found in the building, that those materials so contain lead and should be treated as such.

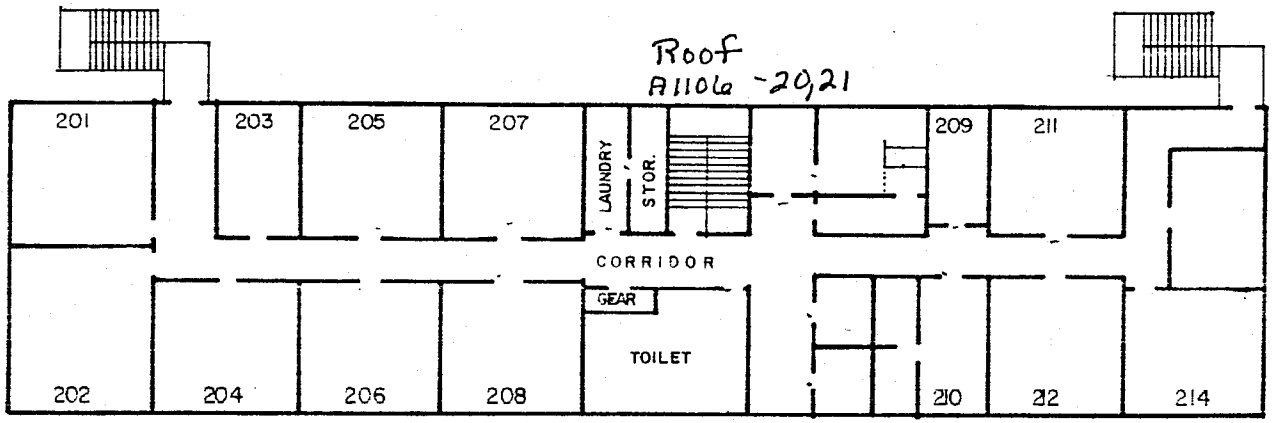

SECOND FLOOR PLAN

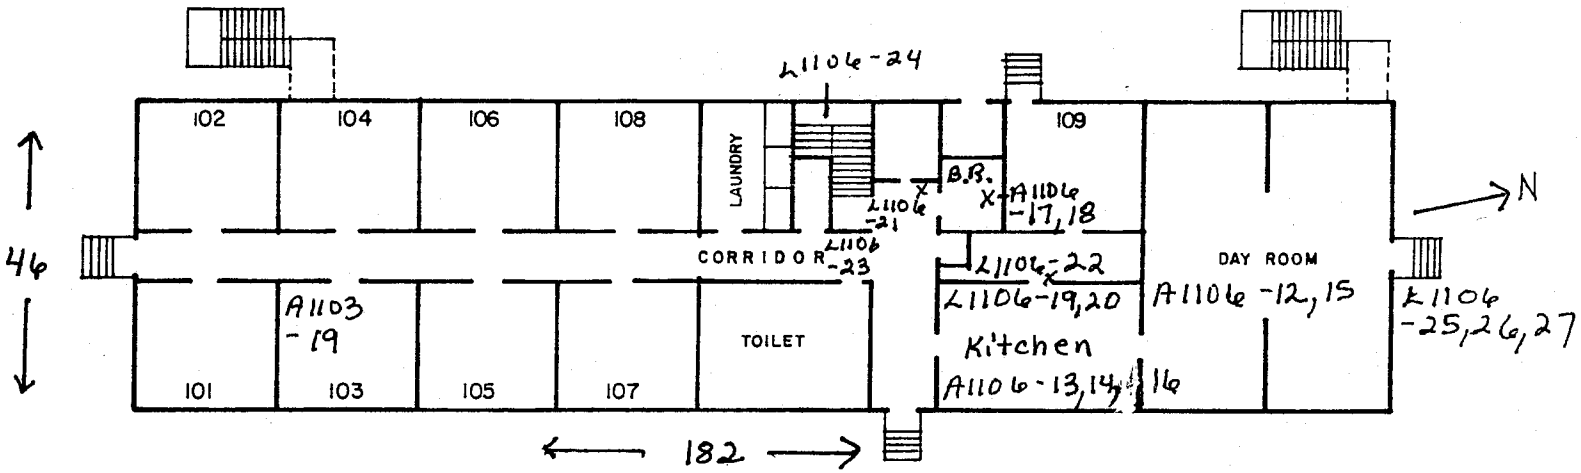

FIRST FLOOR PLAN

PIQUNIQ MANAGEMENT CORPORATION
NAVAL AIR FACILITY- MIDWAY ISLAND

BARRACKS BLDG. NO. 336

NBSTORMSROCT.

Asbestos Bulk Sampling Log
NAF Midway

THE SZARAS COMPANIES

 DATE SAMPLES COLLECTED: November 15, 1993

Building Number	Building Name	Building Description
340	Electrical Sub-Station	1 Story
TSC Project Number	**TSC Inspector**	**TSC Laboratory ID No.**
865	J. Kain and B. Kain	N/A

Sample ID No	Sample Location / Description	Analytical Results	Friable	Condition	Amount
No sample collected	Roof Corrugated transite panels Same as sample A1027-27, building 5182	45% Chrysotile	No	Good	400 sq. ft.

is assumed that anywhere the above identified asbestos containing building materials are found in the building, that those terials also contain asbestos and should be treated as such.

LEAD BASED PAINT SAMPLING LOG
NAF MIDWAY

THE SZAFRAS COMPANIES

 DATE SAMPLES COLLECTED: November 15, 1993

BUILDING NUMBER	BUILDING NAME	BUILDING DESCRIPTION
340	Electrical Sub-Station	1 Story
TSC PROJECT NUMBER	**TSC INSPECTOR**	**TSC LABORATORY ID NO.**
865	J. Kain and B. Kain	112393E

SAMPLE ID NO	SAMPLE LOCATION / DESCRIPTION	ANALYTICAL RESULTS (PPM)	CONDITION	AMOUNT
L1115-25	Exterior north side Brown paint on door	27,371.1	Poor	150 sq. ft.
No sample collected	Exterior Off-white paint on wall Same as sample L1115-23, building 9149	N/A	Good	750 sq. ft.

is assumed that anywhere the above identified lead based paint materials are found in the building, that those materials o contain lead and should be treated as such.

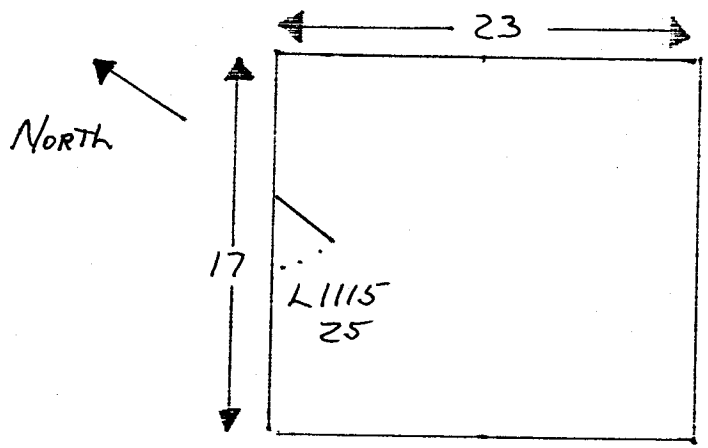

Bld # 340

Electrical
Sub Station

ASBESTOS BULK SAMPLING LOG
NAF MIDWAY

THE SZARAS COMPANIES

 DATE SAMPLES COLLECTED: November 16, 1993

BUILDING NUMBER	BUILDING NAME	BUILDING DESCRIPTION
342	Paint Shop	1 Story
TSC PROJECT NUMBER	**TSC INSPECTOR**	**TSC LABORATORY ID NO.**
865	J. Kain and B. Kain	113093A

SAMPLE ID NO	SAMPLE LOCATION / DESCRIPTION	ANALYTICAL RESULTS	FRIABLE	CONDITION	AMOUNT
	EXTERIOR:				
A1116-17	East side Coating on lower side	Tile - 1-2% Chrysotile Mastic - None detected	Yes	Poor	2,200 sq. ft.
No sample collected	Corrugated transite siding Same as sample A1116-14, building 343	35% Chrysotile	No	Good	3,500 sq. ft.
	INTERIOR:				
A1116-18	Office Green with white streaks 9" x 9" floor tile	Tile - None detected Mastic - 25% Chrysotile	No	Fair	240 sq. ft. mixed with A1116-19
A1116-19	Office Brown with white and orange streaks 9" x 9" floor tile	Tile - 1% Chrysotile Mastic - 12% Chrysotile	No	Fair	Mixed with A1116-18
A1116-20	Tractor storage Drywall	None detected	Yes	Poor	2,000 sq. ft.
	ROOF:				
A1116-21	Southeast side Roof core	None detected	No	Good	3,900 sq. ft.

" is assumed that anywhere the above identified asbestos containing building materials are found in the building, that those aterials also contain asbestos and should be treated as such.

LEAD BASED PAINT SAMPLING LOG
NAF MIDWAY

THE SZARAS COMPANIES

 DATE SAMPLES COLLECTED: November 16, 1993

BUILDING NUMBER	BUILDING NAME	BUILDING DESCRIPTION
342	Paint Shop	1 Story
TSC PROJECT NUMBER	**TSC INSPECTOR**	**TSC LABORATORY ID NO.**
865	J. Kain and B. Kain	113093B

SAMPLE ID NO	SAMPLE LOCATION / DESCRIPTION	ANALYTICAL RESULTS (PPM)	CONDITION	AMOUNT
	EXTERIOR:			
L1116-19	East side White paint on wall	34,763.9	Poor	4,600 sq. ft.
L1116-20	East side Brown paint on door	13,750.0	Fair	600 sq. ft.
	INTERIOR:			
L1116-21	Northeast side Beige paint on wall	11,473.7	Poor	2,000 sq. ft.
L1116-22	Open bay area north wall Beige paint on conduit	1,194.0	Poor	1,000 sq. ft.
L1116-23	Restroom south wall Red paint	10,940.7	Fair	650 sq. ft.
L1116-24	Office west wall Yellow paint	7,306.7	Fair	1,200 sq. ft.
L1116-25	Dope storage north wall Green paint	34,541.7	Poor	1,600 sq. ft.
L1116-26	Tractor storage north wall Orange paint	20,568.2	Fair	1,700 sq. ft.
L1116-27	South end on east wall Gray paint	32,527.8	Poor	1,700 sq. ft.

is assumed that anywhere the above identified lead based paint materials are found in the building, that those materials contain lead and should be treated as such.

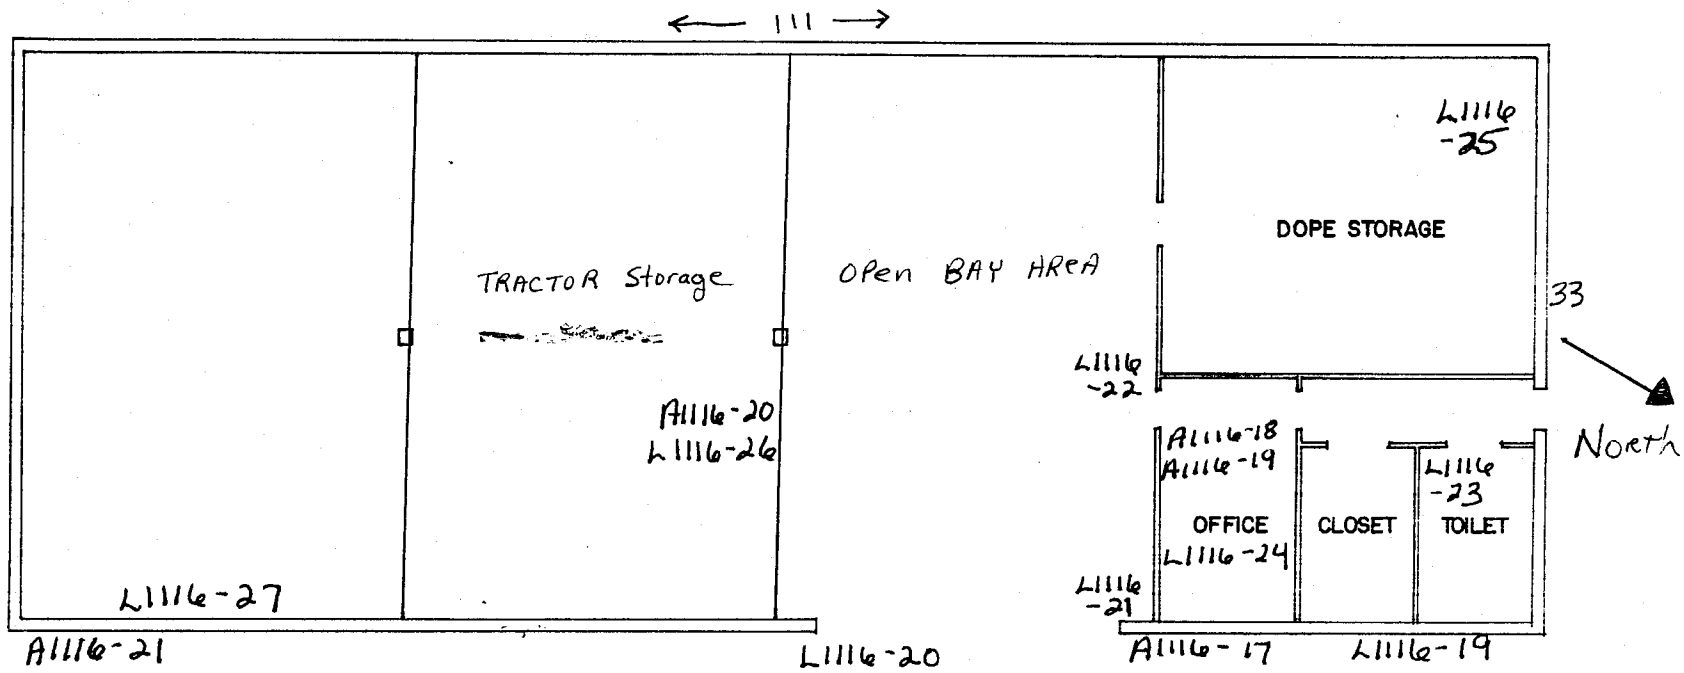

FLOOR PLAN

PIQUNIQ MANAGEMENT CORPORATION
NAVAL AIR FACILITY - MIDWAY ISLAND

PAINT SHOP, BLDG. NO. 342

NESCOR/MERCT.

Asbestos Bulk Sampling Log
NAF Midway

THE SZARAS COMPANIES

 DATE SAMPLES COLLECTED: November 16, 1993

BUILDING NUMBER	BUILDING NAME	BUILDING DESCRIPTION
343	Garage and HE Auto	1 Story
TSC PROJECT NUMBER	**TSC INSPECTOR**	**TSC LABORATORY ID NO.**
865	J. Kain and B. Kain	113093A

SAMPLE ID NO	SAMPLE LOCATION / DESCRIPTION	ANALYTICAL RESULTS	FRIABLE	CONDITION	AMOUNT
	INTERIOR:				
A1116-13	North end Black with white streaks 9" x 9" floor tile	Tile - 2% Chrysotile Mastic - 20% Chrysotile	No	Fair	660 sq. ft.
A1116-15	Southeast side Green with white streaks 9" x 9" floor tile	None detected	No	Poor	280 sq. ft.
	EXTERIOR:				
A1116-14	East side Corrugated transite siding	Tile - 35% Chrysotile Mastic - None detected	No	Fair	3,500 sq. ft.
A1116-16	Roof east side Roof core	Tile - 1-2% Chrysotile Mastic - 1-2% Chrysotile	No	Fair	7,500 sq. ft.

" is assumed that anywhere the above identified asbestos containing building materials are found in the building, that those aterials also contain asbestos and should be treated as such.

LEAD BASED PAINT SAMPLING LOG
NAF MIDWAY

THE SZARAS COMPANIES

 DATE SAMPLES COLLECTED: November 16, 1993

BUILDING NUMBER	BUILDING NAME	BUILDING DESCRIPTION
343	Garage and HE Auto Building	1 Story
TSC PROJECT NUMBER	**TSC INSPECTOR**	**TSC LABORATORY ID NO.**
865	J. Kain and B. Kain	113093B

SAMPLE ID NO	SAMPLE LOCATION / DESCRIPTION	ANALYTICAL RESULTS (PPM)	CONDITION	AMOUNT
	INTERIOR:			
L1116-15	Support poles Yellow paint	39,217.0	Poor	600 sq. ft.
L1116-16	Northeast wall White paint	91,147.9	Poor	9,500 sq. ft.
L1116-17	East wall Light green paint	2,795.8	Poor	1,900 sq. ft.
L1116-18	East wall Light gray paint	89,804.7	Poor	400 sq. ft.

is assumed that anywhere the above identified lead based paint materials are found in the building, that those materials contain lead and should be treated as such.

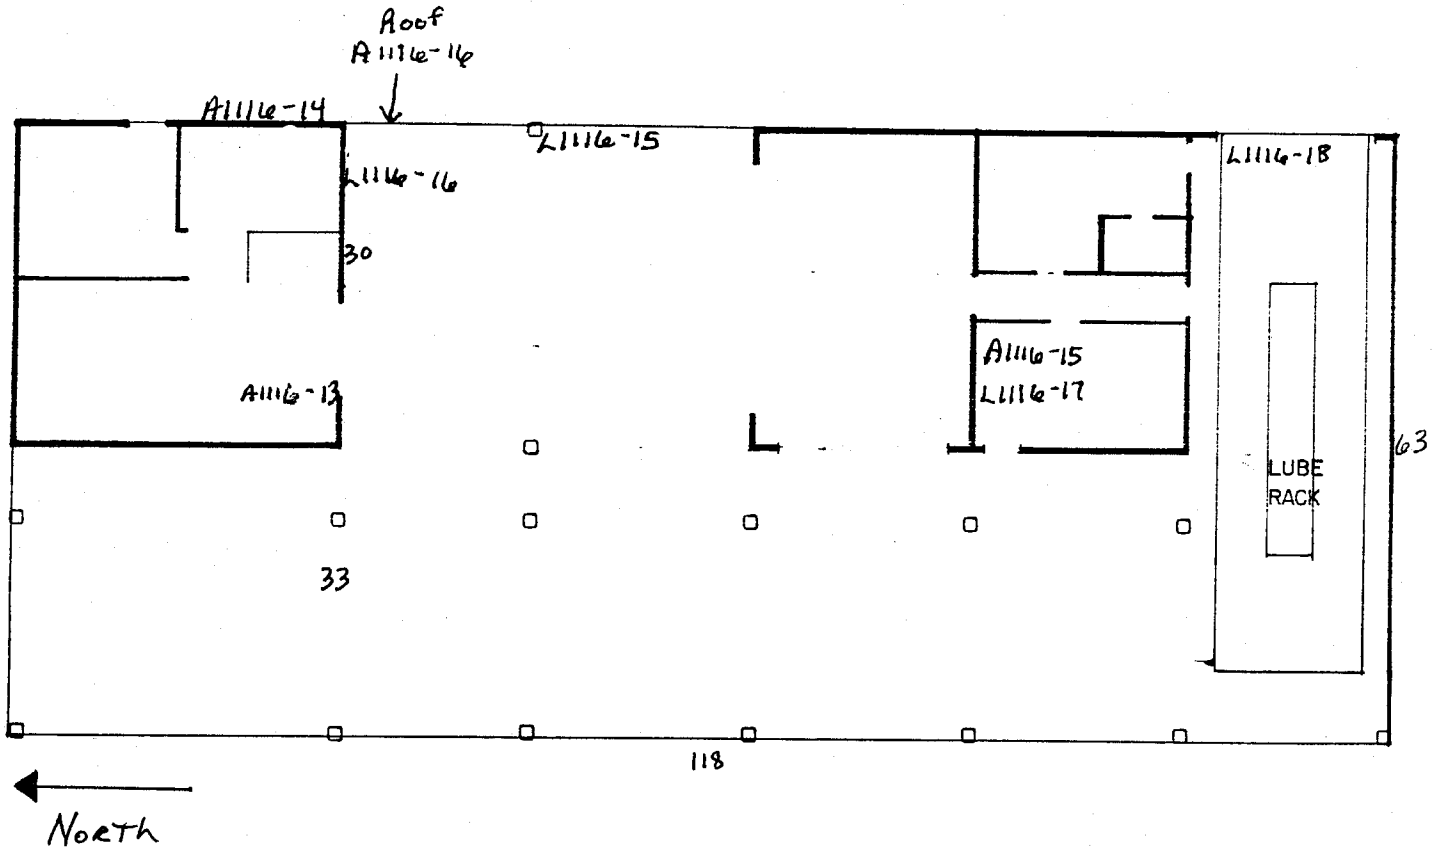

FLOOR PLAN

PIQUNIQ MANAGEMENT CORPORATION
NAVAL AIR FACILITY - MIDWAY ISLAND

GARAGE, HE AUTO BLDG. 343

ASBESTOS BULK SAMPLING LOG
NAF MIDWAY

THE SZARAS COMPANIES

 DATE SAMPLES COLLECTED: November 12, 1993

BUILDING NUMBER	BUILDING NAME	BUILDING DESCRIPTION
347	R-3 Chlorination Building	1 Story
TSC PROJECT NUMBER	**TSC INSPECTOR**	**TSC LABORATORY ID NO.**
865	J. Kain and B. Kain	112393N

SAMPLE ID NO	SAMPLE LOCATION / DESCRIPTION	ANALYTICAL RESULTS	FRIABLE	CONDITION	AMOUNT
	INTERIOR:				
A1112-18	Office east side Brown with orange and white streaks 9" x 9" floor tile	Tile - 2% Chrysotile Mastic - None detected	No	Fair	800 sq. ft. mixed with A1112-19 and 20
A1112-19	Office east side Black with white streaks 9" x 9" floor tile	Tile - 8% Chrysotile Mastic - None detected	No	Poor	Mixed with A1112-18 and 20
A1112-20	Storage with water heater east side Red with white streaks 9" x 9" floor tile	Tile - 6% Chrysotile Mastic - 5% Chrysotile	No	Poor	Mixed with A1112-18 and 19
A1112-21	Roof north side Roof core	None detected	No	Good	800 sq. ft.

is assumed that anywhere the above identified asbestos containing building materials are found in the building, that those erials also contain asbestos and should be treated as such.

LEAD BASED PAINT SAMPLING LOG
NAF MIDWAY

THE SZARAS COMPANIES

 DATE SAMPLES COLLECTED: November 12, 1993

BUILDING NUMBER	BUILDING NAME	BUILDING DESCRIPTION
347	R-3 Chlorination Building	1 Story
TSC PROJECT NUMBER	**TSC INSPECTOR**	**TSC LABORATORY ID NO.**
865	J. Kain and B. Kain	112393A

SAMPLE ID NO	SAMPLE LOCATION / DESCRIPTION	ANALYTICAL RESULTS (PPM)	CONDITION	AMOUNT
	EXTERIOR:			
L1112-38	North side White paint on wall	1,818.4	Fair	1,500 sq. ft.
L1112-39	North side Brown paint on door jamb and door	12,150.5	Fair	1,000 sq. ft.
L1112-40	North side Yellow paint on sidewalk	39,795.9	Fair	150 sq. ft.
	INTERIOR:			
L1112-41	North side chlorine room Red paint on floor	205,684.2	Fair	70 sq. ft.
L1112-42	East side office Light brown paint on wall	2,902.0	Fair	250 sq. ft.
L1112-43	East side office White paint on window	23,833.3	Fair	800 sq. ft.
L1112-44	East side Blue paint on door frame/ceiling	417.2	Fair	2,000 sq. ft.

is assumed that anywhere the above identified lead based paint materials are found in the building, that those materials contain lead and should be treated as such.

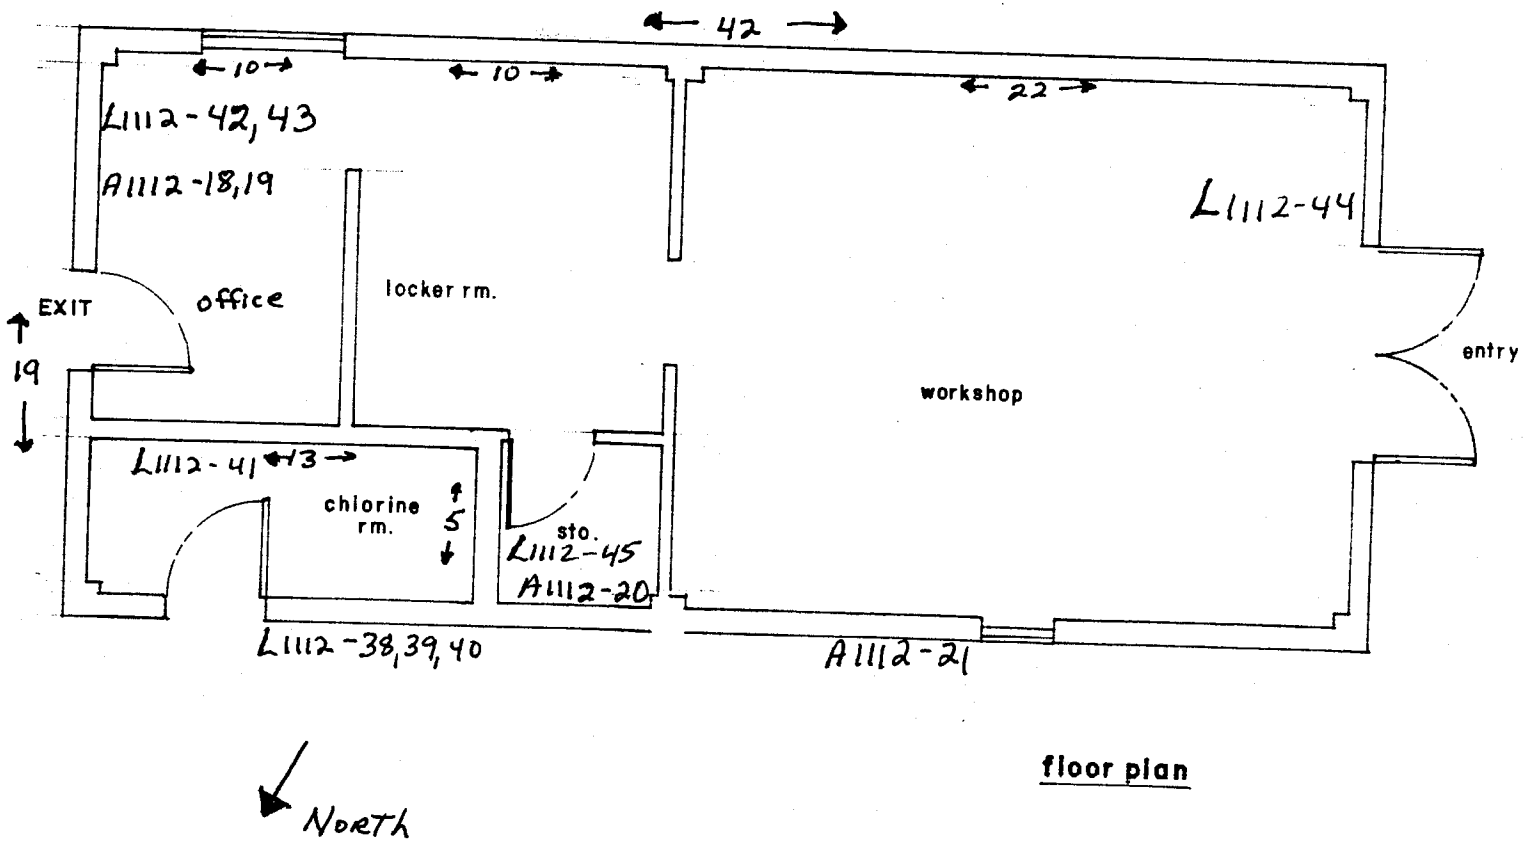

floor plan

PIQUNIQ MANAGEMENT CORP.
NAVAL AIR FACILITY - MIDWAY ISLAND

R-3 CHLORINATION BLDG. 347

ASBESTOS BULK SAMPLING LOG
NAF MIDWAY

THE SZARAS COMPANIES

 DATE SAMPLES COLLECTED: November 16, 1993

BUILDING NUMBER	BUILDING NAME	BUILDING DESCRIPTION
348	PW Administration Shop	2 Story
TSC PROJECT NUMBER	**TSC INSPECTOR**	**TSC LABORATORY ID NO.**
865	J. Kain and B. Kain	113093A

SAMPLE ID NO	SAMPLE LOCATION / DESCRIPTION	ANALYTICAL RESULTS	FRIABLE	CONDITION	AMOUNT
	INTERIOR 1ST FLOOR:				
A1116-1	East hallway Green with beige streaks 9" x 9" floor tile	Tile - 2% Chrysotile Mastic - 5% Chrysotile	No	Fair	7,200 sq. ft.
A1116-2	East stairwell Black stairtread	None detected	No	Good	150 sq. ft.
A1116-3	Southeast side Black with beige and green streaks 9" x 9" floor tile	Tile - 8% Chrysotile Mastic - 0% Chrysotile	No	Fair	2,000 sq. ft.
A1116-4	Southeast side Drywall and tape	None detected	Yes	Poor	25,000 sq. ft.
A1116-5	Southwest side Red with white streaks 9" x 9" floor tile	Tile - 12% Chrysotile Mastic - 2% Chrysotile	No	Fair	700 sq. ft.
A1116-6	West side Black stairtread	None detected	No	Poor	50 sq. ft.
A1116-7	West side 1' x 1' ceiling tile and mastic	None detected	No	Fair	800 sq. ft.
A1116-8	West side Brown with orange and white streaks 9" x 9" floor tile	<1% Chrysotile	No	Fair	800 sq. ft.
A1116-9	SAFC Room Gray with white streaks 9" x 9" floor tile	<1% Chrysotile	No	Fair	25 sq. ft.
No sample collected	Tagged with asbestos tag: One torn bag of asbestos cloth; cloth wrap (improperly bagged): Notified Safety	N/A			

is assumed that anywhere the above identified asbestos containing building materials are found in the building, that those terials also contain asbestos and should be treated as such.

ASBESTOS BULK SAMPLING LOG
NAF MIDWAY

THE SZARAS COMPANIES

 DATE SAMPLES COLLECTED: November 16, 1993

BUILDING NUMBER	BUILDING NAME	BUILDING DESCRIPTION
348	PW Administration Shop	2 Story
TSC PROJECT NUMBER	**TSC INSPECTOR**	**TSC LABORATORY ID NO.**
865	J. Kain and B. Kain	113093A

SAMPLE ID NO	SAMPLE LOCATION / DESCRIPTION	ANALYTICAL RESULTS	FRIABLE	CONDITION	AMOUNT
	EXTERIOR:				
A1116-10	Roof west side Core and rock roof	None detected	No	Fair	6,800 sq. ft.
A1116-11	Roof south end Roof core	None detected	No	Fair	250 sq. ft.
A1116-12	South side Concrete Material	None detected	No	Poor	1,300 sq. ft.

It is assumed that anywhere the above identified asbestos containing building materials are found in the building, that those materials also contain asbestos and should be treated as such.

LEAD BASED PAINT SAMPLING LOG
NAF MIDWAY

THE SZARAS COMPANIES

 DATE SAMPLES COLLECTED: November 16, 1993

BUILDING NUMBER	BUILDING NAME	BUILDING DESCRIPTION
348	PW Administration Shop	2 Story
TSC PROJECT NUMBER	**TSC INSPECTOR**	**TSC LABORATORY ID NO.**
865	J. Kain and B. Kain	113093B

SAMPLE ID NO	SAMPLE LOCATION / DESCRIPTION	ANALYTICAL RESULTS (PPM)	CONDITION	AMOUNT
	INTERIOR 1st FLOOR:			
L1116-1	Hallway east side Off-white paint on wall	29,502.7	Poor	6,600 sq. ft.
L1116-2	Hallway east side Burgundy paint bottom 4 ft. of wall	9,475.8	Poor	6,400 sq. ft.
L1116-3	Stairway east side Black paint on riser	82,100.5	Poor	150 sq. ft.
L1116-4	Stairway east side Beige paint on riser	61,652.8	Poor	300 sq. ft.
L1116-5	Door east side Blue paint	3,317.2	Poor	300 sq. ft.
L1116-6	West wall southeast side (lower half) Blue/gray paint	2,196.2	Poor	1,650 sq. ft.
L1116-7	West wall southeast side (upper half) White paint	1,305.1	Poor	6,800 sq. ft.
L1116-8	North wall southeast side Off-white paint	1,037.2	Poor	2,400 sq. ft.
L1116-9	Wall southwest side Blue/gray paint	3,528.6	Poor	1,200 sq. ft.
L1116-10	West wall center of building Light gray paint	1,578.8	Poor	1,650 sq. ft.
L1116-11	West wall southwest side of building Yellow paint	5,058.3	Poor	800 sq. ft.
L1116-12	West end of hall Light green paint on wall	3,197.2	Poor	6,500 sq. ft.

It is assumed that anywhere the above identified lead based paint materials are found in the building, that those materials also contain lead and should be treated as such.

LEAD BASED PAINT SAMPLING LOG
NAF MIDWAY

THE SZARAS COMPANIES

 DATE SAMPLES COLLECTED: November 16, 1993

BUILDING NUMBER	BUILDING NAME	BUILDING DESCRIPTION
348	PW Administration Shop	2 Story
TSC PROJECT NUMBER	**TSC INSPECTOR**	**TSC LABORATORY ID NO.**
865	J. Kain and B. Kain	113093B

SAMPLE ID NO	SAMPLE LOCATION / DESCRIPTION	ANALYTICAL RESULTS (PPM)	CONDITION	AMOUNT
	EXTERIOR:			
L1116-13	West wall Blue paint	129,285.7	Poor	1,300 sq. ft.
L1116-14	West side White paint on wall	12,812.5	Poor	1,300 sq. ft.
	Note: 2nd floor is collapsing and unsafe for entry. No samples or measurements taken.			

is assumed that anywhere the above identified lead based paint materials are found in the building, that those materials contain lead and should be treated as such.

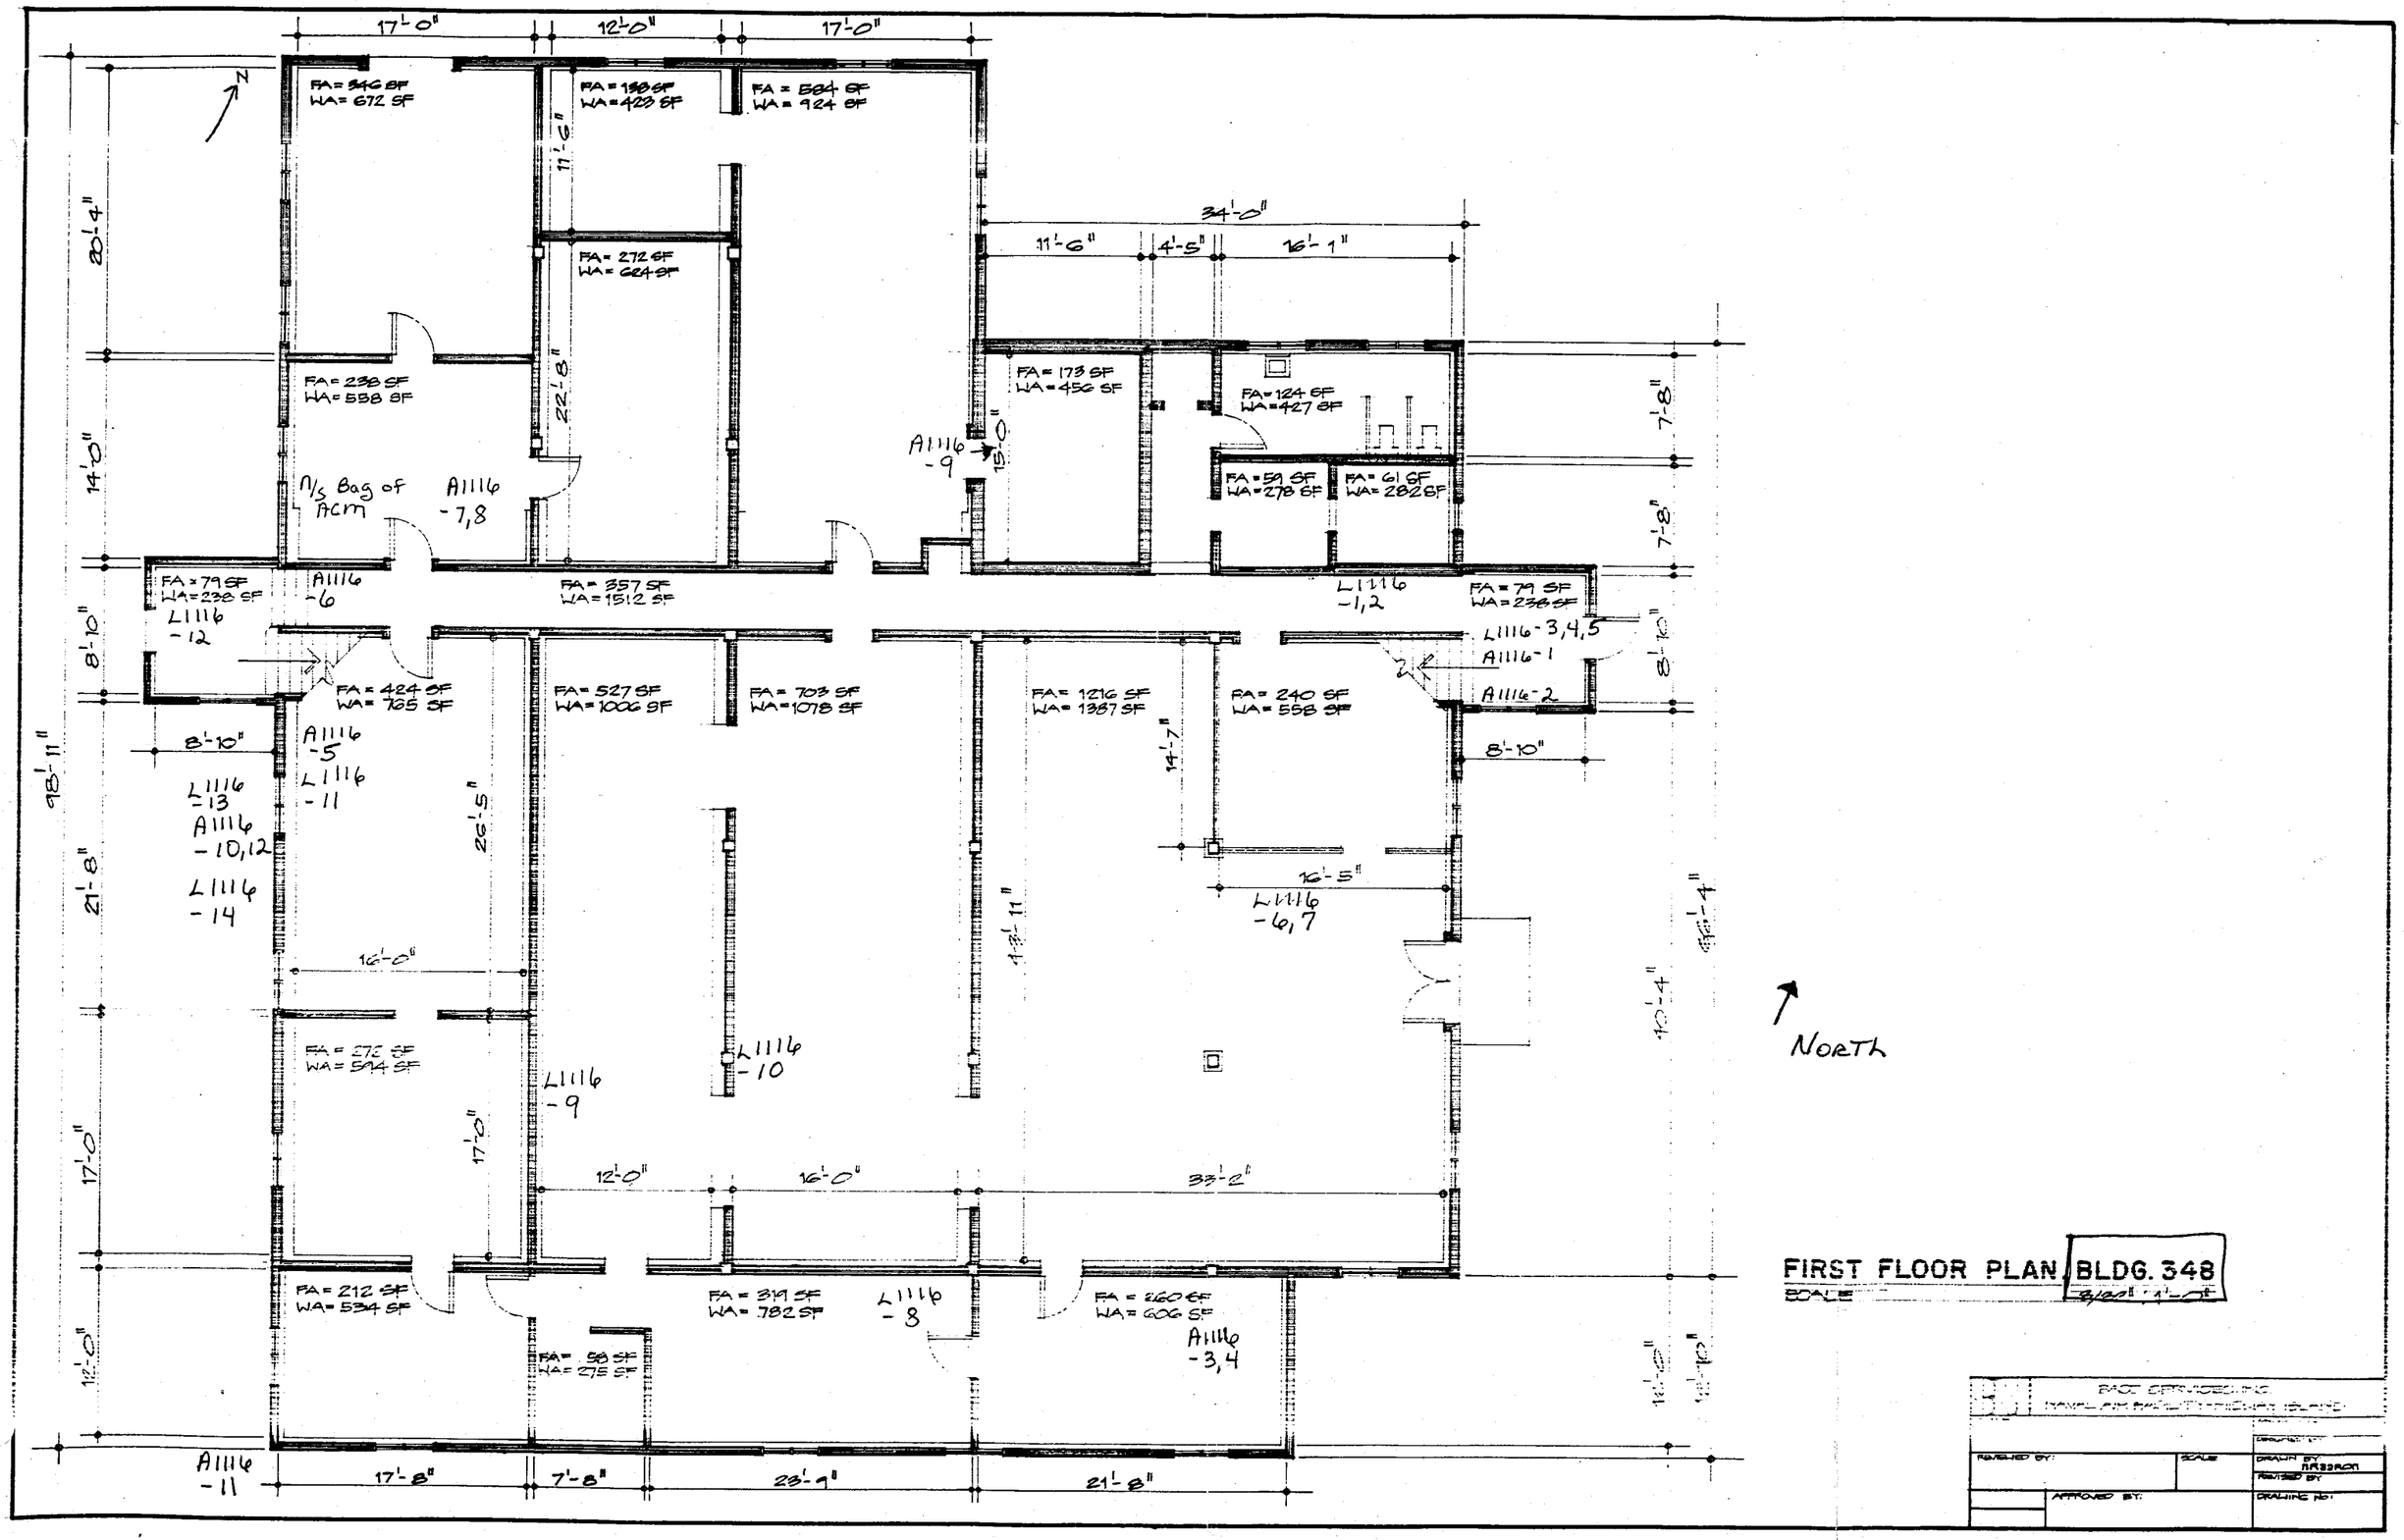
17'-0"
12'-0"
17'-0"
FA = 546 SF
WA = 672 SF
FA = 198 SF
WA = 423 SF
FA = 584 SF
WA = 924 SF
11'-6"
FA = 272 SF
WA = 624 SF
34'-0"
11'-6"
4'-5"
16'-1"
20'-4"
FA = 238 SF
WA = 558 SF
22'-8"
FA = 173 SF
WA = 456 SF
FA = 124 SF
WA = 427 SF
A1116
-9
15'-0"
7'-8"
14'-0"
N/S Bag of ACM
A1116
-7,8
FA = 59 SF
WA = 278 SF
FA = 61 SF
WA = 282 SF
7'-8"
FA = 79 SF
WA = 238 SF
A1116
-6
FA = 357 SF
WA = 1512 SF
L1116
-1,2
FA = 79 SF
WA = 238 SF
L1116
-12
L1116-3,4,5
A1116-1
8'-10"
8'-10"
FA = 424 SF
WA = 725 SF
FA = 527 SF
WA = 1006 SF
FA = 703 SF
WA = 1078 SF
FA = 1216 SF
WA = 1387 SF
FA = 240 SF
WA = 558 SF
A1116-2
8'-10"
8'-10"
A1116
-5
L1116
-11
98'-11"
L1116
-13
A1116
-10,12
L1116
-14
26'-5"
14'-7"
16'-5"
L1116
-6,7
21'-8"
16'-0"
11'-8"
40'-4"
40'-4"
FA = 272 SF
WA = 594 SF
L1116
-9
L1116
-10
17'-0"
17'-0"
12'-0"
16'-0"
33'-2"
NORTH
FA = 212 SF
WA = 534 SF
FA = 319 SF
WA = 782 SF
L1116
-8
FA = 260 SF
WA = 606 SF
A1116
-3,4
FA = 58 SF
WA = 275 SF
12'-0"
12'-0"
12'-10"
A1116
-11
17'-8"
7'-8"
23'-9"
21'-8"
FIRST FLOOR PLAN BLDG. 348
SCALE 1/8" = 1'-0"
DRAWN BY
REVISED BY
DRAWING NO.
APPROVED BY:
SCALE

Asbestos Bulk Sampling Log
NAF Midway

THE SZARAS COMPANIES

 DATE SAMPLES COLLECTED: November 18, 1993

BUILDING NUMBER	BUILDING NAME	BUILDING DESCRIPTION
349	Galley Warehouse	1 Story
TSC PROJECT NUMBER	**TSC INSPECTOR**	**TSC LABORATORY ID NO.**
865	J. Kain and B. Kain	113093F

SAMPLE ID NO	SAMPLE LOCATION / DESCRIPTION	ANALYTICAL RESULTS	FRIABLE	CONDITION	AMOUNT
	EXTERIOR:				
No sample collected	Front only Corrugated transite siding Same as sample A1117-34, building 9146	22% Chrysotile	No	Good	1,700 sq. ft.
	INTERIOR:				
A1118-20	Freeze box #1 east side White concrete material on wall	None detected	No	Poor	5,000 sq. ft.
A1118-21	Freeze box #3 west side Concrete on wall	None detected	No	Fair	5,000 sq. ft.
A1118-22	Office north side Black with beige 9" x 9" floor tile	Tile - 15% Chrysotile Mastic - 8% Chrysotile	No	Good	120 sq. ft.

is assumed that anywhere the above identified asbestos containing building materials are found in the building, that those erials also contain asbestos and should be treated as such.

Lead Based Paint Sampling Log
NAF Midway

THE SZARAS COMPANIES

 DATE SAMPLES COLLECTED: November 18, 1993

Building Number	Building Name	Building Description
349	Galley Warehouse	1 Story
TSC Project Number	**TSC Inspector**	**TSC Laboratory ID No.**
865	J. Kain and B. Kain	113093E

Sample ID No	Sample Location / Description	Analytical Results (ppm)	Condition	Amount
	EXTERIOR:			
L1118-31	East wall Beige paint	104.0	Good	3,600 sq. ft.
L1118-32	Northeast side Red deck paint	128,055.5	Good	100 sq. ft.
L1118-33	Loading dock northeast side Brown paint on trim	61,485.0	Good	800 sq. ft.
L1118-40	West side Silver paint on air handler	170.2	Good	250 sq. ft.
	INTERIOR:			
L1118-34	Restroom west wall Glossy off-white paint	40,720.0	Good	950 sq. ft.
L1118-35	Freeze box #1 east wall White paint	57.6	Poor	5,000 sq. ft.
L1118-36	Chill box #2 south wall Off-white paint	68,225.0	Fair	5,000 sq. ft.
L1118-37	Chill box #3 Gray paint on door	6,960.0	Poor	500 sq. ft.
L1118-38	Dry storage west side White paint on wall	111,377.5	Fair	11,000 sq. ft.
L1118-39	Hall northwest side White paint on wall	7,465.0	Fair	1,500 sq. ft.
No sample collected	Electrical room Gray paint on voltage box Same as sample L1118-29, building 360	282,397.9	Good	300 sq. ft.

It is assumed that anywhere the above identified lead based paint materials are found in the building, that those materials also contain lead and should be treated as such.

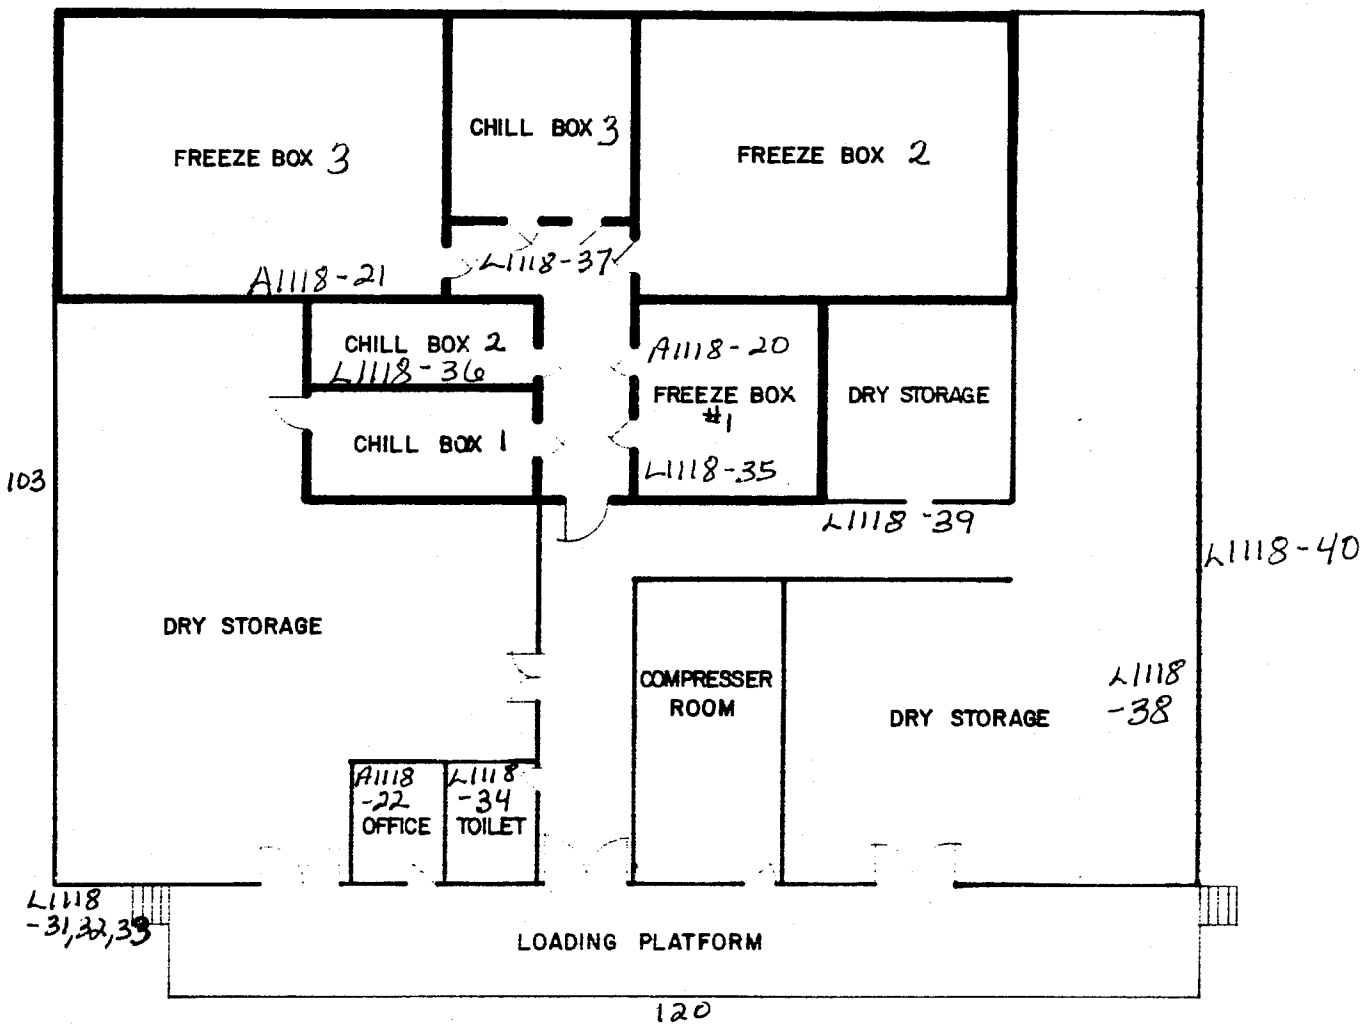

FLOOR PLAN

N

PIQUNIQ MANAGEMENT CORPORATION
NAVAL AIR FACILITY – MIDWAY ISLAND

GALLEY WAREHOUSE, BLDG. 549

Asbestos Bulk Sampling Log
NAF Midway

THE SZARAS COMPANIES

 DATE SAMPLES COLLECTED: November 17, 1993

Building Number	Building Name	Building Description
350	Electrical Sub-Station	1 Story
TSC Project Number	**TSC Inspector**	**TSC Laboratory ID No.**
865	J. Kain and B. Kain	N/A

Sample ID No	Sample Location / Description	Analytical Results	Friable	Condition	Amount
No sample collected	Roof Corrugated transite panels Same as sample A1117-34, building 9146	22% Chrysotile	No	Fair	400 sq. ft.

is assumed that anywhere the above identified asbestos containing building materials are found in the building, that those erials also contain asbestos and should be treated as such.

LEAD BASED PAINT SAMPLING LOG
NAF MIDWAY

THE SZARAS COMPANIES

 DATE SAMPLES COLLECTED: November 17, 1993

BUILDING NUMBER	BUILDING NAME	BUILDING DESCRIPTION
350	Electrical Sub-Station	1 Story
TSC PROJECT NUMBER	**TSC INSPECTOR**	**TSC LABORATORY ID NO.**
865	J. Kain and B. Kain	113093C

SAMPLE ID NO	SAMPLE LOCATION / DESCRIPTION	ANALYTICAL RESULTS (PPM)	CONDITION	AMOUNT
	INTERIOR:			
L1117-63	North door Green paint	159,382.3	Fair	75 sq. ft.
L1117-64	Light green paint on beams and door jamb	119,561.8	Fair	200 sq. ft.
L1117-65	North side Gray paint on transformer	281,887.7	Good	300 sq. ft.
	EXTERIOR:			
L1117-66	West side Off-white paint on wall	40,210.8	Good	650 sq. ft.
L1117-67	North side Brown paint on door	214,825.6	Good	75 sq. ft.

is assumed that anywhere the above identified lead based paint materials are found in the building, that those materials contain lead and should be treated as such.

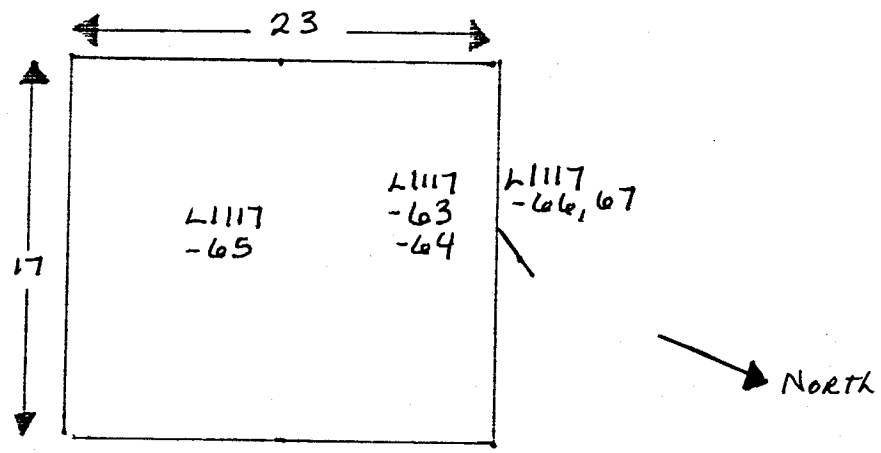

BLDG. #350 Electrical Sub Station

Asbestos Bulk Sampling Log
NAF Midway

THE SZARAS COMPANIES

 DATE SAMPLES COLLECTED: November 16, 1993

BUILDING NUMBER	BUILDING NAME	BUILDING DESCRIPTION
353	Carpenter Shop	1 Story
TSC PROJECT NUMBER	**TSC INSPECTOR**	**TSC LABORATORY ID NO.**
865	J. Kain and B. Kain	113093A

SAMPLE ID NO	SAMPLE LOCATION / DESCRIPTION	ANALYTICAL RESULTS	FRIABLE	CONDITION	AMOUNT
A1116-22	Roof northwest side Roof core	None detected	No	Good	6,000 sq. ft.
	INTERIOR:				
A1116-23	East side Green with white and dark green flecks: 9" x 9" floor tile	Tile - 2% Chrysotile Mastic - 8% Chrysotile	No	Good	288 sq. ft.
A1116-24	Sink room east side Beige with white 12" x 12" floor tile	None detected	No	Good	25 sq. ft.
A1116-25	Office east side Brown with white 9" x 9" floor tile under carpet	<1% Chrysotile	No	Fair	225 sq. ft.

It is assumed that anywhere the above identified asbestos containing building materials are found in the building, that those materials also contain asbestos and should be treated as such.

LEAD BASED PAINT SAMPLING LOG
NAF MIDWAY

THE SZARAS COMPANIES

 DATE SAMPLES COLLECTED: November 16, 1993

BUILDING NUMBER	BUILDING NAME	BUILDING DESCRIPTION
353	Carpenter Shop	1 Story
TSC PROJECT NUMBER	**TSC INSPECTOR**	**TSC LABORATORY ID NO.**
865	J. Kain and B. Kain	113093B

SAMPLE ID NO	SAMPLE LOCATION / DESCRIPTION	ANALYTICAL RESULTS (PPM)	CONDITION	AMOUNT
	INTERIOR:			
L1116-28	Work shop north wall Off-white paint on wall and ceiling	1,670.8	Fair	9,900 sq. ft.
L1116-29	Workshop east wall Blue paint	159,948.9	Good	1,500 sq. ft.
L1116-30	Workshop door north side Brown paint	124,833.3	Poor	1,500 sq. ft.
	EXTERIOR:			
L1116-31	North side Off-white paint on wall	692.3	Good	3,850 sq. ft.

. is assumed that anywhere the above identified lead based paint materials are found in the building, that those materials) contain lead and should be treated as such.

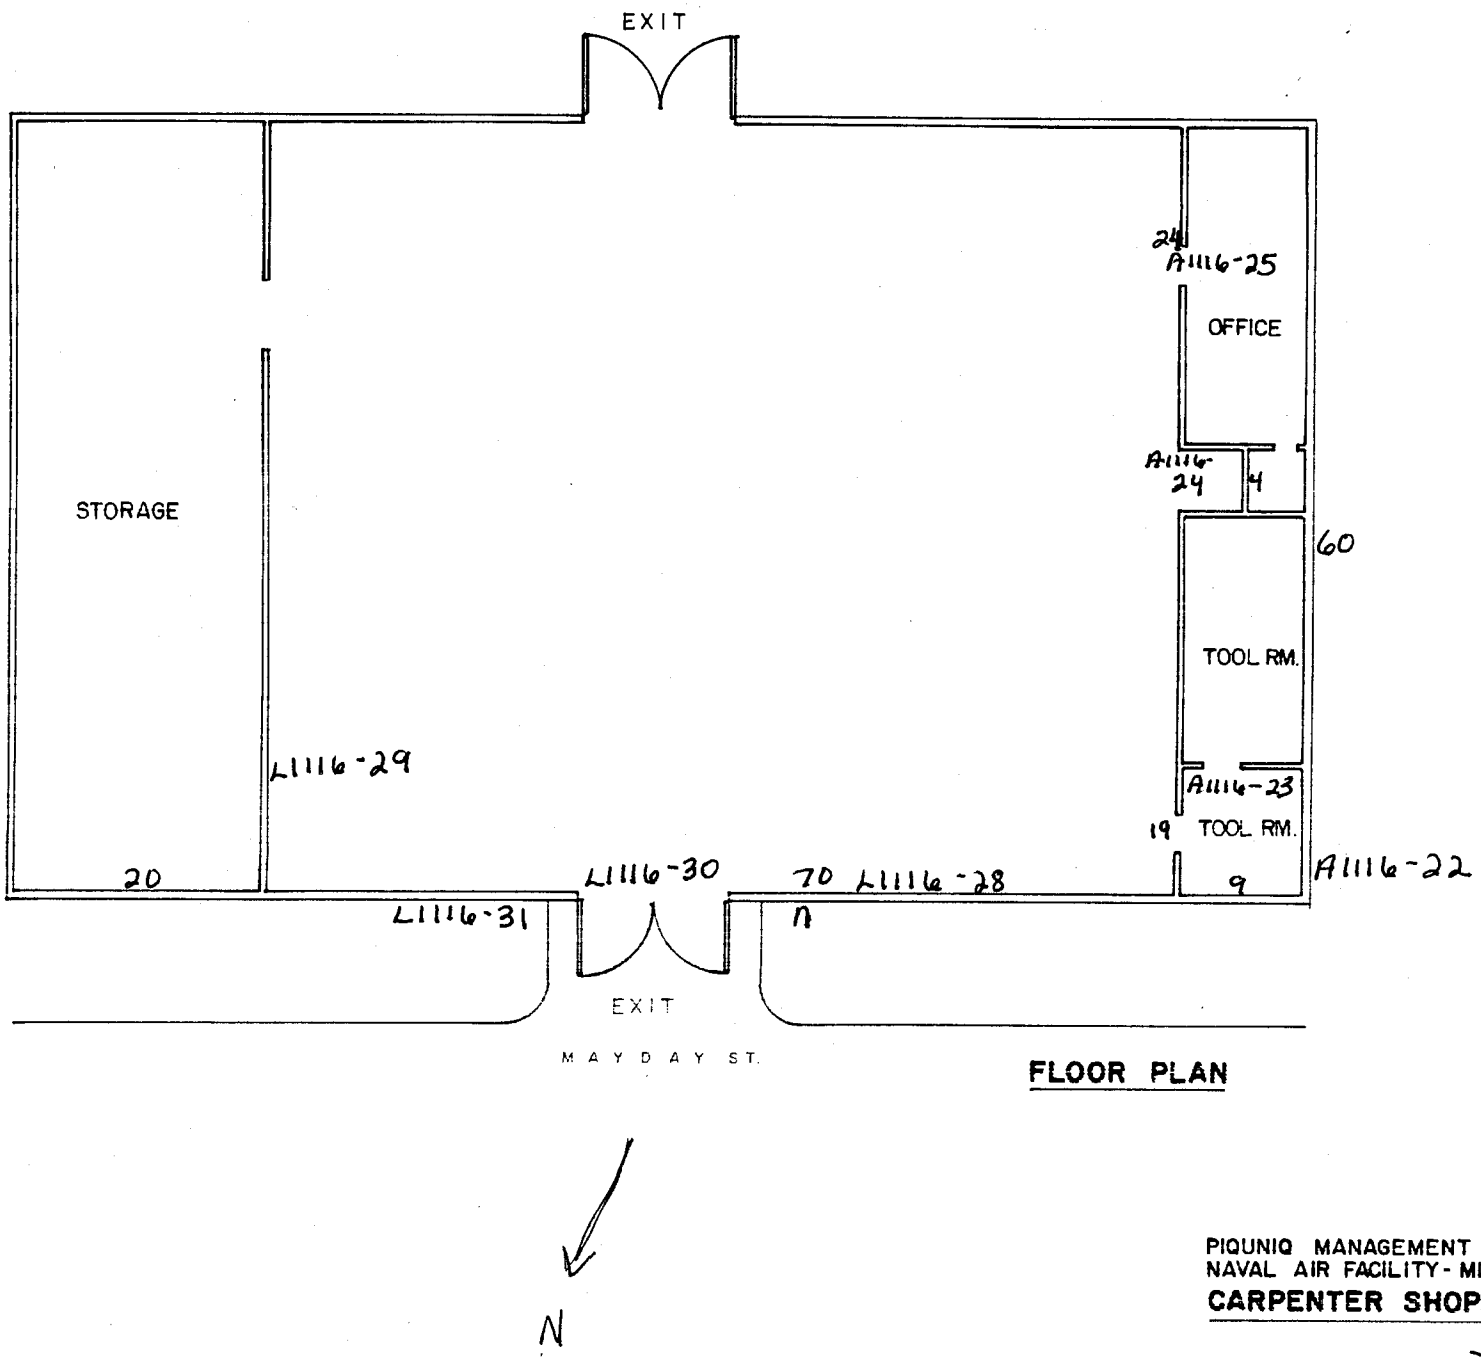

FLOOR PLAN

PIQUNIQ MANAGEMENT CORPORATION
NAVAL AIR FACILITY - MIDWAY ISLAND
CARPENTER SHOP, B. 353

25 SEPT. 92 NESTORVM

Asbestos Bulk Sampling Log
NAF Midway

THE SZARAS COMPANIES

 DATE SAMPLES COLLECTED: November 15, 1993

BUILDING NUMBER	BUILDING NAME	BUILDING DESCRIPTION
354	Old Power Plant	2 Story
TSC PROJECT NUMBER	**TSC INSPECTOR**	**TSC LABORATORY ID NO.**
865	J. Kain and B. Kain	112393M

SAMPLE ID NO	SAMPLE LOCATION / DESCRIPTION	ANALYTICAL RESULTS	FRIABLE	CONDITION	AMOUNT
No sample collected	East side exterior Transit panels Same as sample A1114-4, building 3512	20% Chrysotile	No	Fair	300 sq. ft.
No sample collected	Exterior Corrugated transite panel Same as sample A1027-27, building 5182	45% Chrysotile	No	Fair	700 sq. ft.
A1115-16	West side exterior Concrete	None detected	No	Poor	Unknown
	Note: The building is not safe for entry; doors are welded closed.				

assumed that anywhere the above identified asbestos containing building materials are found in the building, that those erials also contain asbestos and should be treated as such.

LEAD BASED PAINT SAMPLING LOG
NAF MIDWAY

THE SZARAS COMPANIES

 DATE SAMPLES COLLECTED: November 15, 1993

BUILDING NUMBER	BUILDING NAME	BUILDING DESCRIPTION
354	Old Power Plant	2 Story
TSC PROJECT NUMBER	**TSC INSPECTOR**	**TSC LABORATORY ID NO.**
865	J. Kain and B. Kain	112393E

SAMPLE ID NO	SAMPLE LOCATION / DESCRIPTION	ANALYTICAL RESULTS (PPM)	CONDITION	AMOUNT
L1115-16	Exterior west side Green paint on wall	47,032.9	Poor	Unknown
L1115-17	Exterior south side Red paint on concrete pad	4,708.8	Poor	150 sq. ft.

is assumed that anywhere the above identified lead based paint materials are found in the building, that those materials contain lead and should be treated as such.

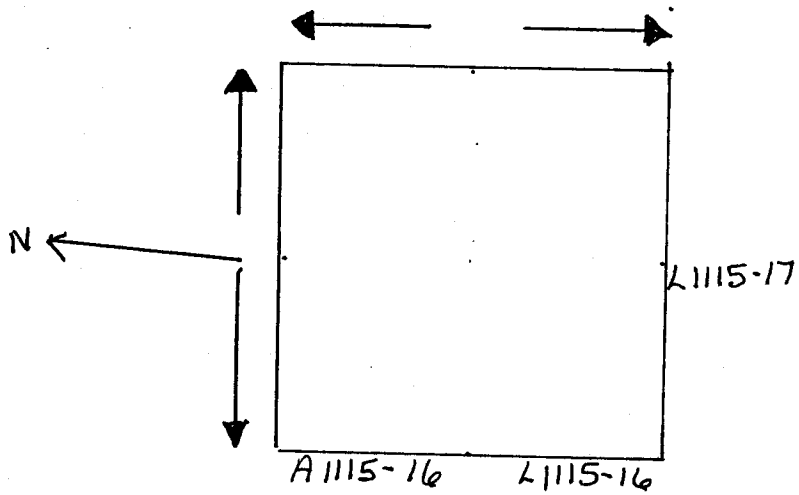

BLDG #354 / Power Plant

~~Doors~~ Welded Closed

Unsafe to be Close to

ASBESTOS BULK SAMPLING LOG
NAF MIDWAY

THE SZARAS COMPANIES | PAGE 1 of 1 | DATE SAMPLES COLLECTED: November 17 & 26th, 1993

BUILDING NUMBER	BUILDING NAME	BUILDING DESCRIPTION
356	Electrical Shop and Parking Garage	1 Story
TSC PROJECT NUMBER	**TSC INSPECTOR**	**TSC LABORATORY ID NO.**
865	J. Kain and B. Kain	113093D

SAMPLE ID NO	SAMPLE LOCATION / DESCRIPTION	ANALYTICAL RESULTS	FRIABLE	CONDITION	AMOUNT
	INTERIOR:				
A1117-6	Restroom north side 2' x 4' suspended ceiling tile	None detected	Yes	Good	120 sq. ft.
A1117-7	Restroom north side Off-white with brown & white flecks 12" x 12" floor tile	None detected	No	Good	400 sq. ft.
A1117-8	Office southwest side Green with white streaks 9" x 9" floor tile	None detected	No	Good	120 sq. ft.
A1117-9	Storage room Black with white streaks 9" x 9" floor tile	1-2% Chrysotile	No	Poor	1,000 sq. ft.
	ROOF:				
A1126-3	Core and rock northwest side	None detected	No	Good	48,000 sq. ft.
A1126-4	Tar on vent east side	3% Chrysotile	No	Good	200 sq. ft.

"It is assumed that anywhere the above identified asbestos containing building materials are found in the building, that those materials also contain asbestos and should be treated as such.

LEAD BASED PAINT SAMPLING LOG
NAF MIDWAY

THE SZARAS COMPANIES

 DATE SAMPLES COLLECTED: November 16, 1993

BUILDING NUMBER	BUILDING NAME	BUILDING DESCRIPTION
356	Electrical Shop and Parking Garage	1 Story
TSC PROJECT NUMBER	**TSC INSPECTOR**	**TSC LABORATORY ID NO.**
865	J. Kain and B. Kain	113093B

SAMPLE ID NO	SAMPLE LOCATION / DESCRIPTION	ANALYTICAL RESULTS (PPM)	CONDITION	AMOUNT
	INTERIOR:			
L1116-18	Wall dividing parking and vault northeast side Off-white paint on wall	89,804.7	Fair	4,800 sq. ft.
L1116-19	Northeast side White paint on beam	34,763.9	Fair	2,700 sq. ft.
L1116-20	Wall dividing parking and vault northeast side White paint	13,750.0	Good	2,400 sq. ft.
L1116-21	Ceiling northeast side Yellow paint	11,473.7	Poor	12,000 sq. ft.
L1116-22	Center north end wall White paint	1,194.0	Fair	6,200 sq. ft.
L1116-23	Southwest side Brown paint on beam	10,940.7	Good	2,700 sq. ft.
L1116-25	Electrical room south side Gray paint on wall	34,541.7	Fair	1,400 sq. ft.
	EXTERIOR:			
L1116-24	Southwest side Off-white paint on wall	7,306.7	Fair	3,600 sq. ft.

is assumed that anywhere the above identified lead based paint materials are found in the building, that those materials contain lead and should be treated as such.

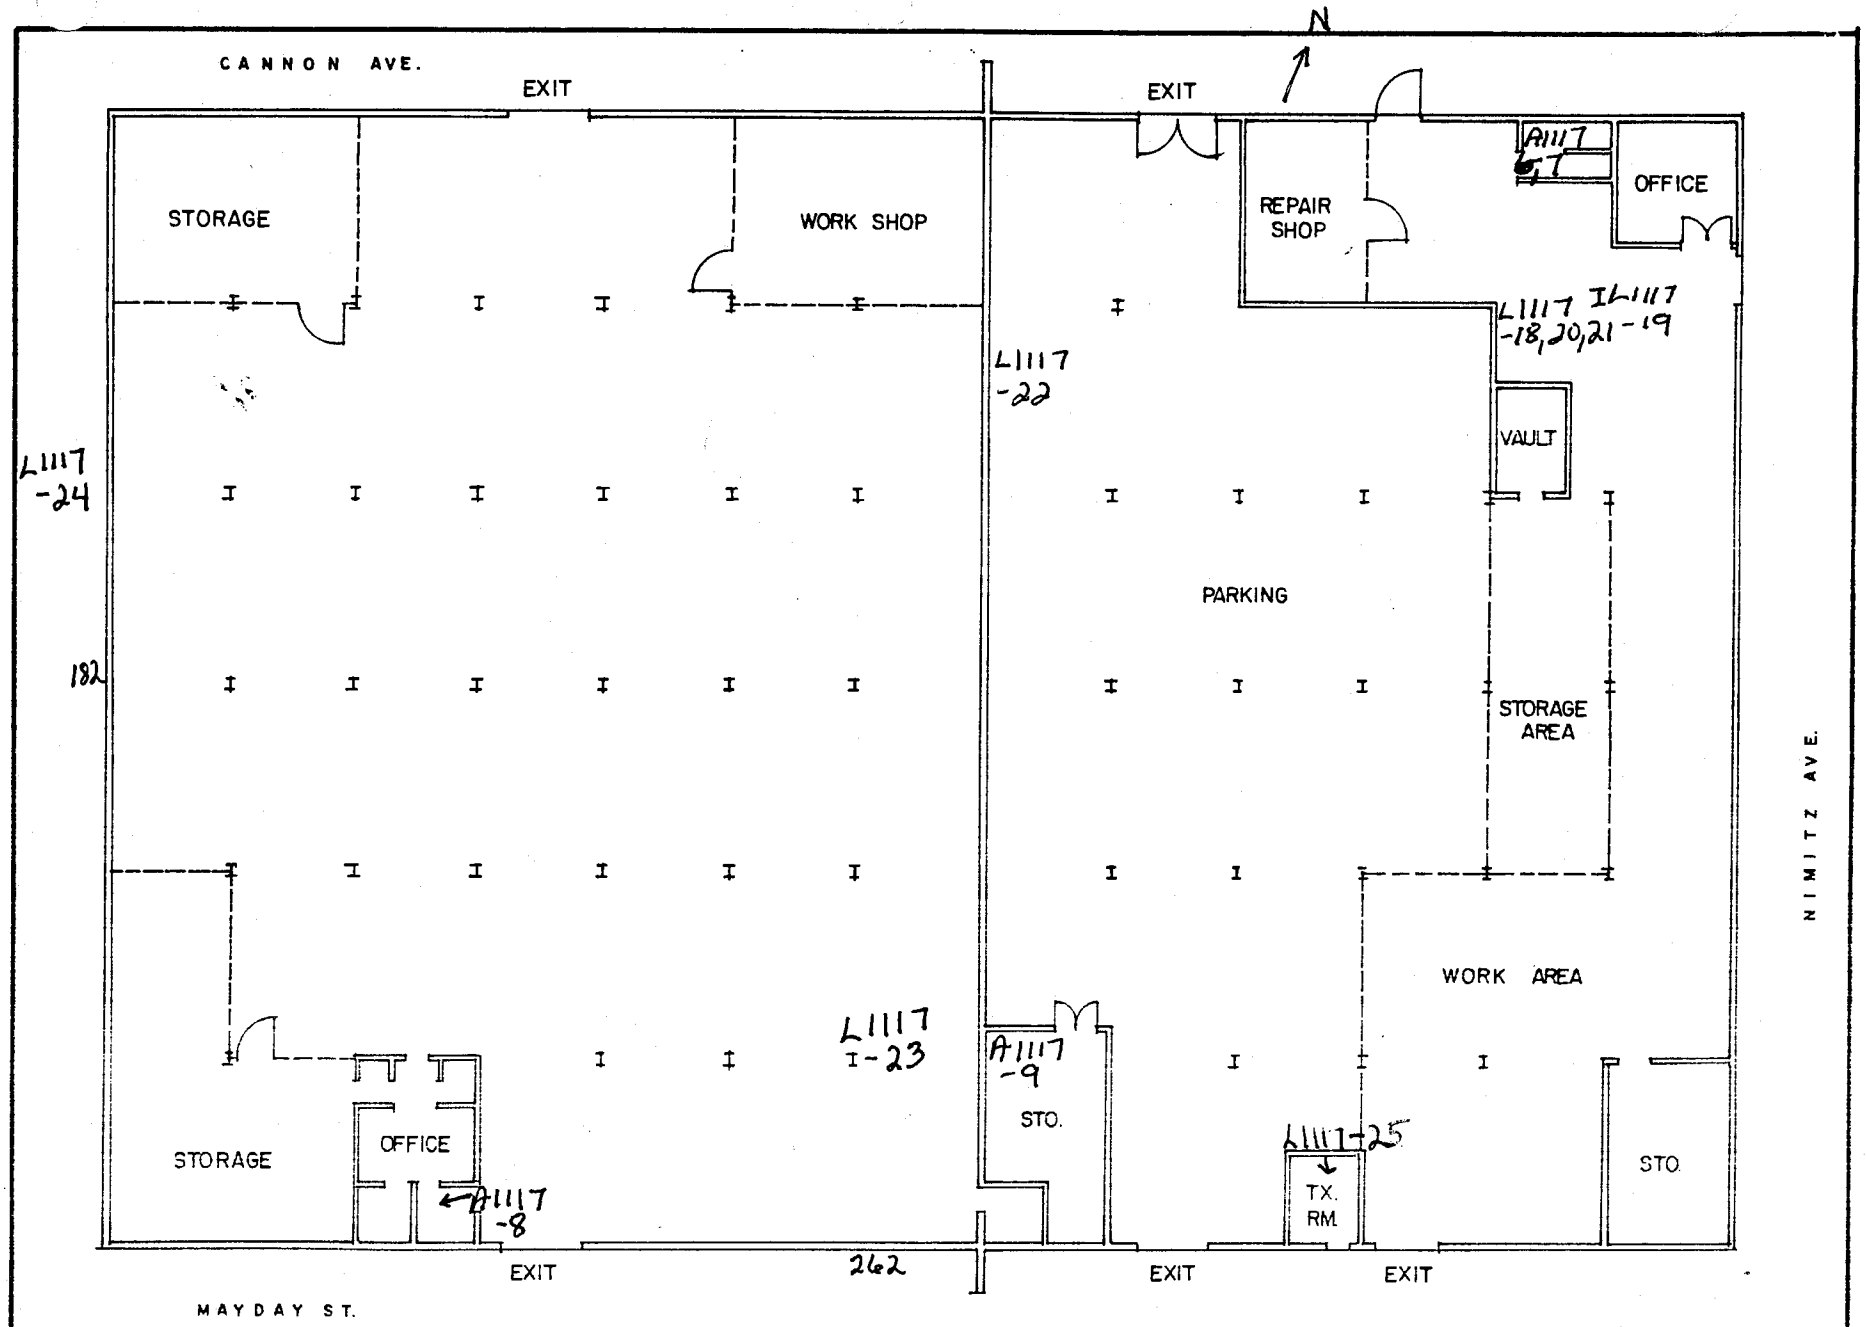

FLOOR PLAN

PIQUNIQ MANAGEMENT CORPORATION
NAVAL AIR FACILITY - MIDWAY ISLAND
ELECTRICAL SHOP/PARKING GARAGE
BLDG. NO. 356

NESTORMATER

ASBESTOS BULK SAMPLING LOG
NAF MIDWAY

THE SZARAS COMPANIES

 DATE SAMPLES COLLECTED: November 17, 1993

BUILDING NUMBER	BUILDING NAME	BUILDING DESCRIPTION
357	Machine Shop	1 Story
TSC PROJECT NUMBER	**TSC INSPECTOR**	**TSC LABORATORY ID NO.**
865	J. Kain and B. Kain	113093D

SAMPLE ID NO	SAMPLE LOCATION / DESCRIPTION	ANALYTICAL RESULTS	FRIABLE	CONDITION	AMOUNT
	INTERIOR:				
A1117-37	Office west side Brown with yellow flecks 9" x 9" floor tile	Tile - 8% Chrysotile Mastic - 25% Chrysotile	No	Good	190 sq. ft.
A1117-38	Lounge north side Brown with orange & white streaks 9" x 9" floor tile	Tile - 2% Chrysotile Mastic - 20% Chrysotile	No	Fair	400 sq. ft.
A1117-39	Workshop northwest side Black with white streaks 9" x 9" floor tile	Tile - 4% Chrysotile Mastic - 12%	No	Poor	425 sq. ft.
A1126-7	Roof Core and rock roof	None detected	No	Good	8,300 sq. ft.

It is assumed that anywhere the above identified asbestos containing building materials are found in the building, that those aterials also contain asbestos and should be treated as such.

LEAD BASED PAINT SAMPLING LOG
NAF MIDWAY

THE SZARAS COMPANIES

 DATE SAMPLES COLLECTED: November 17, 1993

BUILDING NUMBER	BUILDING NAME	BUILDING DESCRIPTION
357	Machine Shop	1 Story
TSC PROJECT NUMBER	**TSC INSPECTOR**	**TSC LABORATORY ID NO.**
865	J. Kain and B. Kain	113093C

SAMPLE ID NO	SAMPLE LOCATION / DESCRIPTION	ANALYTICAL RESULTS (PPM)	CONDITION	AMOUNT
	INTERIOR:			
L1117-54	Office west wall White paint	34,972.8	Good	1,350 sq. ft.
L1117-55	Restroom west wall Light brown paint	3,858.2	Good	1,350 sq. ft.
L1117-56	Drain pipe east wall Gray paint	115,937.5	Fair	2,000 sq. ft.
L1117-57	Storage room south wall Black paint	3,976.2	Fair	1,200 sq. ft.
L1117-58	Storage room west wall Green paint	10,219.8	Poor	1,200 sq. ft.
L1117-59	Work shop northeast wall White paint	75,384.6	Fair	2,900 sq. ft.
L1117-60	Material storage west side Beige with yellow paint on wall	4,905.5	Poor	500 sq. ft.
	EXTERIOR:			
L1117-61	Upper section north side Beige paint on wall	119,320.6	Poor	8,200 sq. ft.
L1117-62	Lower section north side Off-white paint on wall	1,263.6	Good	4,200 sq. ft.

is assumed that anywhere the above identified lead based paint materials are found in the building, that those materials contain lead and should be treated as such.

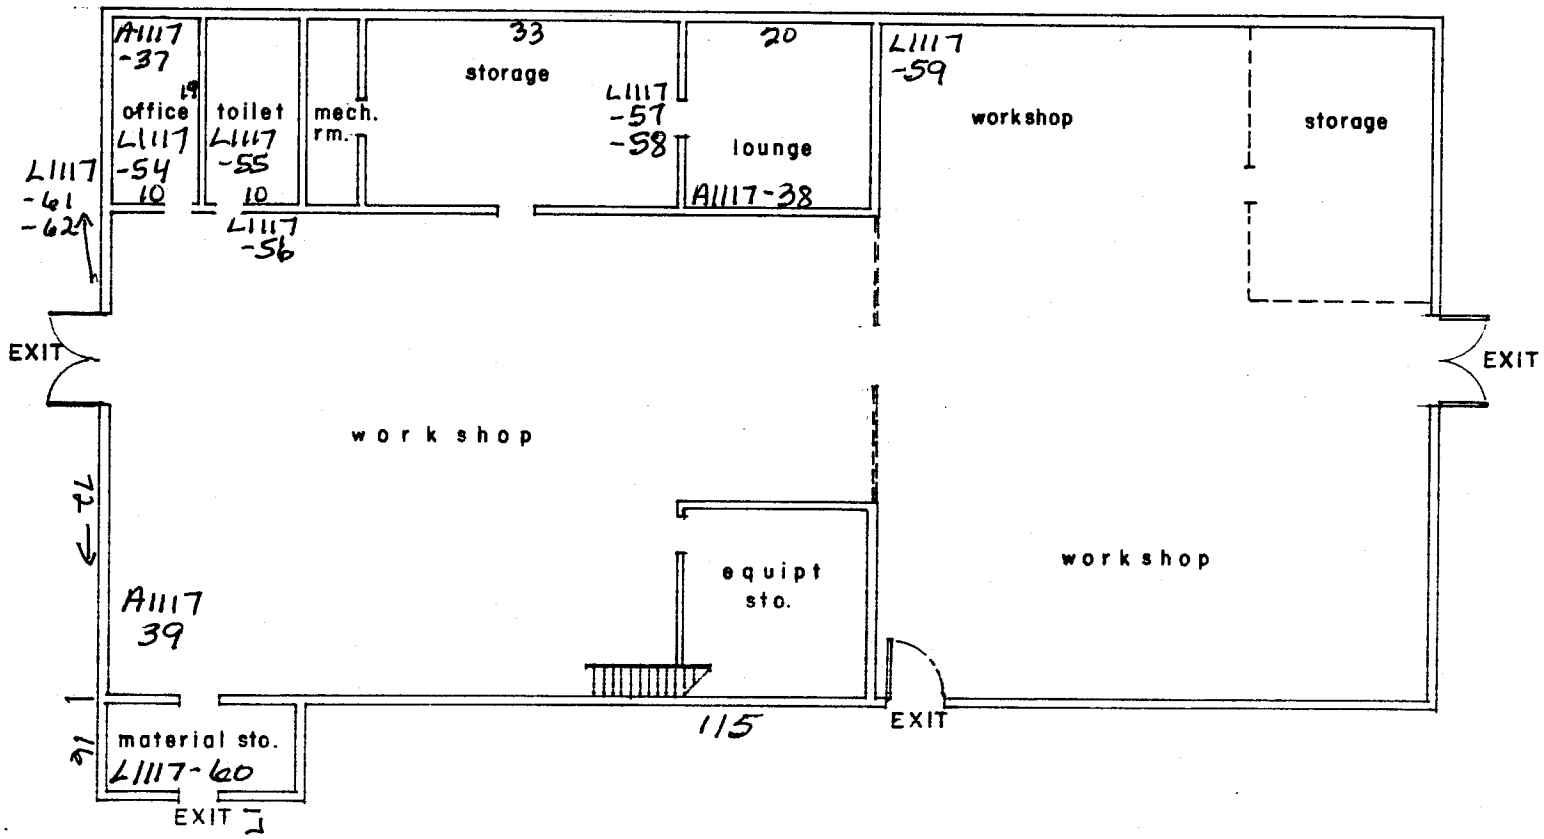

floor plan

PIQUNIQ MANAGEMENT CORP.
NAVAL AIR FACILITY-MIDWAY ISLAND

STEEL SHOP BLDG. 357

09 sept 91
mvarinas

ASBESTOS BULK SAMPLING LOG
NAF MIDWAY

THE SZARAS COMPANIES

 DATE SAMPLES COLLECTED: November 18, 1993

BUILDING NUMBER	BUILDING NAME	BUILDING DESCRIPTION
360	Electrical Sub-Station	1 Story
TSC PROJECT NUMBER	**TSC INSPECTOR**	**TSC LABORATORY ID NO.**
865	J. Kain and B. Kain	N/A

SAMPLE ID NO	SAMPLE LOCATION / DESCRIPTION	ANALYTICAL RESULTS	FRIABLE	CONDITION	AMOUNT
No sample collected	Roof Corrugated transite Same as sample A1117-34, building 9146	22% Chrysotile	No	Good	450 sq. ft.

is assumed that anywhere the above identified asbestos containing building materials are found in the building, that those erials also contain asbestos and should be treated as such.

LEAD BASED PAINT SAMPLING LOG
NAF MIDWAY

THE SZARAS COMPANIES

 DATE SAMPLES COLLECTED: November 18, 1993

BUILDING NUMBER	BUILDING NAME	BUILDING DESCRIPTION
360	Electrical Sub-Station	1 Story
TSC PROJECT NUMBER	**TSC INSPECTOR**	**TSC LABORATORY ID NO.**
865	J. Kain and B. Kain	113093E

SAMPLE ID NO	SAMPLE LOCATION / DESCRIPTION	ANALYTICAL RESULTS (PPM)	CONDITION	AMOUNT
	INTERIOR:			
L1118-29	Center Gray paint on switches	282,397.9	Good	200 sq. ft.
	EXTERIOR:			
No sample collected	Brown paint on door Same as sample L1117-67, building 350	214,825.6	Good	150 sq. ft.
L1118-30	South side Off-white paint on wall	2,330.8	Good	100 sq. ft.

. is assumed that anywhere the above identified lead based paint materials are found in the building, that those materials contain lead and should be treated as such.

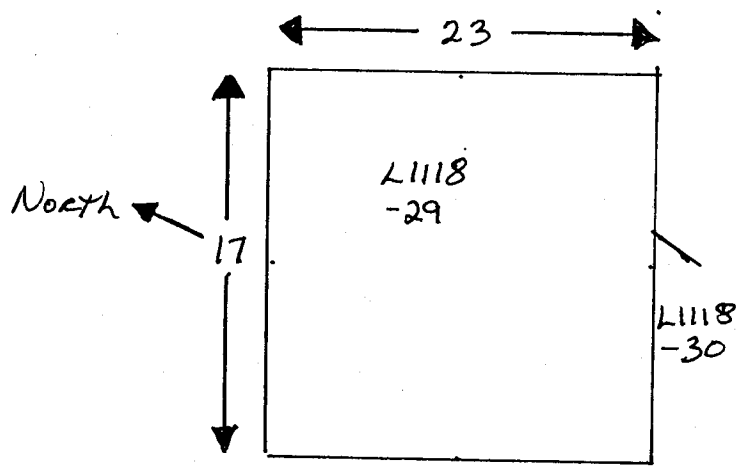

BLDG. #360 Electrical Sub Station

Asbestos Bulk Sampling Log
NAF Midway

THE SZARAS COMPANIES

 DATE SAMPLES COLLECTED: November 18, 1993

Building Number	Building Name	Building Description
363	Diesel Maintenance Shop	1 Story
TSC Project Number	**TSC Inspector**	**TSC Laboratory ID No.**
865	J. Kain and B. Kain	113093F

Sample ID No	Sample Location / Description	Analytical Results	Friable	Condition	Amount
	EXTERIOR:				
No sample collected	Wall Corrugated transite siding Same as sample A1105-4, building 5309	15% Chrysotile	No	Good	8,500 sq. ft.
A1118-16	North side Tar seal on bottom of transite	None detected	No	Fair	1,000 sq. ft.
A1118-17	Storage room east side Black with beige streaks 9" x 9" floor tile	Tile - 5% Chrysotile Mastic - 12% Chrysotile	No	Good	2,000 sq. ft. mixed with A1118-18
A1118-18	Storage room east side Green with beige streaks 9" x 9" floor tile	Tile - 15% Chrysotile Mastic - 12% Chrysotile	No	Good	Mixed with A1118-17
A1119-19	Restroom west side Beige with shades of brown flecks 12" x 12" floor tile	Tile - 1% Chrysotile Mastic - 2% Chrysotile	No	Fair	300 sq. ft.
	Note: A1118-18 green is under A1118-19				
	ROOF:				
A1126-5	Northwest side core	None detected	No	Good	7,500 sq. ft.
A1126-6	Northwest side Tar seal on 3x3 roof hatch	None detected	No	Good	1,000 sq. ft.

is assumed that anywhere the above identified asbestos containing building materials are found in the building, that those erials also contain asbestos and should be treated as such.

LEAD BASED PAINT SAMPLING LOG
NAF MIDWAY

THE SZARAS COMPANIES

 DATE SAMPLES COLLECTED: November 18, 1993

BUILDING NUMBER	BUILDING NAME	BUILDING DESCRIPTION
363	Diesel Maintenance Shop	1 Story
TSC PROJECT NUMBER	**TSC INSPECTOR**	**TSC LABORATORY ID NO.**
865	J. Kain and B. Kain	113093E

SAMPLE ID NO	SAMPLE LOCATION / DESCRIPTION	ANALYTICAL RESULTS (PPM)	CONDITION	AMOUNT
	EXTERIOR:			
L1118-21	North side Off-white paint on wall	6,947.4	Fair	5,600 sq. ft.
L1118-22	North side Gray paint on door	202,760.4	Poor	300 sq. ft.
	INTERIOR:			
L1118-23	East side Green paint on wall	28,358.6	Fair	3,800 sq. ft.
L1118-24	Storage room east side Dark green paint on door	148,775.0	Fair	800 sq. ft.
L1118-25	Storage room east side White paint on walls	273,453.6	Fair	14,000 sq. ft.
L1118-26	Restroom west side White paint on wall	40,918.4	Poor	2,800 sq. ft.
L1118-27	West side Gray paint on floor	262,164.9	Poor	5,000 sq. ft.
L1118-28	West side Gray paint on wall	7,348.5	Poor	6,000 sq. ft.

is assumed that anywhere the above identified lead based paint materials are found in the building, that those materials contain lead and should be treated as such.

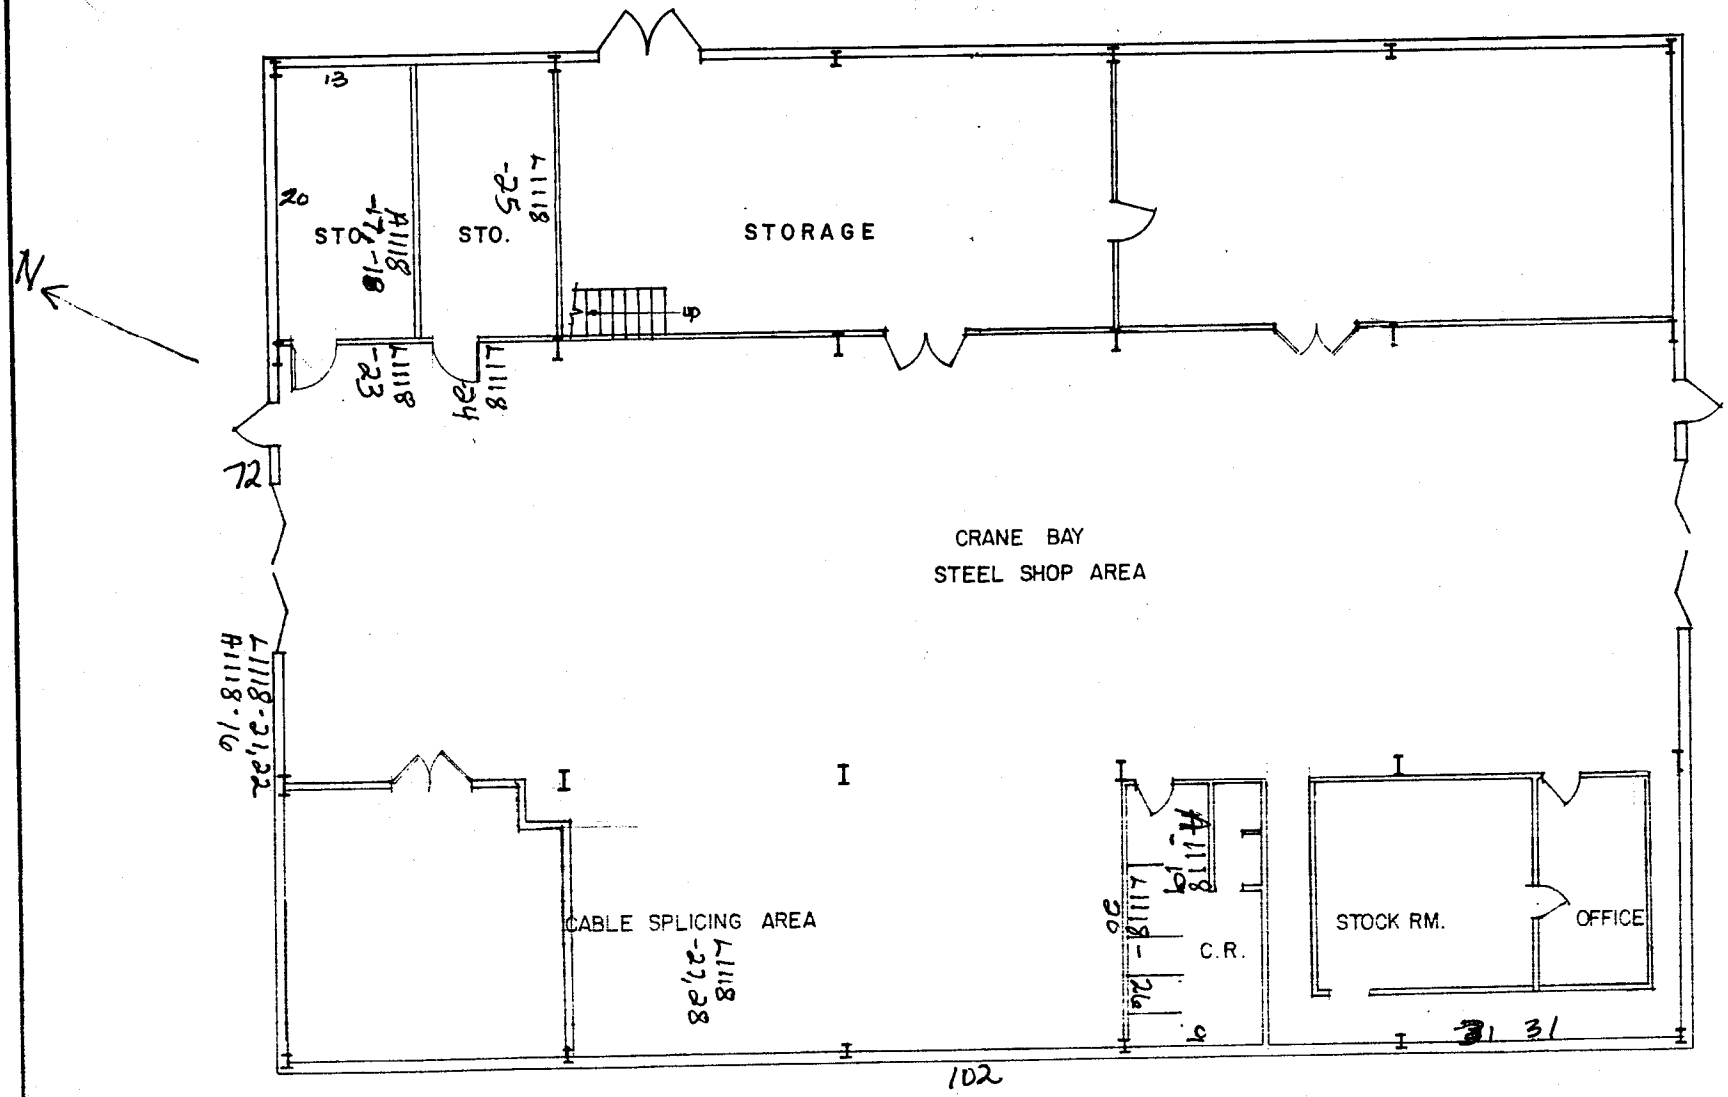

FLOOR PLAN

PIQUNIQ MANAGEMENT CORPORATION
NAVAL AIR FACILITY- MIDWAY ISLAND

DIESEL MAINTENACE SHOP

BLDG. 365

Asbestos Bulk Sampling Log
NAF Midway

THE SZARAS COMPANIES

 DATE SAMPLES COLLECTED: November 17, 1993

UILDING NUMBER	BUILDING NAME	BUILDING DESCRIPTION
365	Abandoned Laundry	1 Story
TSC PROJECT NUMBER	**TSC INSPECTOR**	**TSC LABORATORY ID NO.**
865	J. Kain and B. Kain	113093D

SAMPLE ID NO	SAMPLE LOCATION / DESCRIPTION	ANALYTICAL RESULTS	FRIABLE	CONDITION	AMOUNT
A1117-27	Roof west side under tin roof Rolled roof	None detected	No	Poor	12,000 sq. ft.
	INTERIOR:				
A1117-28	Storage Brown sheet vinyl	None detected	Yes	Poor	200 sq. ft.
A1117-29	Restroom Green with shades of green streaks 9" x 9" floor tile	Tile - 10% Chrysotile Mastic - 15% Chrysotile	No	Poor	20 sq. ft.
A1117-30	Receiving area east end Green with white flecks 9" x 9" floor tile	Tile - 15% Chrysotile Mastic - 12% Chrysotile	No	Fair	300 sq. ft.
A1117-31	Office northeast end Beige with brown and white streaks 9" x 9" floor tile	Tile - 15% Chrysotile Mastic - 5% Chrysotile	No	Fair	200 sq. ft.
A1117-32	Entry northeast end Beige with gray streaks 12" x 12" floor tile	Tile - 5% Chrysotile Mastic - 20% Chrysotile	No	Fair	100 sq. ft.

" is assumed that anywhere the above identified asbestos containing building materials are found in the building, that those aterials also contain asbestos and should be treated as such.

LEAD BASED PAINT SAMPLING LOG
NAF MIDWAY

THE SZARAS COMPANIES

 DATE SAMPLES COLLECTED: November 17, 1993

BUILDING NUMBER	BUILDING NAME	BUILDING DESCRIPTION
365	Abandoned Laundry	1 Story
TSC PROJECT NUMBER	**TSC INSPECTOR**	**TSC LABORATORY ID No.**
865	J. Kain and B. Kain	113093C

SAMPLE ID NO	SAMPLE LOCATION / DESCRIPTION	ANALYTICAL RESULTS (PPM)	CONDITION	AMOUNT
L1117-41	Exterior west side Peach paint on wall	281,318.7	Poor	8,200 sq. ft.
L1117-42	Roof west end Light gray paint	13,916.7	Poor	12,000 sq. ft.
	INTERIOR:			
L1117-43	Tank and storage west end Silver paint on air tank	193,947.4	Poor	250 sq. ft.
L1117-44	West end White paint on beams	261,082.5	Poor	1,200 sq. ft.
L1117-45	Storage room northwest end White paint on door	40,478.7	Poor	1,000 sq. ft.
L1117-46	Ceiling southwest end White paint	8,409.1	Poor	12,000 sq. ft.
L1117-47	Fire extinguisher marker northeast end Red paint on beams	9,627.6	Poor	100 sq. ft.
L1117-48	Boards on floor south end by wash area Yellow paint	33,376.3	Fair	400 sq. ft.
L1117-49	Shower west side White with green paint on door	42,473.7	Poor	1,000 sq. ft.
L1117-50	Shower west side White with yellow paint on wall	10,842.7	Poor	800 sq. ft.

assumed that anywhere the above identified lead based paint materials are found in the building, that those materials contain lead and should be treated as such.

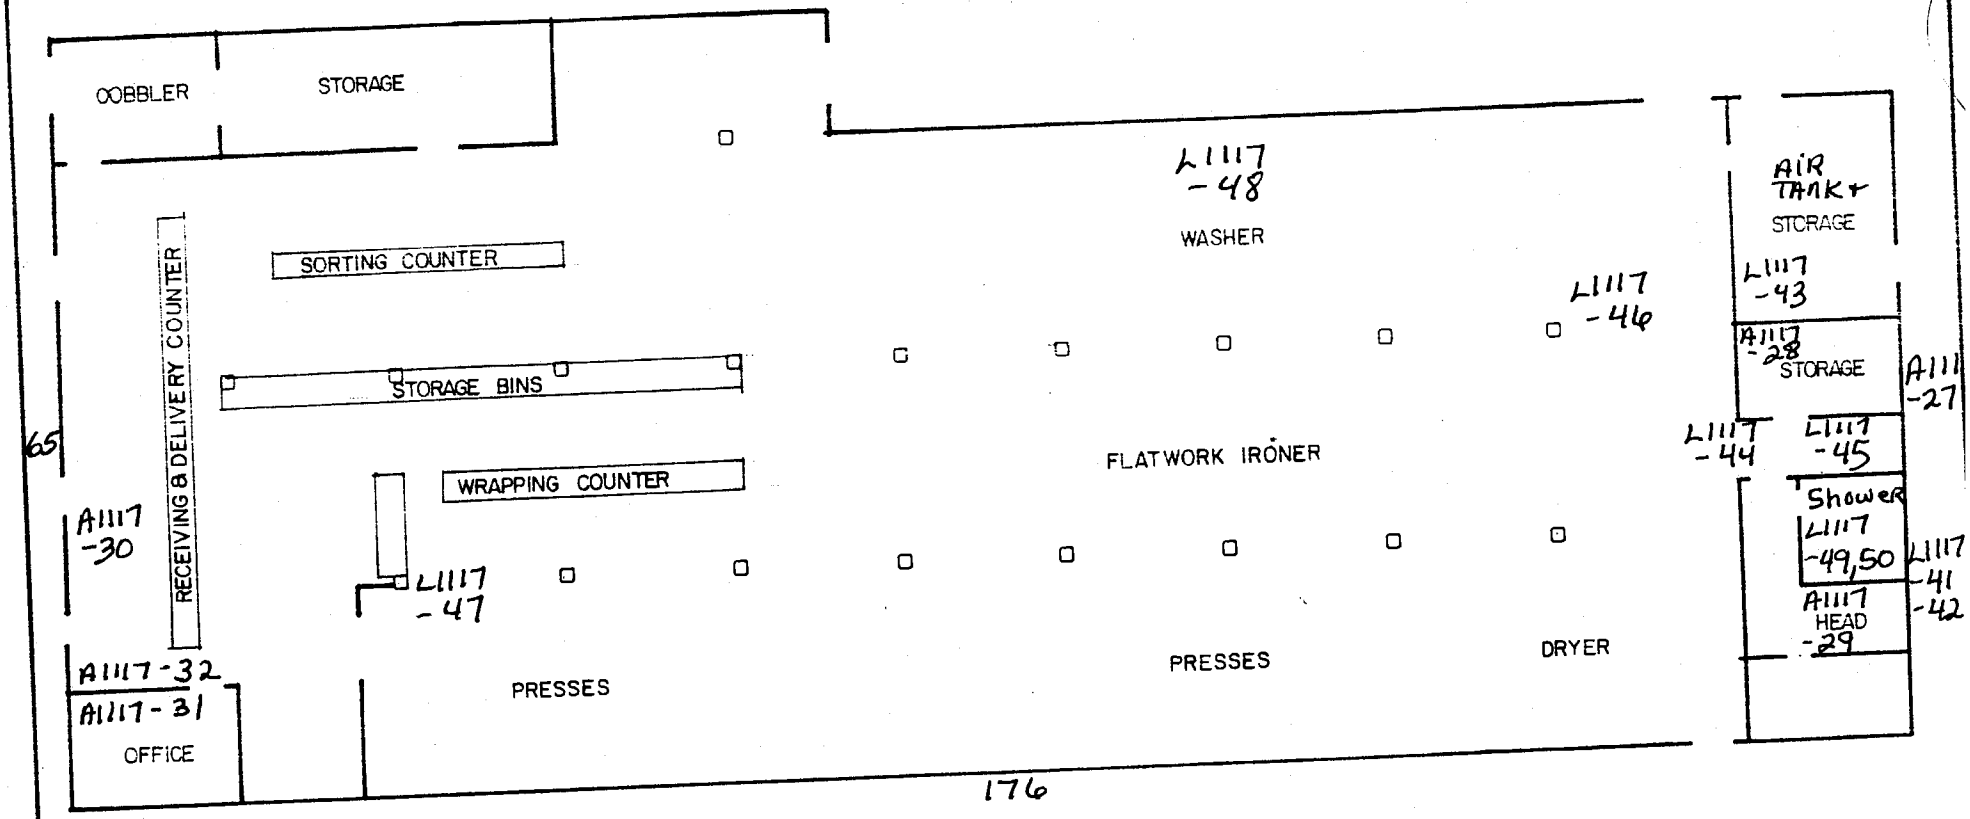

FLOOR PLAN

PIQUNIQ MANAGEMENT CORPORATION
NAVAL AIR FACILITY- MIDWAY ISLAND

LAUNDRY, BLDG. NO. 365

ASBESTOS BULK SAMPLING LOG
NAF MIDWAY

THE SZARAS COMPANIES

 DATE SAMPLES COLLECTED: November 15, 1993

BUILDING NUMBER	BUILDING NAME	BUILDING DESCRIPTION
393	Ski Warehouse	1 Story
TSC PROJECT NUMBER	**TSC INSPECTOR**	**TSC LABORATORY ID NO.**
865	J. Kain and B. Kain	112393M

SAMPLE ID NO	SAMPLE LOCATION / DESCRIPTION	ANALYTICAL RESULTS	FRIABLE	CONDITION	AMOUNT
	INTERIOR:				
A1115-5	West wall Concrete lower section of wall	None detected	No	Fair	4,500 lin. ft.
A1115-6	Northwest side - new roll Tar paper	None detected	No	Good	1 roll
A1115-7	Northwest side - new roll Tar paper with yellow stripes	None detected	No	Good	1 roll
A1115-8	Northwest side - new roll Black rolled shingles	None detected	No	Good	1 roll
A1115-9	Northwest side - new roll Black with white rock rolled shingle	None detected	No	Good	1 roll
A1115-10	Northwest side Burgundy with orange and white streaks: 9" x 9" floor tile	Tile - 6% Chrysotile Mastic - 5% Chrysotile	~~Fair~~ NO	Poor	300 sq. ft.
A1115-11	Northwest side Brown with white and orange streaks 9" x 9" floor tile	Tile - None detected Mastic - 1% Chrysotile	No	Poor	150 sq. ft.
A1115-12	Southwest side Black with white streaks 9" x 9" floor tile (2 layers on top)	Tile - 3% Chrysotile Mastic - 20% Chrysotile	No	Fair	140 sq. ft.
A1115-13	Southeast side Black with beige streaks 9" x 9" floor tile (2 layers on top)	Green tile - 8% Chrysotile Mastic - 4% Chrysotile Black tile - 12% Chrysotile Mastic - 5% Chrysotile	No	Fair	250 sq. ft.
A1115-14	Northeast side Black with beige streaks 9" x 9" floor tile (2 layers on top)	Green tile - 8% Chrysotile Mastic - 2% Chrysotile Black tile - 8% Chrysotile Mastic - 3% Chrysotile	No	Poor	300 sq. ft.
A1115-15	Northeast side Red with white streaks 9" x 9" floor tile	Tile - 10% Chrysotile Mastic - 1-2% Chrysotile	No	Poor	100 sq. ft.

assumed that anywhere the above identified asbestos containing building materials are found in the building, that those erials also contain asbestos and should be treated as such.

ASBESTOS BULK SAMPLING LOG
NAF MIDWAY

THE SZARAS COMPANIES

 DATE SAMPLES COLLECTED: November 15, 1993

BUILDING NUMBER	BUILDING NAME	BUILDING DESCRIPTION
393	Ski Warehouse	1 Story
TSC PROJECT NUMBER	**TSC INSPECTOR**	**TSC LABORATORY ID NO.**
865	J. Kain and B. Kain	112393M

SAMPLE ID NO	SAMPLE LOCATION / DESCRIPTION	ANALYTICAL RESULTS	FRIABLE	CONDITION	AMOUNT
	ROOF:				
A1115-36	North side Roof core	None detected	No	Poor	100 sq. ft.
A1115-37	Parapet wall northwest side Tar paper and tar	None detected	No	Fair	1,000 sq. ft.

" is assumed that anywhere the above identified asbestos containing building materials are found in the building, that those aterials also contain asbestos and should be treated as such.

LEAD BASED PAINT SAMPLING LOG
NAF MIDWAY

THE SZARAS COMPANIES

 DATE SAMPLES COLLECTED: Novemberr 15, 1993

BUILDING NUMBER	BUILDING NAME	BUILDING DESCRIPTION
393	Ski Warehouse	1 Story
TSC PROJECT NUMBER	**TSC INSPECTOR**	**TSC LABORATORY ID NO.**
865	J. Kain and B. Kain	112393E

SAMPLE ID NO	SAMPLE LOCATION / DESCRIPTION	ANALYTICAL RESULTS (PPM)	CONDITION	AMOUNT
	INTERIOR:			
L1115-10	West wall White paint	360.6	Fair	42,000 sq. ft.
L1115-11	North wall Light green paint on beam	1,152.6	Fair	300 sq. ft.
L1115-12	East wall Dark green paint	8,940.2	Fair	500 sq. ft.
L1115-13	East wall White paint	2,998.5	Fair	11,000 sq. ft.
	EXTERIOR:			
L1115-14	North wall Off-white paint	43,596.9	Fair	14,000 sq. ft.
L1115-15	Northwest door Brown paint	32,708.3	Fair	400 sq. ft.

is assumed that anywhere the above identified lead based paint materials are found in the building, that those materials contain lead and should be treated as such.

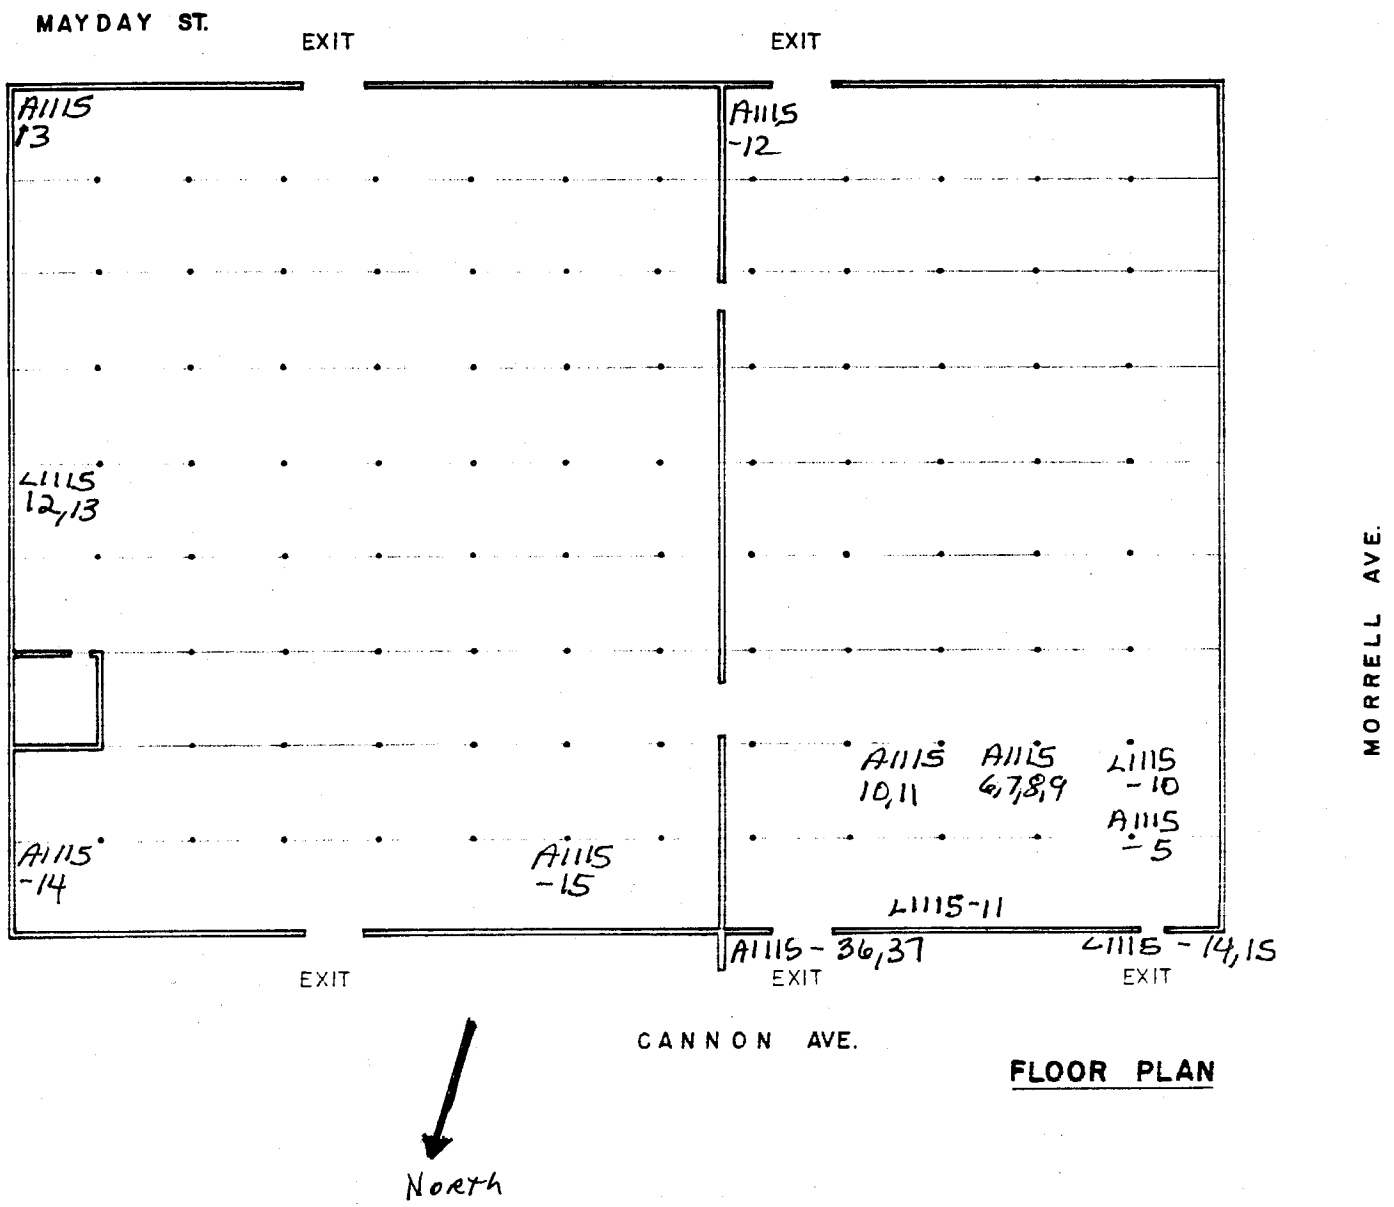

FLOOR PLAN

PIQUNIQ MANAGEMENT CORPORATION
NAVAL AIR FACILITY - MIDWAY ISLAND
SKI WAREHOUSE, BLDG. 393

26 SEPT 92 NESTOR VM

Asbestos Bulk Sampling Log
NAF Midway

THE SZARAS COMPANIES

 DATE SAMPLES COLLECTED: November 7, 1993

Building Number	Building Name	Building Description
394	Hot Water Heater Building	1 Story Tin Shed
TSC Project Number	**TSC Inspector**	**TSC Laboratory ID No.**
865	J. Kain and B. Kain	N/A

Sample ID No	Sample Location / Description	Analytical Results	Friable	Condition	Amount
No sample collected	No suspect ACM	N/A			

"It is assumed that anywhere the above identified asbestos containing building materials are found in the building, that those materials also contain asbestos and should be treated as such.

LEAD BASED PAINT SAMPLING LOG
NAF MIDWAY

THE SZARAS COMPANIES

 DATE SAMPLES COLLECTED: November 17, 1993

BUILDING NUMBER	BUILDING NAME	BUILDING DESCRIPTION
394	Hot Water Heater Building	1 Story Tin Shed
TSC PROJECT NUMBER	**TSC INSPECTOR**	**TSC LABORATORY ID NO.**
865	J. Kain and B. Kain	111693O

SAMPLE ID NO	SAMPLE LOCATION / DESCRIPTION	ANALYTICAL RESULTS (PPM)	CONDITION	AMOUNT
No sample collected	Exterior Beige paint on wall - same as sample L1106-25, building 336	431.9	Good	620 sq. ft. outside only
No sample collected	Exterior Brown paint on door and trim - same as sample L1106-26, building 336	3,663.1	Good	125 sq. ft.
No sample collected	Interior Silver paint on duct work and pipes - same as sample L1107-2, building S395	24,924.2	Good	250 sq. ft.

is assumed that anywhere the above identified lead based paint materials are found in the building, that those materials o contain lead and should be treated as such.

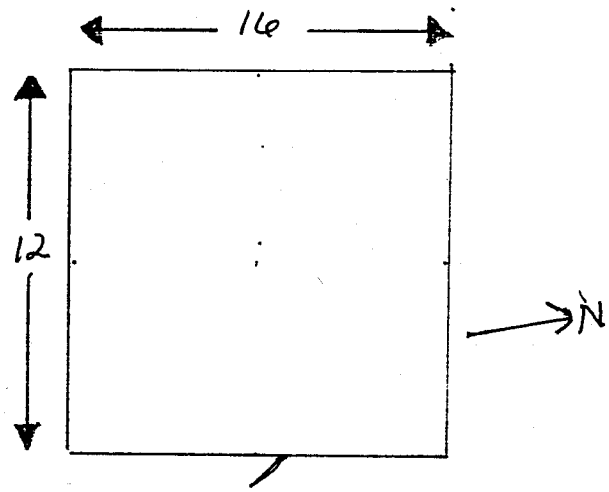

BLDG. # 394 Hot WATER Bldg

ASBESTOS BULK SAMPLING LOG
NAF MIDWAY

THE SZARAS COMPANIES

 DATE SAMPLES COLLECTED: November 2, 1993

BUILDING NUMBER	BUILDING NAME	BUILDING DESCRIPTION
400	Electrical Sub-Station	1 Story Block
TSC PROJECT NUMBER	**TSC INSPECTOR**	**TSC LABORATORY ID NO.**
865	J. Kain and B. Kain	N/A

SAMPLE ID NO	SAMPLE LOCATION / DESCRIPTION	ANALYTICAL RESULTS	FRIABLE	CONDITION	AMOUNT
No sample collected	Roof Corrugated transite roof panel - same as sample A1029-3, building S225	60% Chrysotile	No	Good	300 sq. ft.

It is assumed that anywhere the above identified asbestos containing building materials are found in the building, that those materials also contain asbestos and should be treated as such.

LEAD BASED PAINT SAMPLING LOG
NAF MIDWAY

THE SZARAS COMPANIES

 DATE SAMPLES COLLECTED: November 2, 1993

BUILDING NUMBER	BUILDING NAME	BUILDING DESCRIPTION
400	Electrical Sub-Station	1 Story Block
TSC PROJECT NUMBER	**TSC INSPECTOR**	**TSC LABORATORY ID NO.**
865	J. Kain and B. Kain	111593I

SAMPLE ID NO.	SAMPLE LOCATION / DESCRIPTION	ANALYTICAL RESULTS (PPM)	CONDITION	AMOUNT
L1102-15	Interior south door Brown paint on door and trim	5,380.0	Fair	275 sq. ft.
L1102-16	Interior east side Gray paint on voltage boxes	471.5	Good	100 sq. ft.
L1102-17	Interior south wall Off-white paint on wall	128.0	Good	1,550 sq. ft.
L1102-18	Exterior west of building 400 Orange paint on pole stand, 15 ft.	75,800.0	Poor	25 sq. ft.

is assumed that anywhere the above identified lead based paint materials are found in the building, that those materials contain lead and should be treated as such.

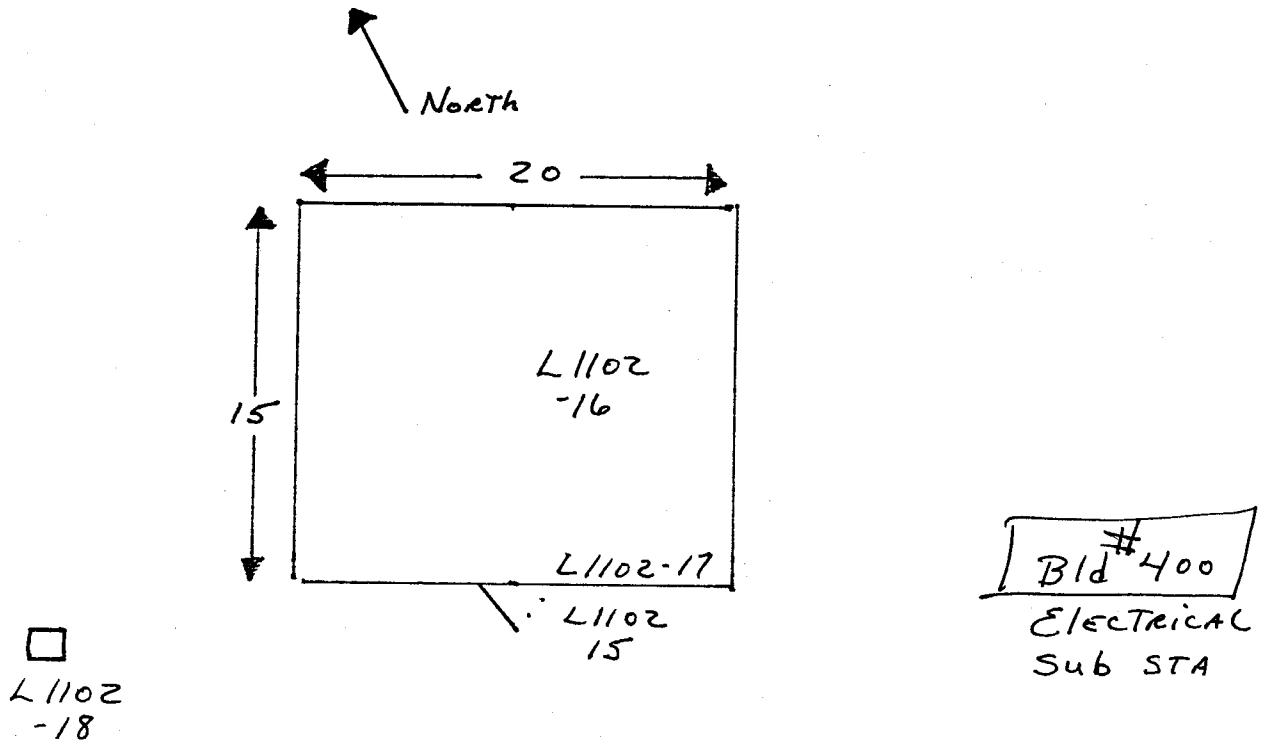
North
20
15
L1102
-16
L1102-17
L1102
15
L1102
-18
Bld #400
Electrical
Sub STA

ASBESTOS BULK SAMPLING LOG
NAF MIDWAY

THE SZARAS COMPANIES

 DATE SAMPLES COLLECTED: November 14, 1993

BUILDING NUMBER	BUILDING NAME	BUILDING DESCRIPTION
410	Pavilion	Covered Concrete Pad
TSC PROJECT NUMBER	**TSC INSPECTOR**	**TSC LABORATORY ID NO.**
865	J. Kain and B. Kain	N/A

SAMPLE ID NO	SAMPLE LOCATION / DESCRIPTION	ANALYTICAL RESULTS	FRIABLE	CONDITION	AMOUNT
No sample collected	No suspect ACM	N/A			

" is assumed that anywhere the above identified asbestos containing building materials are found in the building, that those aterials also contain asbestos and should be treated as such.

LEAD BASED PAINT SAMPLING LOG
NAF MIDWAY

THE SZARAS COMPANIES

 DATE SAMPLES COLLECTED: November 14, 1993

BUILDING NUMBER	BUILDING NAME	BUILDING DESCRIPTION
410	Pavilion	Covered Concrete Pad
TSC PROJECT NUMBER	**TSC INSPECTOR**	**TSC LABORATORY ID NO.**
865	J. Kain and B. Kain	112393F

SAMPLE ID NO	SAMPLE LOCATION / DESCRIPTION	ANALYTICAL RESULTS (PPM)	CONDITION	AMOUNT
	EXTERIOR:			
L1114-1	North side Blue paint on post	95,235.3	Good	100 sq. ft.
L1114-2	North side White paint on post	925.0	Good	250 sq. ft.
L1114-3	North side Red paint on floor	2,810.8	Good	2,100 sq. ft.

is assumed that anywhere the above identified lead based paint materials are found in the building, that those materials contain lead and should be treated as such.

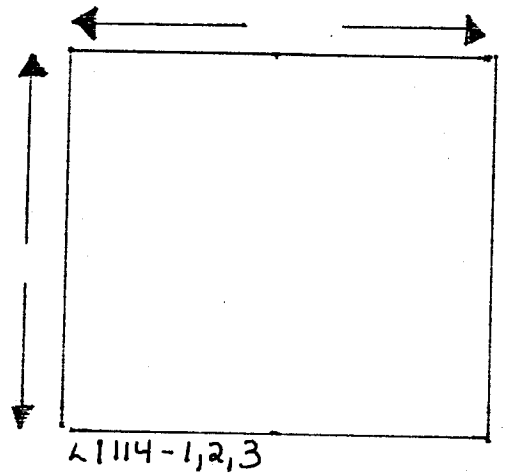

BLDG. #410 Pavilion

ASBESTOS BULK SAMPLING LOG
NAF MIDWAY

THE SZARAS COMPANIES DATE SAMPLES COLLECTED: October 29, 1993

BUILDING NUMBER	BUILDING NAME	BUILDING DESCRIPTION
425	TV Satellite Receiver Building	1 Story
TSC PROJECT NUMBER	**TSC INSPECTOR**	**TSC LABORATORY ID NO.**
865	J. Kain and B. Kain	N/A

SAMPLE ID NO	SAMPLE LOCATION / DESCRIPTION	ANALYTICAL RESULTS	FRIABLE	CONDITION	AMOUNT
No sample collected	Roof Transite corrugated panel Same as sample A1029-3, building S225	60% Chrysotile	No	Good	75 sq. ft.

assumed that anywhere the above identified asbestos containing building materials are found in the building, that those materials also contain asbestos and should be treated as such.

LEAD BASED PAINT SAMPLING LOG
NAF MIDWAY

THE SZARAS COMPANIES

DATE SAMPLES COLLECTED: October 29, 1993

UILDING NUMBER	BUILDING NAME	BUILDING DESCRIPTION
425	TV Satellite Receiver Building	1 Story
TSC PROJECT NUMBER	**TSC INSPECTOR**	**TSC LABORATORY ID NO.**
865	J. Kain and B. Kain	110893M

SAMPLE ID NO	SAMPLE LOCATION / DESCRIPTION	ANALYTICAL RESULTS (PPM)	CONDITION	AMOUNT
L1029-4	Exterior north side Off-white paint	215.6	Good	1,300 sq. ft.
L1029-5	Exterior south side Brown paint on door	2,351.6	Fair	100 sq. ft.
L1029-6	Interior south side Red deck paint	102.1	Fair	75 sq. ft.

is assumed that anywhere the above identified lead based paint materials are found in the building, that those materials contain lead and should be treated as such.

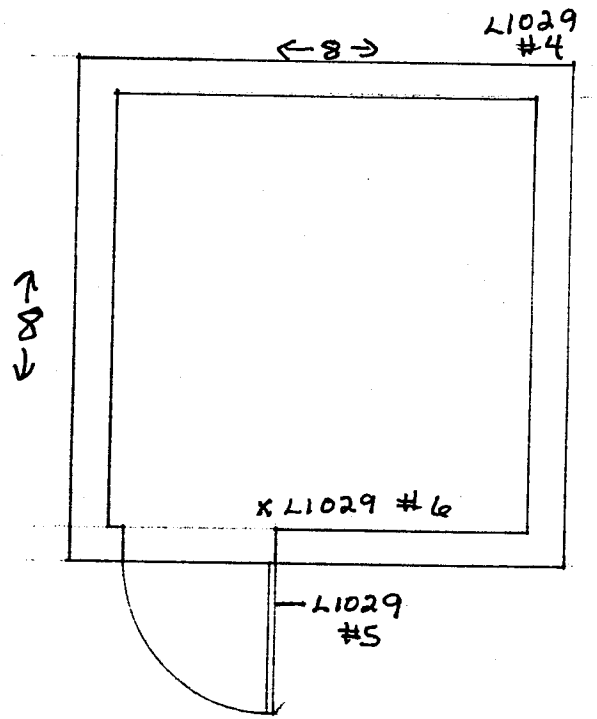

FLOOR PLAN

PIQUNIQ MANAGEMENT CORPORATION
NAVAL AIR FACILITY - MIDWAY ISLAND

TV SATELLITE RECEIVER BLDG.
BLDG. 425

ASBESTOS BULK SAMPLING LOG
NAF MIDWAY

THE SZARAS COMPANIES

 DATE SAMPLES COLLECTED: November 22, 1993

BUILDING NUMBER	BUILDING NAME	BUILDING DESCRIPTION
502	AT&T	1 Story
TSC PROJECT NUMBER	**TSC INSPECTOR**	**TSC LABORATORY ID NO.**
865	J. Kain and B. Kain	113093I

SAMPLE ID NO	SAMPLE LOCATION / DESCRIPTION	ANALYTICAL RESULTS	FRIABLE	CONDITION	AMOUNT
	INTERIOR:				
A1122-16	Telecommunication room west side Light brown with brown and yellow streaks: 9" x 9" floor tile	Tile - 15% Chrysotile Mastic - 10% Chrysotile	No	Good	750 sq. ft.
A1122-17	Generator room 8" pipe lagging - exhaust stack	41% Chrysotile	Yes	Fair	10 lin. ft.

"It is assumed that anywhere the above identified asbestos containing building materials are found in the building, that those materials also contain asbestos and should be treated as such.

LEAD BASED PAINT SAMPLING LOG
NAF MIDWAY

THE SZARAS COMPANIES

 DATE SAMPLES COLLECTED: November 22, 1993

BUILDING NUMBER	BUILDING NAME	BUILDING DESCRIPTION
502	AT&T	1 Story
TSC PROJECT NUMBER	**TSC INSPECTOR**	**TSC LABORATORY ID NO.**
865	J. Kain and B. Kain	113093H

SAMPLE ID NO	SAMPLE LOCATION / DESCRIPTION	ANALYTICAL RESULTS (PPM)	CONDITION	AMOUNT
	INTERIOR:			
L1122-25	Telecommunication room west side Yellow paint on wall	1,302.8	Good	1,560 sq. ft.
L1122-26	Generator room Green paint on door	11,477.3	Good	75 sq. ft.
L1122-27	Restroom south wall Yellow paint	1,758.1	Good	400 sq. ft.
L1122-28	Exit door north side Gold paint on door	62,329.5	Good	150 sq. ft.
L1122-29	Generator room east side Gray paint on floor	2,601.9	Fair	150 sq. ft.
	EXTERIOR:			
L1122-30	North side Green paint on door	5,612.5	Fair	200 sq. ft.
L1122-31	South side White paint on wall	1,472.2	Fair	2,000 sq. ft.
L1122-32	South side Silver paint on pipe	1,688.1	Poor	50 sq. ft.
L1122-34	Tin shed White paint on wall (same as inside paint)	2,550.0	Fair	3,000 sq. ft.

is assumed that anywhere the above identified lead based paint materials are found in the building, that those materials o contain lead and should be treated as such.

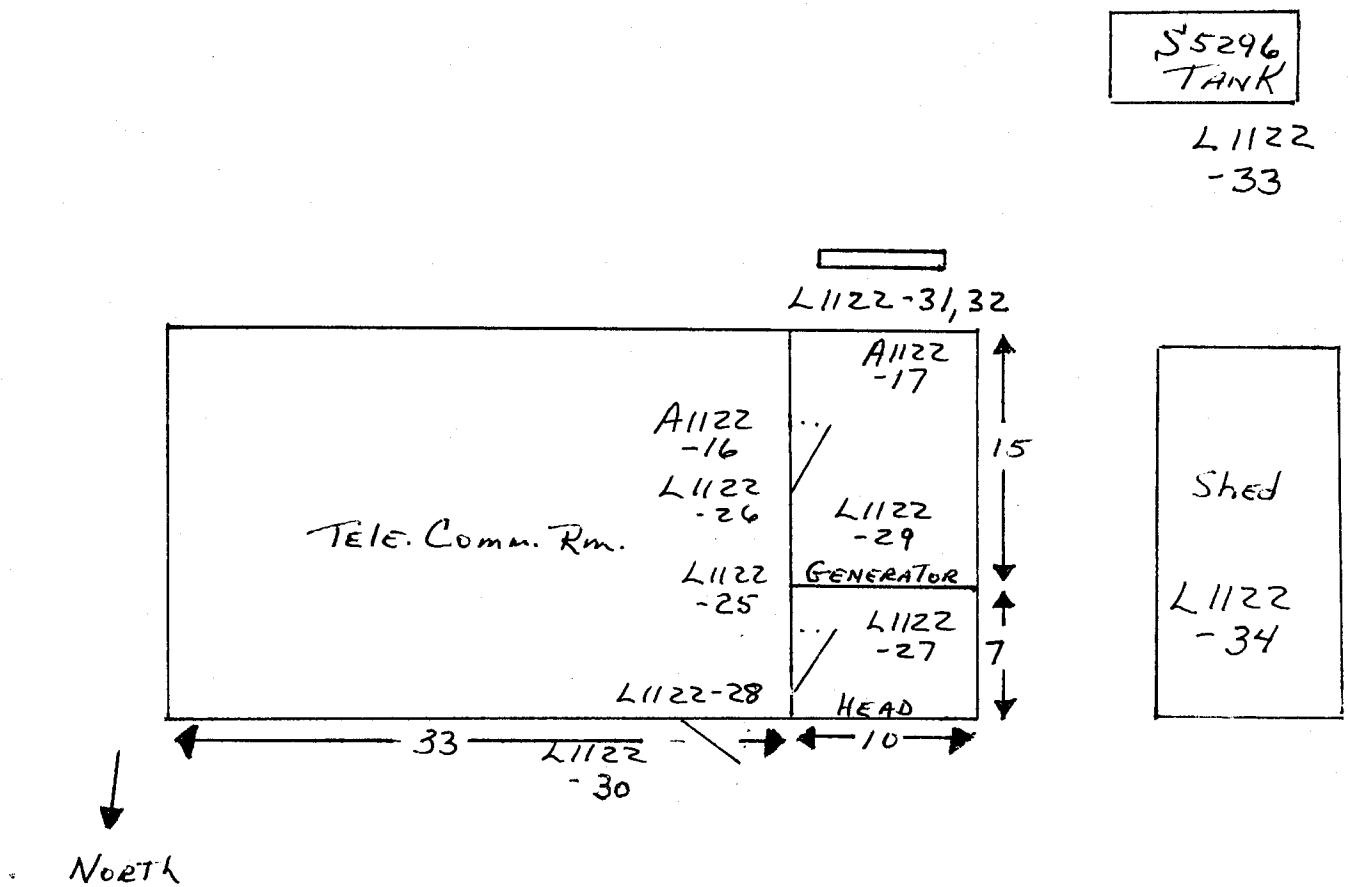

Bld # 502

A.T.&T.

Bld S 5296

Shed No #

ASBESTOS BULK SAMPLING LOG
NAF MIDWAY

THE SZARAS COMPANIES

 DATE SAMPLES COLLECTED: November 5, 1993

BUILDING NUMBER	BUILDING NAME	BUILDING DESCRIPTION
503	Electrical Sub-Station	1 Story
TSC PROJECT NUMBER	**TSC INSPECTOR**	**TSC LABORATORY ID NO.**
865	J. Kain and B. Kain	111693I

SAMPLE ID NO	SAMPLE LOCATION / DESCRIPTION	ANALYTICAL RESULTS	FRIABLE	CONDITION	AMOUNT
A1105-14	Roof west side Roof core	None detected	No	Fair	125 sq. ft.

" is assumed that anywhere the above identified asbestos containing building materials are found in the building, that those aterials also contain asbestos and should be treated as such.

Lead Based Paint Sampling Log

NAF Midway

THE SZARAS COMPANIES

DATE SAMPLES COLLECTED: November 5, 1993

Building Number	Building Name	Building Description
503	Electrical Sub-Station	1 Story
TSC Project Number	**TSC Inspector**	**TSC Laboratory ID No.**
865	J. Kain and B. Kain	111693C

Sample ID No	Sample Location / Description	Analytical Results (ppm)	Condition	Amount
L1105-24	Exterior east Beige paint on wall	28,937.5	Good	350 sq. ft.
L1105-25	Exterior west door Brown paint on door	5,103.5	Good	75 sq. ft.
No sample collected	Interior Gray paint on voltage box - same as sample L1105-16, building 5350	78,356.7	Good	100 sq. ft.

. is assumed that anywhere the above identified lead based paint materials are found in the building, that those materials ›o contain lead and should be treated as such.

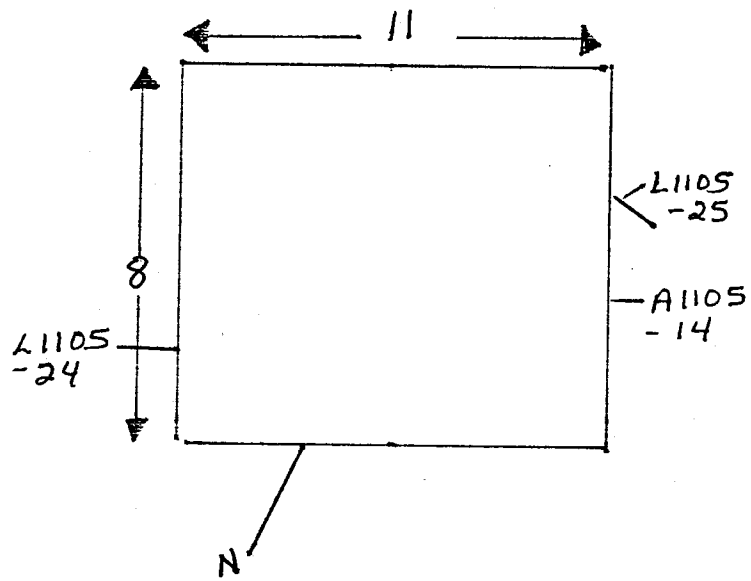

BLDG. #503 Electrial Sub Station

Asbestos Bulk Sampling Log
NAF Midway

THE SZARAS COMPANIES

 DATE SAMPLES COLLECTED: November 12, 1993

BUILDING NUMBER	BUILDING NAME	BUILDING DESCRIPTION
520	Extinguisher Storage Room	1 Story
TSC PROJECT NUMBER	**TSC INSPECTOR**	**TSC LABORATORY ID NO.**
865	J. Kain and B. Kain	N/A

SAMPLE ID NO	SAMPLE LOCATION / DESCRIPTION	ANALYTICAL RESULTS	FRIABLE	CONDITION	AMOUNT
No sample collected	Roof Corrugated transite panels Same as sample A1027-27, building 5182	45% Chrysotile	No	Good	600 sq. ft.

is assumed that anywhere the above identified asbestos containing building materials are found in the building, that those erials also contain asbestos and should be treated as such.

LEAD BASED PAINT SAMPLING LOG
NAF MIDWAY

THE SZARAS COMPANIES

 DATE SAMPLES COLLECTED: November 12, 1993

BUILDING NUMBER	BUILDING NAME	BUILDING DESCRIPTION
520	Extinguisher Room Storage	1 Story
TSC PROJECT NUMBER	**TSC INSPECTOR**	**TSC LABORATORY ID NO.**
865	J. Kain and B. Kain	112393A

SAMPLE ID NO	SAMPLE LOCATION / DESCRIPTION	ANALYTICAL RESULTS (PPM)	CONDITION	AMOUNT
	EXTERIOR:			
L1112-1	West side White paint on eaves and walls	1,953.3	Fair	2,200 sq. ft. same on interior and exterior
L1112-2	South side Gray paint on 2 doors	3,094.9	Poor	150 sq. ft.
No sample collected	North side Brown paint on door	N/A	Fair	75 sq. ft.

is assumed that anywhere the above identified lead based paint materials are found in the building, that those materials contain lead and should be treated as such.

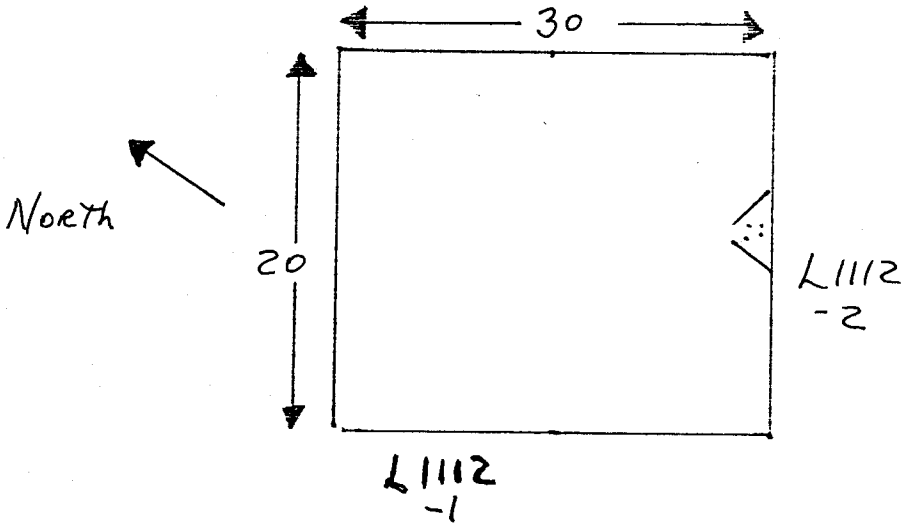

Bld #520
Extinguisher Room
Storage

ASBESTOS BULK SAMPLING LOG
NAF MIDWAY

THE SZARAS COMPANIES

 DATE SAMPLES COLLECTED: November 12, 1993

BUILDING NUMBER	BUILDING NAME	BUILDING DESCRIPTION
521	Communications Center	2 Story
TSC PROJECT NUMBER	**TSC INSPECTOR**	**TSC LABORATORY ID NO.**
865	J. Kain and B. Kain	112393N

SAMPLE ID NO	SAMPLE LOCATION / DESCRIPTION	ANALYTICAL RESULTS	FRIABLE	CONDITION	AMOUNT
	EXTERIOR:				
A1112-1	North end Stucco on wall	None detected	No	Good	8,000 sq. ft.
A1112-7	Roof Roof core	None detected	No	Poor	6,000 sq. ft.
	INTERIOR:				
A1112-2	Northwest side Tar over cork insulation on 7" pipe on compressor	None detected	No	Fair	30 ft.
A1112-3	East side Light brown with white and orange streaks: 9" x 9" floor tile	Tile - 6% Chrysotile Mastic - None detected	No	Fair	150 sq. ft.
A1112-4	East side Black with white streaks 9" x 9" floor tile	Tile - 5% Chrysotile Mastic - None detected	No	Fair	6,000 sq. ft.
A1112-5	Southeast side Mastic on wall used for wall tile	None detected	No	Fair	3,000 sq. ft.
A1112-6	Southeast side 1' x 1' wall tile with 1/4" drilled holes	None detected	Yes	Poor	3,000 sq. ft.

It is assumed that anywhere the above identified asbestos containing building materials are found in the building, that those materials also contain asbestos and should be treated as such.

LEAD BASED PAINT SAMPLING LOG

NAF MIDWAY

Near Airport Hangar

THE SZARAS COMPANIES

 DATE SAMPLES COLLECTED: November 12, 1993

BUILDING NUMBER	BUILDING NAME	BUILDING DESCRIPTION
521	Communications Center	2 Story
TSC PROJECT NUMBER	**TSC INSPECTOR**	**TSC LABORATORY ID NO.**
865	J. Kain and B. Kain	112393A

SAMPLE ID NO	SAMPLE LOCATION / DESCRIPTION	ANALYTICAL RESULTS (PPM)	CONDITION	AMOUNT
	EXTERIOR:			
L1112-3	North end White paint on wall	1,401.4	Poor	8,000 sq. ft.
L1112-4	North end Green paint on door	17,335.6	Poor	2,000 sq. ft.
L1112-8	Northwest side Gray paint on air handler	18,239.7	Poor	100 sq. ft.
	INTERIOR:			
L1112-5	Northwest wall White paint	6,018.5	Poor	Unknown
L1112-6	Northwest wall Light green paint	5,313.9	Poor	Unknown
L1112-7	Southwest wall Light green paint	2,991.6	Poor	Unknown
	Note: 1st floor unsafe for entry			

is assumed that anywhere the above identified lead based paint materials are found in the building, that those materials contain lead and should be treated as such.

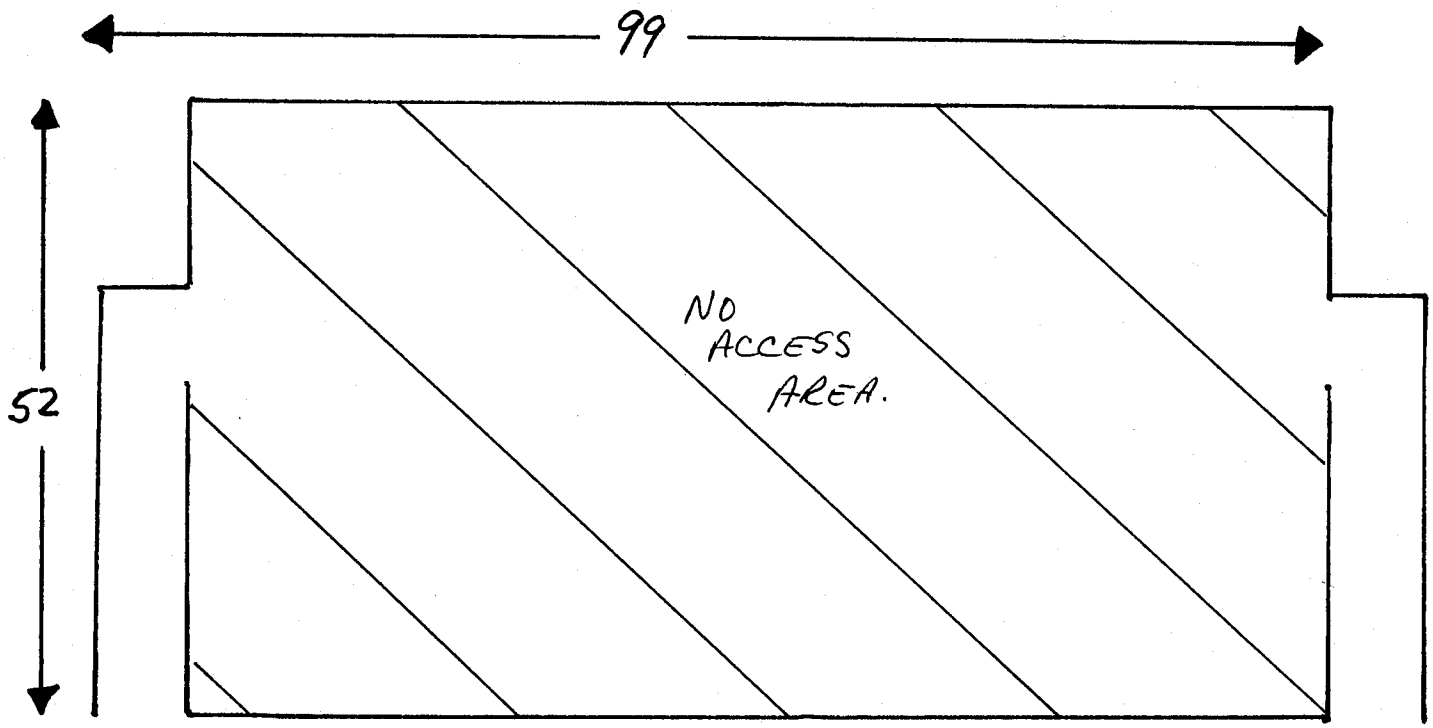

FIRST FLOOR PLAN

Bld #521
Comm. CTR.

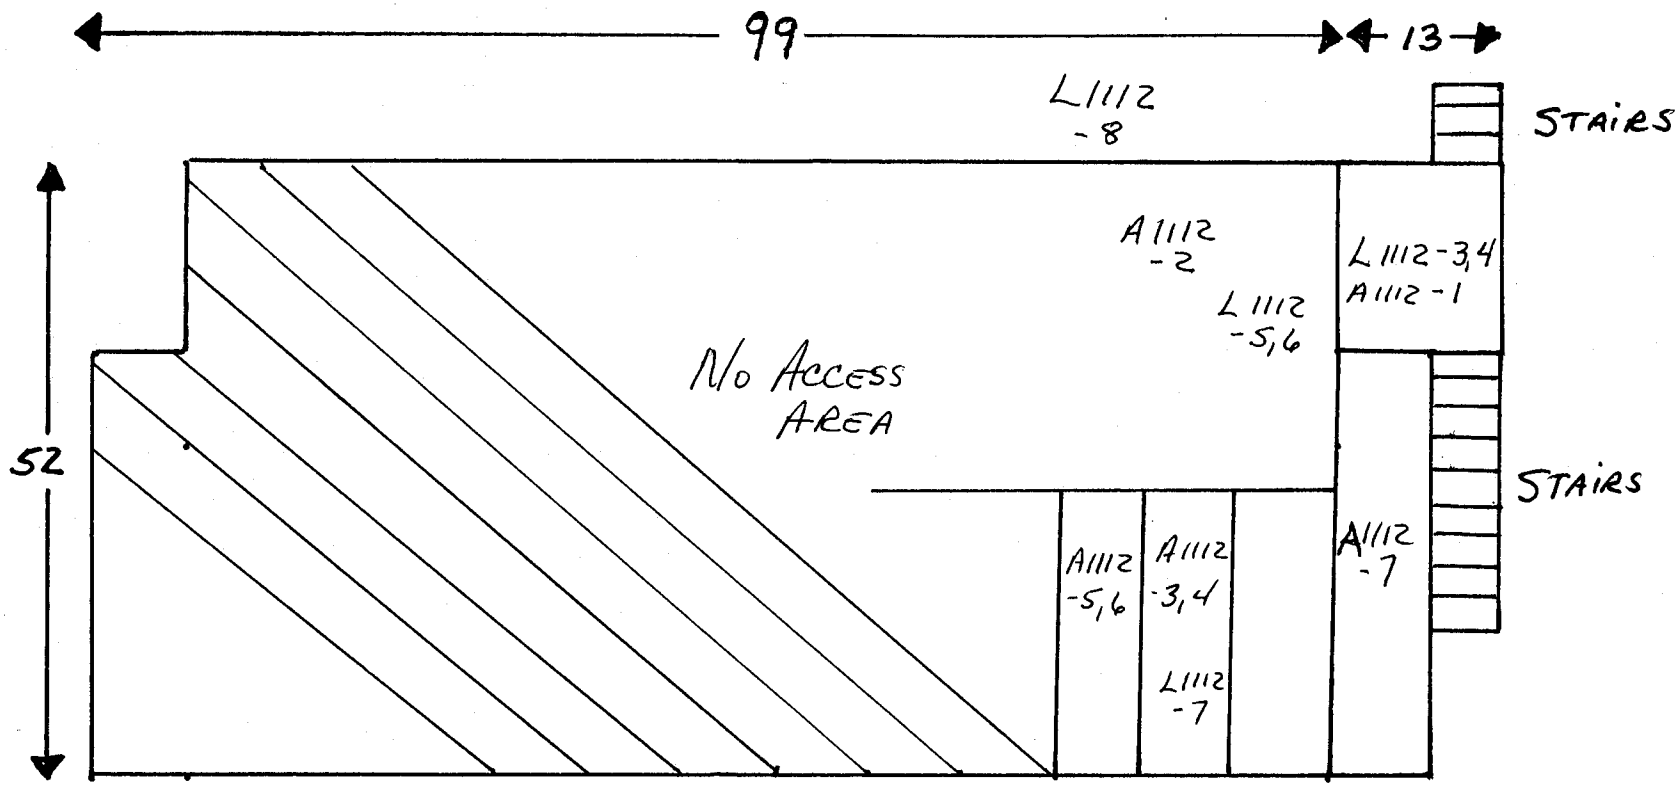

2nd Floor Plan

PG. 2 OF 2

Bld # 521

Comm. CTR.

ASBESTOS BULK SAMPLING LOG
NAF MIDWAY

THE SZARAS COMPANIES

 DATE SAMPLES COLLECTED: Novemberr 10, 1993

UILDING NUMBER	BUILDING NAME	BUILDING DESCRIPTION
576	Paint Storage	Concrete Pad
TSC PROJECT NUMBER	**TSC INSPECTOR**	**TSC LABORATORY ID NO.**
865	J. Kain and B. Kain	112393G

SAMPLE ID NO	SAMPLE LOCATION / DESCRIPTION	ANALYTICAL RESULTS	FRIABLE	CONDITION	AMOUNT
A1110-59	Exterior center Black tar in cracks of concrete pad	None detected	No	Fair	200 sq. ft.
	Note: The building has been demolished. Only concrete pad left with tar that fills the cracks.				

" is assumed that anywhere the above identified asbestos containing building materials are found in the building, that those aterials also contain asbestos and should be treated as such.

LEAD BASED PAINT SAMPLING LOG
NAF MIDWAY

THE SZARAS COMPANIES

 DATE SAMPLES COLLECTED: November 10, 1993

BUILDING NUMBER	BUILDING NAME	BUILDING DESCRIPTION
576	Paint Storage	Concrete Pad
TSC PROJECT NUMBER	**TSC INSPECTOR**	**TSC LABORATORY ID NO.**
865	J. Kain and B. Kain	N/A

SAMPLE ID NO	SAMPLE LOCATION / DESCRIPTION	ANALYTICAL RESULTS (PPM)	CONDITION	AMOUNT
No sample collected	No paint	N/A		

.. is assumed that anywhere the above identified lead based paint materials are found in the building, that those materials contain lead and should be treated as such.

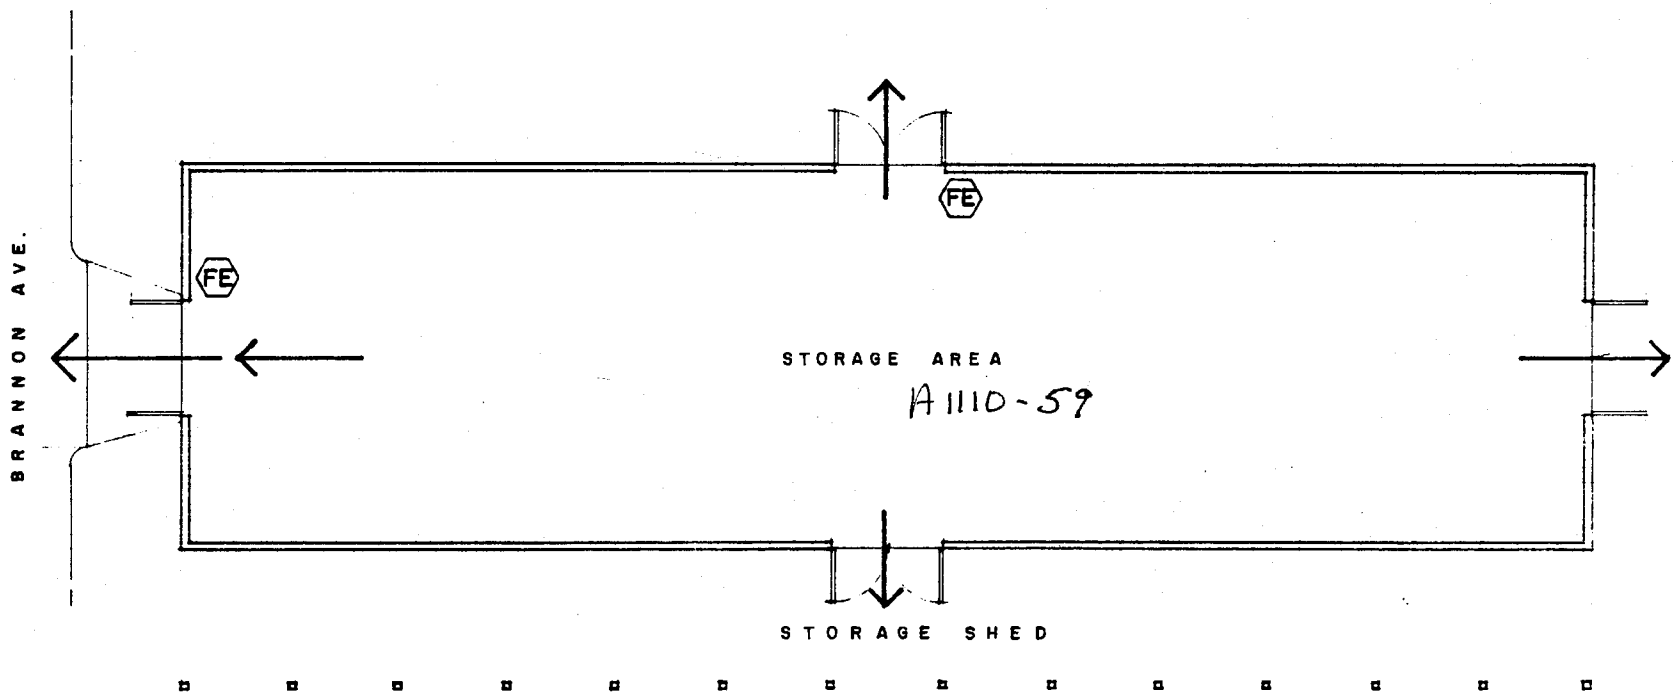

floor plan

LEGEND:

FE —— FIRE EXTINGUISHER

- MEETING AREA: INTERSECTION OF MADOLE ST. AND BRANNON AVENUE.
- IN THE EVENT OF A SPILL, CALL 888 IMMEDIATELY!

BASE SERVICES, INC.
NAVAL AIR FACILITY- MIDWAY ISLAND

PAINT STORAGE | **BLDG. 576**
PG. 1 OF 2

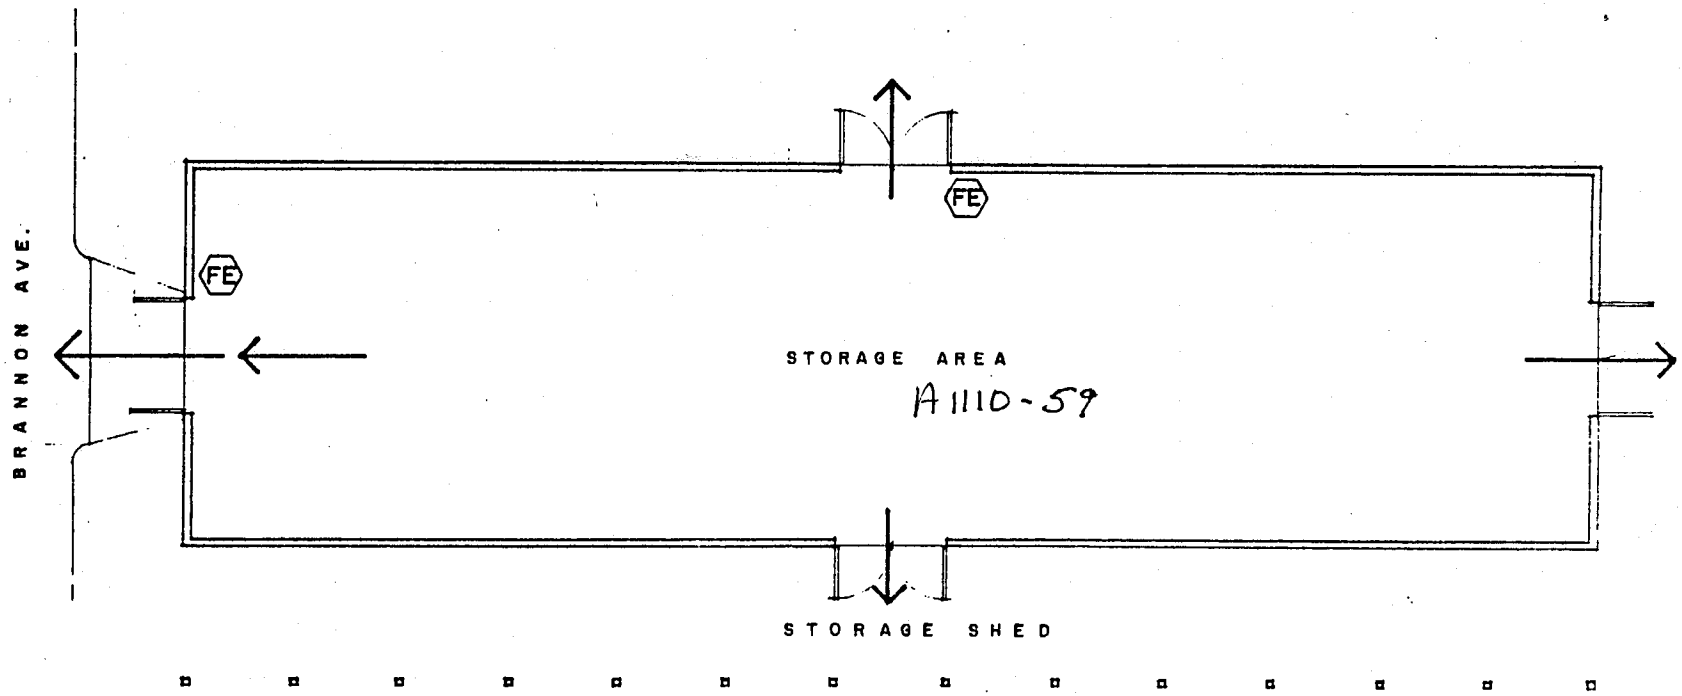

floor plan

LEGEND:

FE —— FIRE EXTINGUISHER

- MEETING AREA: INTERSECTION OF MADOLE ST. AND BRANNON AVENUE.
- IN THE EVENT OF A SPILL, CALL 888 IMMEDIATELY!

BASE SERVICES, INC.
NAVAL AIR FACILITY- MIDWAY ISLAND

PAINT STORAGE BLDG. 576

PG. 2 OF 2

ASBESTOS BULK SAMPLING LOG
NAF MIDWAY

THE SZARAS COMPANIES

 DATE SAMPLES COLLECTED: November 10, 1993

BUILDING NUMBER	BUILDING NAME	BUILDING DESCRIPTION
578	Barracks	2 Story
TSC PROJECT NUMBER	**TSC INSPECTOR**	**TSC LABORATORY ID NO.**
865	J. Kain and B. Kain	112393G

SAMPLE ID NO	SAMPLE LOCATION / DESCRIPTION	ANALYTICAL RESULTS	FRIABLE	CONDITION	AMOUNT
	INTERIOR:				
A1110-29	Room 102, 1st floor Beige with brown dents 12" x 12" floor tile	Tile - None detected Mastic - 4% Chrysotile	No	Fair	500 sq. ft.
A1110-30	Corridor 1st floor Brown with white flecks 12" x 12" floor tile	Tile - <1% Chrysotile Mastic - 5% Chrysotile	No	Fair	4,500 sq. ft.
A1110-31	Room 101, 1st floor Beige with gray swirls 12" x 12" floor tile	Tile - 2% Chrysotile Mastic - None detected	No	Fair	3,200 sq. ft.
A1110-32	Corridor 1st floor 2' x 4' suspended ceiling tile	None detected	Yes	Fair	1,700 sq. ft.
A1110-33	Room 106, 1st floor Gold with brown and beige specks 12" x 12" floor tile	None detected	No	Good	400 sq. ft.
A1110-34	Room 102 east wall 1st floor Drywall and tape	None detected	Yes	Fair	30,000 sq. ft.
A1110-35	Room 214 west wall 2nd floor Texture material on wall	None detected	Yes	Fair	15,000 sq. ft.
A1110-40	2nd floor Black stairtread	None detected	No	Poor	100 sq. ft.
A1110-41	Corridor north end 2nd floor Black baseboard and mastic	None detected	No	Poor	1,300 lin. ft.
A1110-42	Hallway by stairwell 2nd floor Brown with white and dark brown 12" x 12" floor tile	Tile - 1-2% Chrysotile Mastic - None detected	No	Good	8,500 sq. ft.
A1110-43	Boiler room 1st floor Woven material on exhaust stack	90% Chrysotile	Yes	Poor	25 sq. ft.

It is assumed that anywhere the above identified asbestos containing building materials are found in the building, that those materials also contain asbestos and should be treated as such.

Asbestos Bulk Sampling Log
NAF Midway

THE SZARAS COMPANIES

 DATE SAMPLES COLLECTED: November 10, 1993

Building Number	Building Name	Building Description
578	Barracks	2 Story
TSC Project Number	**TSC Inspector**	**TSC Laboratory ID No.**
865	J. Kain and B. Kain	112393G

Sample ID No	Sample Location / Description	Analytical Results	Friable	Condition	Amount
	ROOF:				
A1110-36	Center Green shingle and tar paper around vent	None detected	No	Fair	100 sq. ft.
A1110-37	Center Roof core and rock	None detected	No	Fair	8,500 sq. ft.
A1110-38	By roof hatch Tar on 11 vents	None detected	No	Fair	50 sq. ft.

" is assumed that anywhere the above identified asbestos containing building materials are found in the building, that those aterials also contain asbestos and should be treated as such.

LEAD BASED PAINT SAMPLING LOG
NAF MIDWAY

THE SZARAS COMPANIES

 DATE SAMPLES COLLECTED: November 10, 1993

BUILDING NUMBER	BUILDING NAME	BUILDING DESCRIPTION
578	Barracks	2 Story
TSC PROJECT NUMBER	**TSC INSPECTOR**	**TSC LABORATORY ID NO.**
865	J. Kain and B. Kain	112393C

SAMPLE ID NO	SAMPLE LOCATION / DESCRIPTION	ANALYTICAL RESULTS (PPM)	CONDITION	AMOUNT
	INTERIOR:			
L1110-25	Room 102 1st floor White paint on wall	1,238.5	Fair	9,000 sq. ft.
L1110-26	Room 106 1st floor Green paint on wall	835.0	Fair	4,000 sq. ft.
L1110-27	Storage 1st floor Mauve paint on wall	560.4	Fair	2,000 sq. ft.
L1110-28	Room 214 west wall 2nd floor White paint	108.0	Fair	15,000 sq. ft.
L1110-29	Shower room south wall 2nd floor Yellow paint	81.4	Poor	2,000 sq. ft.
L1110-30	Gear room north wall 2nd floor Green paint	14,278.3	Poor	600 sq. ft.
L1110-31	Stairwell 2nd floor Red paint on trim	13,489.6	Poor	150 sq. ft.
L1110-32	Stairwell 2nd floor Pink paint on wall	12,171.7	Poor	1,600 sq. ft.
L1110-33	Stairwell 2nd floor Yellow paint on handrail	4,208.1	Poor	50 sq. ft.
L1110-34	Stairwell 2nd floor Black paint on steps and floor	316.5	Poor	1,000 sq. ft.
L1110-35	Corridor north end 1st floor Beige paint on overhead deck	6,641.4	Fair	19,000 sq. ft.

is assumed that anywhere the above identified lead based paint materials are found in the building, that those materials contain lead and should be treated as such.

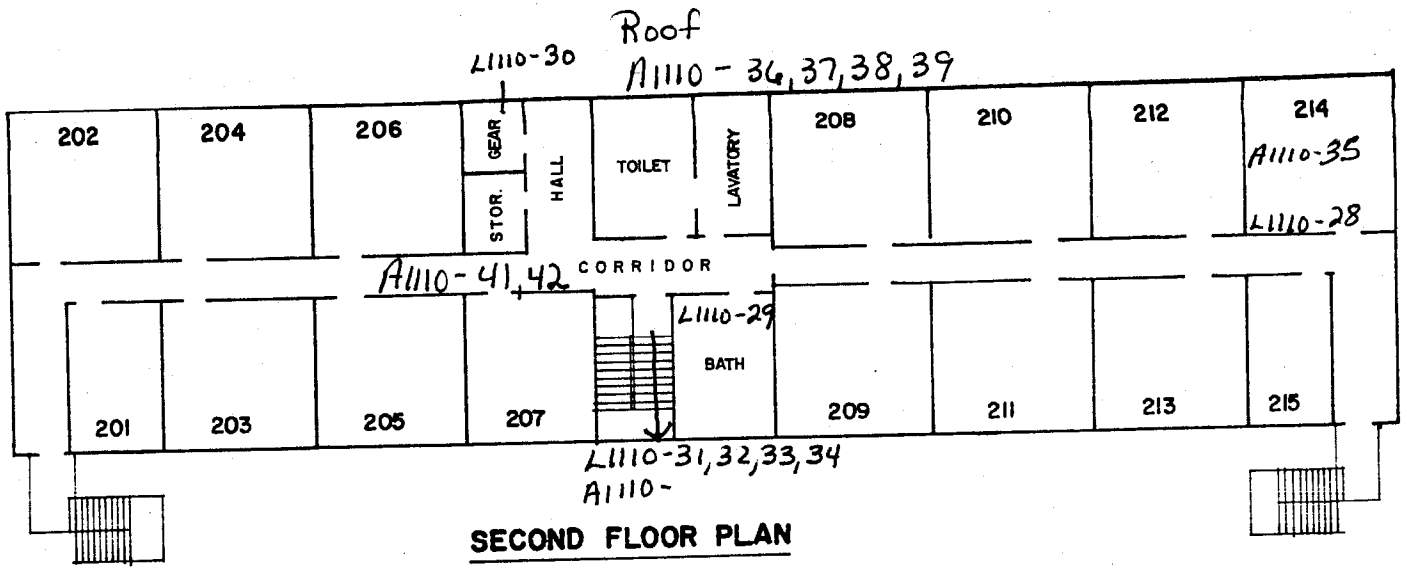

SECOND FLOOR PLAN

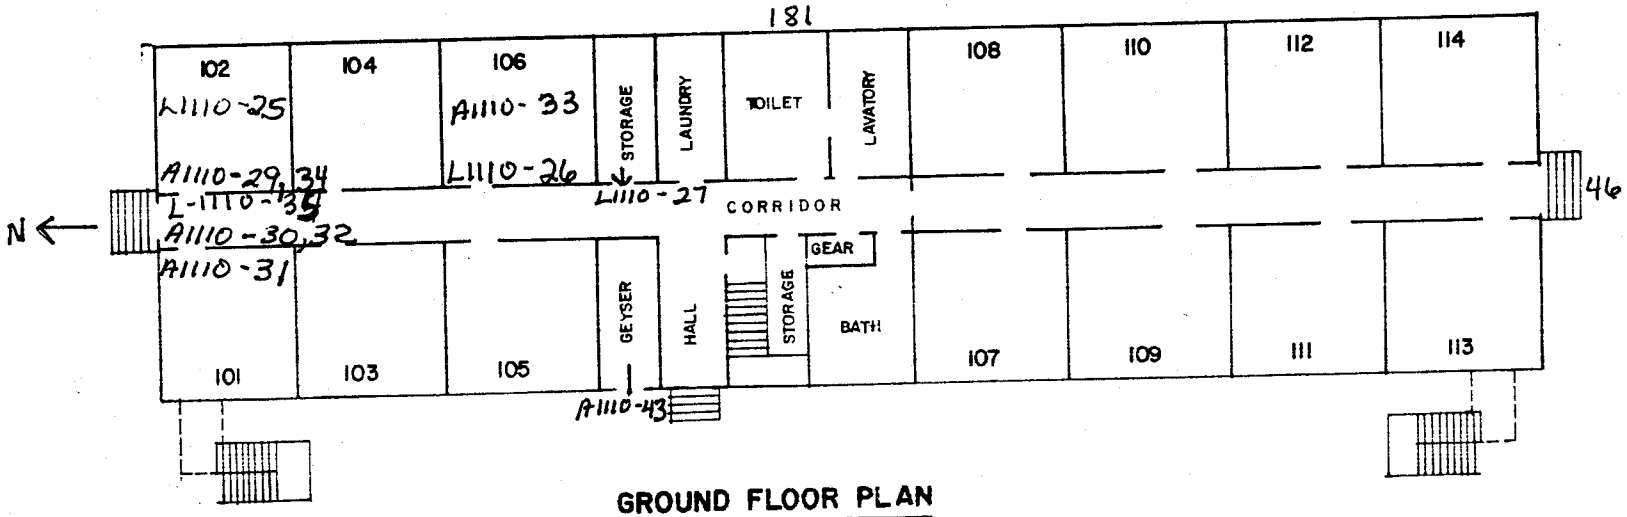

GROUND FLOOR PLAN

PIQUNIQ MANAGEMENT CORPORATION
NAVAL AIR FACILITY - MIDWAY ISLAND

BARRACKS, BLDG. NO. 578

Asbestos Bulk Sampling Log
NAF Midway

THE SZARAS COMPANIES

 DATE SAMPLES COLLECTED: November 10, 1993

Building Number	Building Name	Building Description
579	Barracks	2 Story
TSC Project Number	**TSC Inspector**	**TSC Laboratory ID No.**
865	J. Kain and B. Kain	112393G

Sample ID No	Sample Location / Description	Analytical Results	Friable	Condition	Amount
	EXTERIOR:				
A1110-13	8" high horizontal strip - 8 ft. wide Transite siding	30% Chrysotile	No	Good	13,000 sq. ft.
	INTERIOR:				
A1110-14	Day room north end Aqua with off-white streaks 12" x 12" floor tile	<1% Chrysotile	No	Fair	1,500 sq. ft.
A1110-15	Day room north end 2' x 4' suspended ceiling tile	None detected	Yes	Fair	1,100 sq. ft.
A1110-16	Mail room north end Sand color with brown and white 9" x 9" floor tile	Tile - 2% Chrysotile Mastic - 3% Chrysotile	No	Good	3,200 sq. ft.
A1110-17	Room 101A north end Brown with white and orange streaks 9" x 9" floor tile	Tile - 8% Chrysotile Mastic - None detected	No	Fair	200 sq. ft.
A1110-18	Corridor north end Beige with gray streaks 9" x 9" floor tile	Tile - 1-2% Chrysotile Mastic - 12% Chrysotile	No	Fair	5,200 sq. ft.
A1110-19	Room 101A north end Sprayed on acoustical ceiling material	8% Chrysotile	Yes	Fair	5,000 sq. ft.
A1110-20	Corridor south end Mustard color with brown flecks 12" x 12" floor tile	<1% Chrysotile	No	Fair	100 sq. ft.
A1110-21	Corridor south end Drywall and tape	None detected	Yes	Fair	30,000 sq. ft.
A1110-22	Room south end Sprayed on acoustical ceiling material	6% Chrysotile	Yes	Fair	5,000 sq. ft.
A1110-23	Corridor outside restroom Off-white 12" x 12" floor tile	Tile - None detected Mastic - 4% Chrysotile	No	Fair	200 sq. ft.
A1110-24	1st floor north end Black baseboard	None detected	No	Fair	1,300 lin. ft.

It is assumed that anywhere the above identified asbestos containing building materials are found in the building, that those materials also contain asbestos and should be treated as such.

Asbestos Bulk Sampling Log
NAF Midway

THE SZARAS COMPANIES

 DATE SAMPLES COLLECTED: November 10, 1993

Building Number	Building Name	Building Description
579	Barracks	2 Story
TSC Project Number	**TSC Inspector**	**TSC Laboratory ID No.**
865	J. Kain and B. Kain	112393G

Sample ID No	Sample Location / Description	Analytical Results	Friable	Condition	Amount
A1110-25	Room 202 north end 2nd floor Black 9" x 9" floor tile	Tile - 2% Chrysotile Mastic - <1% Chrysotile	No	Fair	17,000 sq. ft.
	Note: Black floor tile found under other tiles with layer of wood between them - ref. to sample A1110-25, this building				
A1110-26	Room 208, 2nd floor Sprayed on acoustical ceiling material	10% Chrysotile	Yes	Fair	5,000 sq. ft.
A1110-27	Corridor south end 2nd floor 2' x 4' suspended ceiling tile	None detected	Yes	Fair	1,100 sq. ft.
A1110-28	1st floor Stairtread	None detected	No	Fair	100 sq. ft.
No sample collected	Roof Roof core Same as sample A1110-37, building 578	None detected	No	Good	8,500 sq. ft.

assumed that anywhere the above identified asbestos containing building materials are found in the building, that those erials also contain asbestos and should be treated as such.

LEAD BASED PAINT SAMPLING LOG
NAF MIDWAY

THE SZARAS COMPANIES

 DATE SAMPLES COLLECTED: November 10, 1993

BUILDING NUMBER	BUILDING NAME	BUILDING DESCRIPTION
579	Barracks	2 Story
TSC PROJECT NUMBER	**TSC INSPECTOR**	**TSC LABORATORY ID NO.**
865	J. Kain and B. Kain	112393C

SAMPLE ID NO	SAMPLE LOCATION / DESCRIPTION	ANALYTICAL RESULTS (PPM)	CONDITION	AMOUNT
	EXTERIOR:			
L1110-11	Steps north end 1st floor Red deck paint	17,287.2	Poor	3,500 sq. ft.
L1110-12	North end 1st floor Off-white paint on wall	26,461.0	Good	12,000 sq. ft.
L1110-13	North end 1st floor Brown paint on door	274.2	Good	1,200 sq. ft.
L1110-37	Air handler north side Silver paint on air handler	31,134.0	Fair	250 sq. ft.
	INTERIOR:			
L1110-14	Room 109 south end 1st floor Yellow paint on door frame	28,020.8	Poor	400 sq. ft.
L1110-15	Room 109 south end 1st floor Black paint on door frame	51,630.4	Poor	940 sq. ft.
L1110-16	East of day room north end Peach paint on wall	512.8	Fair	1,500 sq. ft.
L1110-17	Day room north end White paint on wall	210.7	Fair	3,600 sq. ft.
L1110-18	Day room north end Blue paint on door frame	2,275.3	Fair	1,000 sq. ft.
L1110-19	Room 102 north end Beige paint on door frame	14,770.4	Fair	18,600 sq. ft.
L1110-20	Room 101A north end Green paint on door frame	4,303.9	Fair	1,000 sq. ft.

It is assumed that anywhere the above identified lead based paint materials are found in the building, that those materials also contain lead and should be treated as such.

LEAD BASED PAINT SAMPLING LOG
NAF MIDWAY

THE SZARAS COMPANIES

 DATE SAMPLES COLLECTED: November 10, 1993

BUILDING NUMBER	BUILDING NAME	BUILDING DESCRIPTION
579	Barracks	2 Story
TSC PROJECT NUMBER	**TSC INSPECTOR**	**TSC LABORATORY ID NO.**
865	J. Kain and B. Kain	N/A

SAMPLE ID NO	SAMPLE LOCATION / DESCRIPTION	ANALYTICAL RESULTS (PPM)	CONDITION	AMOUNT
L1110-21	Laundry room northeast end Blue paint on wall	673.4	Fair	600 sq. ft.
L1110-22	Room 107 south end Blue/green paint on wall	438.5	Fair	600 sq. ft.
L1110-23	Room 108 south end Red paint on door frame	20,478.7	Fair	200 sq. ft.
L1110-24	Stairwell 1st floor Black paint	243.5	Fair	400 sq. ft.
No sample collected	1st floor Beige paint on overhead deck Same as sample L1110-35, building 578	6,641.4	Fair	19,000 sq. ft.

assumed that anywhere the above identified lead based paint materials are found in the building, that those materials o contain lead and should be treated as such.

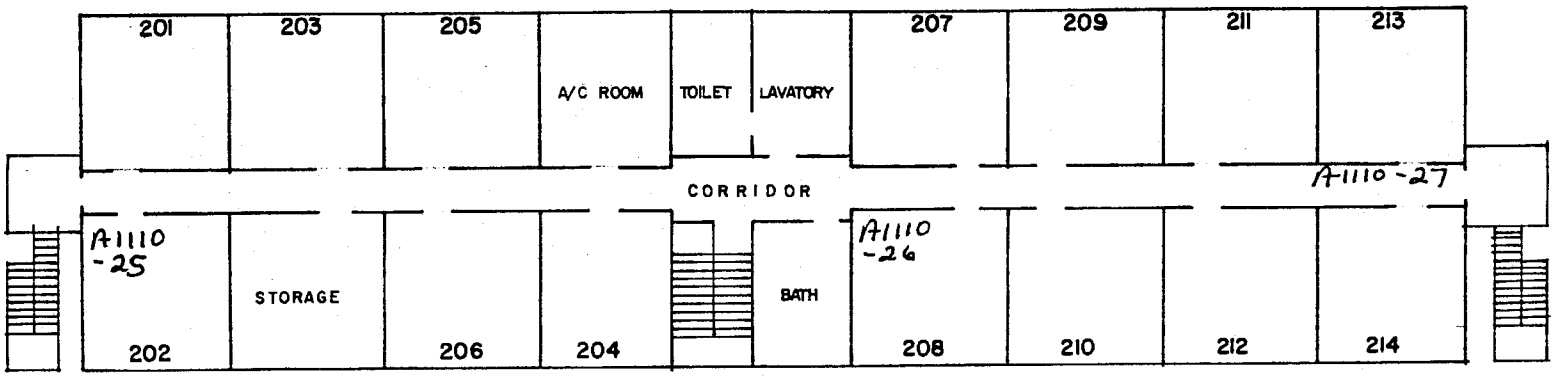

SECOND FLOOR PLAN

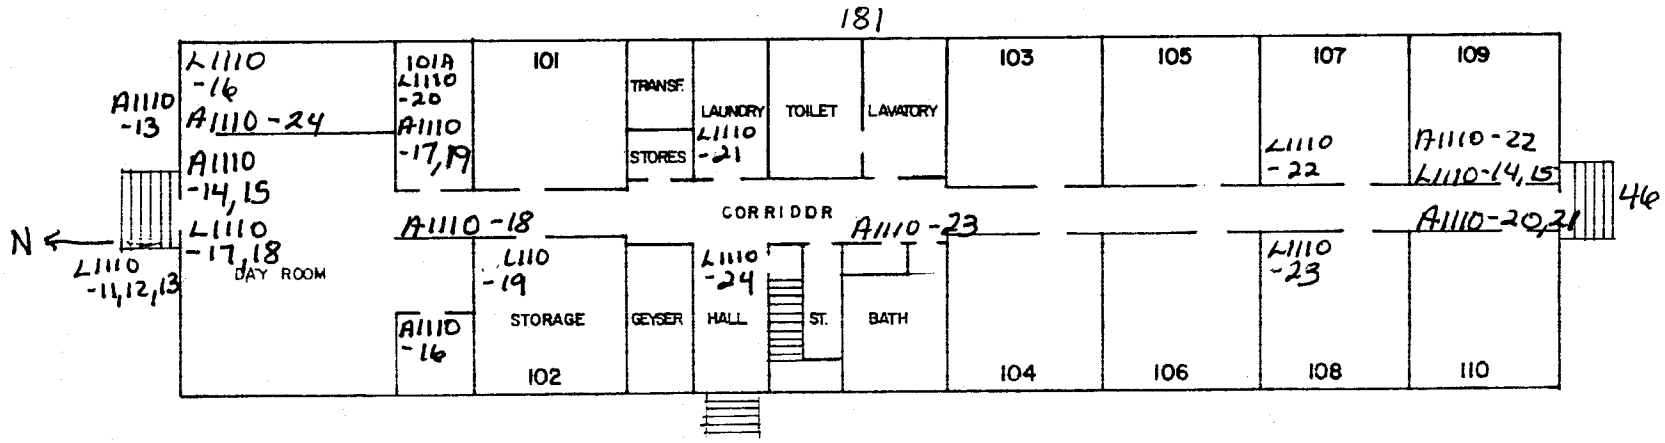

FIRST FLOOR PLAN

PIQUNIQ MANAGEMENT CORPORATION
NAVAL AIR FACILITY- MIDWAY ISLAND
BARRACKS BLDG. NO. 579

ASBESTOS BULK SAMPLING LOG
NAF MIDWAY

THE SZARAS COMPANIES

 DATE SAMPLES COLLECTED: November 12, 1993

BUILDING NUMBER	BUILDING NAME	BUILDING DESCRIPTION
580	Hazardous Material Storage Shed	1 Story
TSC PROJECT NUMBER	**TSC INSPECTOR**	**TSC LABORATORY ID NO.**
865	J. Kain and B. Kain	N/A

SAMPLE ID NO	SAMPLE LOCATION / DESCRIPTION	ANALYTICAL RESULTS	FRIABLE	CONDITION	AMOUNT
No sample collected	Roof Corrugated transite panel on roof	Transite is known to contain asbestos	No	Good	250 sq. ft.

It is assumed that anywhere the above identified asbestos containing building materials are found in the building, that those materials also contain asbestos and should be treated as such.

LEAD BASED PAINT SAMPLING LOG
NAF MIDWAY

THE SZARAS COMPANIES

 DATE SAMPLES COLLECTED: November 10, 1993

BUILDING NUMBER	BUILDING NAME	BUILDING DESCRIPTION
580	Hazardous Material Storage Shed	1 Story
TSC PROJECT NUMBER	**TSC INSPECTOR**	**TSC LABORATORY ID NO.**
865	J. Kain and B. Kain	N/A

SAMPLE ID NO	SAMPLE LOCATION / DESCRIPTION	ANALYTICAL RESULTS (PPM)	CONDITION	AMOUNT
No sample collected	No paint inside or outside	N/A		

is assumed that anywhere the above identified lead based paint materials are found in the building, that those materials contain lead and should be treated as such.

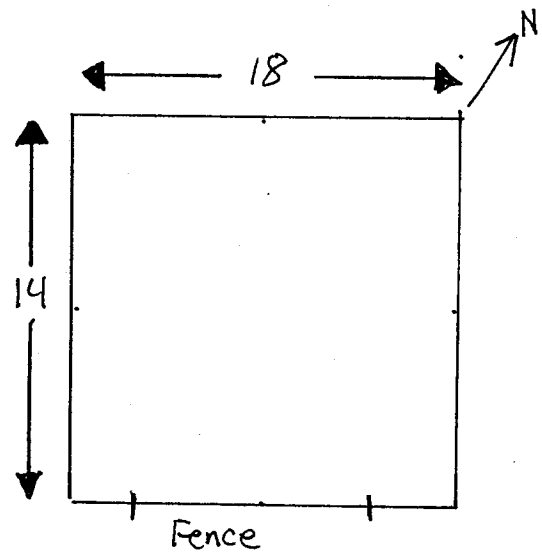

BLDG.# 580 Hazardous Materials Storage Shed

ASBESTOS BULK SAMPLING LOG
NAF MIDWAY

THE SZARAS COMPANIES

 DATE SAMPLES COLLECTED: November 10, 1993

BUILDING NUMBER	BUILDING NAME	BUILDING DESCRIPTION
586	Crash Fire Rescue	1 Story
TSC PROJECT NUMBER	**TSC INSPECTOR**	**TSC LABORATORY ID NO.**
865	J. Kain and B. Kain	112393G

SAMPLE ID NO	SAMPLE LOCATION / DESCRIPTION	ANALYTICAL RESULTS	FRIABLE	CONDITION	AMOUNT
	INTERIOR:				
A1110-1	Southwest end Green with beige flecks 9" x 9" floor tile	Tile - 10% Chrysotile Mastic - 6% Chrysotile	No	Poor	7,000 sq. ft. mixed with the following Samples: A1110-1, 2, 3, 4, 5, 6, 7 and 8
A1110-2	Southwest end Black 9" x 9" floor tile	Tile - 8% Chrysotile Mastic - None detected	No	Poor	
A1110-3	Southwest end Red 9" x 9" floor tile (over A1110-2)	Tile - 12% Chrysotile Mastic - None detected	No	Poor	
A1110-4	Northwest end Green 9" x 9" floor tile	Tile - 3% Chrysotile Mastic - 2% Chrysotile	No	Poor	See A1110-1
A1110-5	Northwest end Beige with orange 12" x 12" floor tile on top of A1110-4	<1% Chrysotile	No	Poor	See A1110-1
A1110-6	Restroom north end Beige 12" x 12" floor tile	<1% Chrysotile	No	Poor	See A1110-1
A1110-7	Restroom north end Brown 12" x 12" floor tile	Tile - 8% Chrysotile Mastic - None detected	No	Poor	See A1110-1
A1110-8	Outside restroom north end Red 9" x 9" floor tile	Tile - 5% Chrysotile Mastic - None detected	No	Poor	See A1110-1
A1110-9	Debris Garlock 3000 (gasket)	None detected	No	Poor	10 sq. ft.
A1110-10	West end Concrete wall	None detected	No	Poor	5,000
A1110-11	South end Drywall	None detected	Yes	Poor	3,000 sq. ft.
A1110-12	West Corrugated transite siding	30% Chrysotile	No	Fair	3,000 sq. ft.

It is assumed that anywhere the above identified asbestos containing building materials are found in the building, that those materials also contain asbestos and should be treated as such.

LEAD BASED PAINT SAMPLING LOG
NAF MIDWAY

THE SZARAS COMPANIES

 DATE SAMPLES COLLECTED: November 10, 1993

BUILDING NUMBER	BUILDING NAME	BUILDING DESCRIPTION
586	Crash Fire Rescue	1 Story
TSC PROJECT NUMBER	**TSC INSPECTOR**	**TSC LABORATORY ID NO.**
865	J. Kain and B. Kain	112393C

SAMPLE ID NO	SAMPLE LOCATION / DESCRIPTION	ANALYTICAL RESULTS (PPM)	CONDITION	AMOUNT
	INTERIOR:			
L1110-1	South side Dark blue paint on wall	396.6	Fair	400 sq. ft.
L1110-2	South side Green paint on wall	8,145.2	Poor	8,000 sq. ft.
L1110-3	Southeast side White paint on wall	13,252.7	Poor	1,200 sq. ft.
L1110-4	North side White over green paint on wall	2,070.1	Poor	2,500 sq. ft.
L1110-5	North side Black paint on wall	40,390.6	Poor	2,000 sq. ft.
L1110-6	North side Blue paint on door jamb	218,831.5	Poor	75 sq. ft.
L1110-7	Restroom north side Blue paint on wall	10,184.2	Poor	700 sq. ft.
L1110-8	Restroom north side Beige paint on wall	1,887.4	Poor	500 sq. ft.
L1110-9	West wall Red and white paint	17,842.1	Poor	8,000 sq. ft.
L1110-10	Southwest wall White with blue paint	10,263.1	Poor	2,000 sq. ft.

. is assumed that anywhere the above identified lead based paint materials are found in the building, that those materials contain lead and should be treated as such.

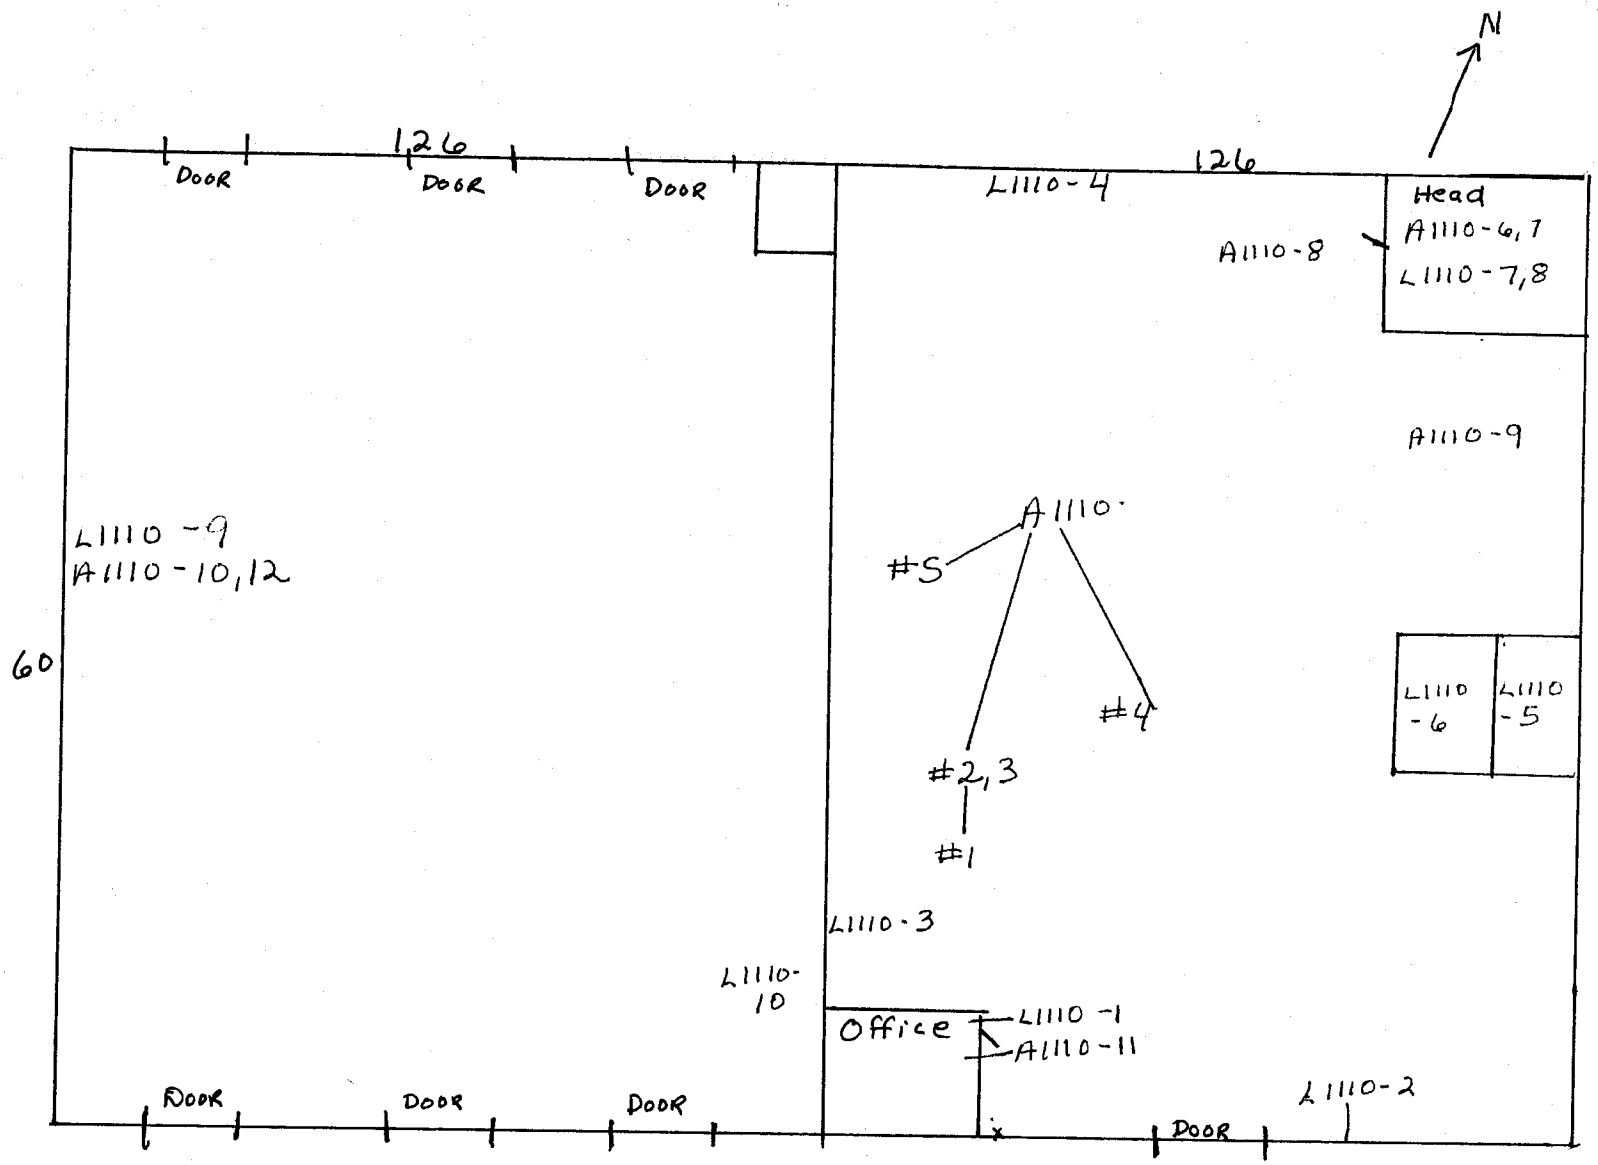

BLDG. #586 Crash Fire Rescue

Asbestos Bulk Sampling Log
NAF Midway

THE SZARAS COMPANIES

 DATE SAMPLES COLLECTED: November 9, 1993

Building Number	Building Name	Building Description
594	Storage Room	1 Story
TSC Project Number	**TSC Inspector**	**TSC Laboratory ID No.**
865	J. Kain and B. Kain	1123931

Sample ID No	Sample Location / Description	Analytical Results	Friable	Condition	Amount
A1109-7	Interior northwest side Gray 9" x 9" floor tile	Tile - 6% Chrysotile Mastic - 10% Chrysotile	No	Poor	240 sq. ft.
A1109-8	Interior south side Red 9" x 9" floor tile	Tile - 4% Chrysotile Mastic - 3% Chrysotile	No	Poor	100 sq. ft.

" is assumed that anywhere the above identified asbestos containing building materials are found in the building, that those aterials also contain asbestos and should be treated as such.

LEAD BASED PAINT SAMPLING LOG
NAF MIDWAY

THE SZARAS COMPANIES

DATE SAMPLES COLLECTED: November 9, 1993

BUILDING NUMBER	BUILDING NAME	BUILDING DESCRIPTION
594	Storage Room	1 Story
TSC PROJECT NUMBER	**TSC INSPECTOR**	**TSC LABORATORY ID NO.**
865	J. Kain and B. Kain	112393H

SAMPLE ID NO	SAMPLE LOCATION / DESCRIPTION	ANALYTICAL RESULTS (PPM)	CONDITION	AMOUNT
L1109-26	Interior north wall Green paint	875.3	Poor	800 sq. ft.
L1109-27	Interior west wall White paint on trim	339,898.9	Poor	700 sq. ft.
No sample collected	Exterior Silver paint Same as sample L1109-23, building 596	1,169.4	Fair	2,600 sq. ft.

is assumed that anywhere the above identified lead based paint materials are found in the building, that those materials contain lead and should be treated as such.

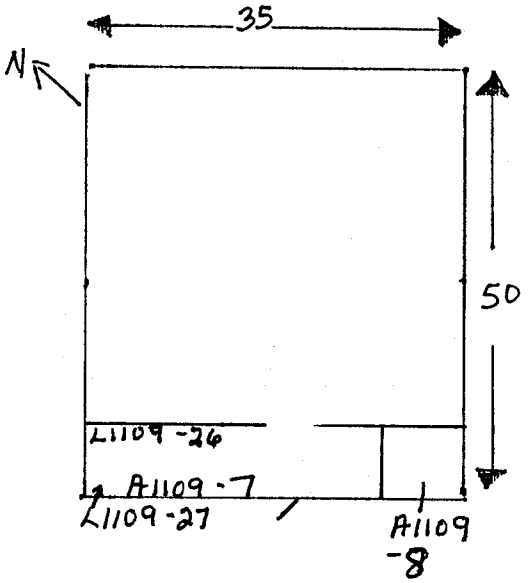

BLDG. # 594 Storage Room

ASBESTOS BULK SAMPLING LOG
NAF MIDWAY

THE SZARAS COMPANIES

 DATE SAMPLES COLLECTED: November 9, 1993

BUILDING NUMBER	BUILDING NAME	BUILDING DESCRIPTION
595	607 Supply Squadron Hangar	1 Story
TSC PROJECT NUMBER	**TSC INSPECTOR**	**TSC LABORATORY ID NO.**
865	J. Kain and B. Kain	N/A

SAMPLE ID NO	SAMPLE LOCATION / DESCRIPTION	ANALYTICAL RESULTS	FRIABLE	CONDITION	AMOUNT
No sample collected	No suspect ACM	N/A			

It is assumed that anywhere the above identified asbestos containing building materials are found in the building, that those materials also contain asbestos and should be treated as such.

LEAD BASED PAINT SAMPLING LOG
NAF MIDWAY

THE SZARAS COMPANIES

 DATE SAMPLES COLLECTED: November 9, 1993

BUILDING NUMBER	BUILDING NAME	BUILDING DESCRIPTION
595	607 Supply Squadron Hangar	1 Story
TSC PROJECT NUMBER	**TSC INSPECTOR**	**TSC LABORATORY ID NO.**
865	J. Kain and B. Kain	112393H

SAMPLE ID NO	SAMPLE LOCATION / DESCRIPTION	ANALYTICAL RESULTS (PPM)	CONDITION	AMOUNT
L1109-28	Interior south side Celery green paint on door (entire interior)	5,065.8	Fair	13,000 sq. ft.
L1109-25	Exterior south side Gray paint on door (entire roof and building)	767.2	Poor	13,000 sq. ft.

is assumed that anywhere the above identified lead based paint materials are found in the building, that those materials contain lead and should be treated as such.

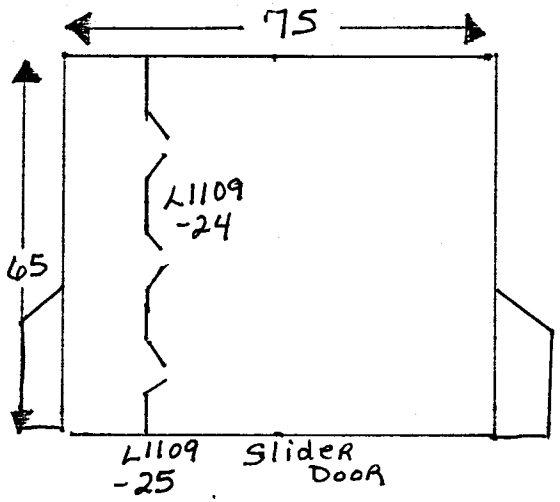

Bld # 595
607th Supply
Squadron
Hanger

Asbestos Bulk Sampling Log
NAF Midway

THE SZARAS COMPANIES

 DATE SAMPLES COLLECTED: November 9, 1993

Building Number	Building Name	Building Description
596	607 FWD Supply Squadron	1 Story
TSC Project Number	**TSC Inspector**	**TSC Laboratory ID No.**
865	J. Kain and B. Kain	N/A

Sample ID No	Sample Location / Description	Analytical Results	Friable	Condition	Amount
No sample collected	No suspect ACM	N/A			

"It is assumed that anywhere the above identified asbestos containing building materials are found in the building, that those materials also contain asbestos and should be treated as such.

LEAD BASED PAINT SAMPLING LOG
NAF MIDWAY

THE SZARAS COMPANIES

 DATE SAMPLES COLLECTED: November 9, 1993

BUILDING NUMBER	BUILDING NAME	BUILDING DESCRIPTION
596	607 FWD Squadron Supply	1 Story
TSC PROJECT NUMBER	**TSC INSPECTOR**	**TSC LABORATORY ID NO.**
865	J. Kain and B. Kain	112393H

SAMPLE ID NO	SAMPLE LOCATION / DESCRIPTION	ANALYTICAL RESULTS (PPM)	CONDITION	AMOUNT
L1109-21	Interior west wall Light green paint	522.0	Poor	2,800 sq. ft.
L1109-22	Interior west wall Red paint	2,357.8	Poor	25 sq. ft.
L1109-23	Exterior west wall Silver paint	1,169.4	Poor	2,800 sq. ft.

is assumed that anywhere the above identified lead based paint materials are found in the building, that those materials contain lead and should be treated as such.

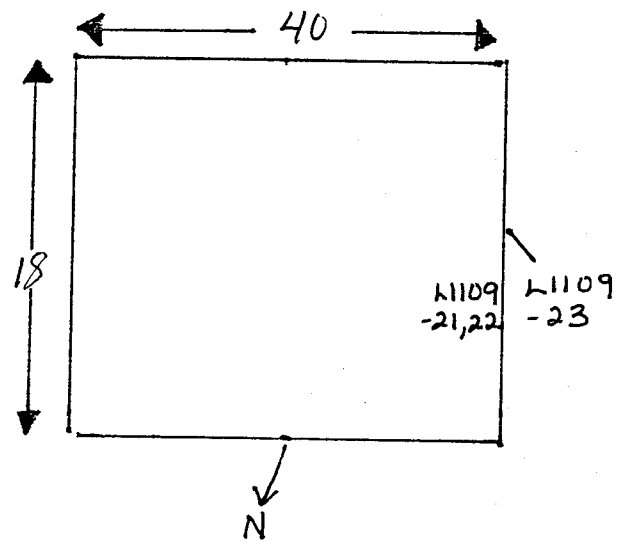

BLDG.# 596 607 Supply Squadron

FWD Supply